



Designation: **E251–20 E251 – 20a**

Standard Test Methods for Performance Characteristics of Metallic Bonded Resistance Strain Gages¹

This standard is issued under the fixed designation E251; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

This standard has been approved for use by agencies of the U.S. Department of Defense.

INTRODUCTION

The Organization of International Legal Metrology is a treaty organization with approximately ~~75 member~~ 75 member nations. In 1984, OIML issued International Recommendation No. 62, “Performance Characteristics of Metallic Resistance Strain Gages.” Test Methods E251 has been modified and expanded to be the United States of America’s compliant test specification. Throughout this standard the terms “~~strain gage~~” and “~~gage~~” are to be understood to represent term “strain gage” represents the longer, but more accurate, “metallic bonded resistance strain gages.”gage.”

1. Scope

1.1 The purpose of these test methods are to provide uniform test methods for the determination of strain gage performance characteristics. Suggested testing equipment designs are included.

1.2 Test Methods E251 describes methods and procedures for determining five strain gage ~~parameters:~~performance characteristics:

	Section
Part I—General Requirements	7
Part II—Resistance at a Reference Temperature	8
Part III—Gage Factor at a Reference Temperature	9
Part IV—Temperature Coefficient of Gage Factor	10
Part V—Transverse Sensitivity	11
Part VI—Thermal Output	12

1.3 Strain gages are very sensitive devices with essentially infinite resolution. Their response to strain, however, is low and great care must be exercised in their use. The performance characteristics identified by these test methods must be known to an acceptable accuracy to obtain meaningful results in field applications.

1.3.1 Strain gage resistance is used to balance instrumentation circuits and to provide a reference value for measurements since all data are related to a change in the strain gage resistance from a known reference value.

1.3.2 Gage factor is the transfer function of a strain gage. It relates resistance change in the strain gage and strain to which it is subjected. Accuracy of strain gage data can be no better than the ~~precision~~accuracy of the gage factor.

1.3.3 Changes in gage factor as temperature varies also affect accuracy although to a much lesser degree since variations are usually small.

1.3.4 Transverse sensitivity is a measure of the strain gage’s response to strains perpendicular to its measurement axis. Although transverse sensitivity is usually much less than 10 % of the gage factor, large errors can occur if the value is not known with reasonable precision.

1.3.5 Thermal output is the response of a strain gage to temperature changes. Thermal output is an additive (not multiplicative) error. Therefore, it can often be much larger than the strain gage output from structural loading. To correct for these effects, thermal output must be determined from strain gages bonded to specimens of the same material on which the tests are to run, often to the test structure itself.

¹ These test methods are under the jurisdiction of ASTM Committee E28 on Mechanical Testing and are the direct responsibility of Subcommittee E28.01 on Calibration of Mechanical Testing Machines and Apparatus.

Current edition approved ~~May 1, 2020~~ June 1, 2020. Published August 2020. Originally approved in 1964. Last previous edition approved in 2014 as E251 – 92 (2014). DOI: ~~10.1520/E0251-92R14~~ 10.1520/E0251-20A.

1.4 ~~Bonded~~ Metallic bonded resistance strain gages differ from extensometers in that they measure average unit elongation ($\Delta L/L$) over a nominal ~~gage~~gauge length rather than total elongation between definite gauge points. Practice **E83** is not applicable to these strain gages.

1.5 These test methods do not apply to transducers, such as load cells and extensometers, that use bonded resistance strain gages as sensing elements.

1.6 Strain gages are part of a complex system that includes structure, adhesive, strain gage, lead wires, instrumentation, and (often) environmental protection. As a result, many things affect the performance of strain gages, including user technique. A further complication is that strain gages once installed normally cannot be reinstalled in another location. Therefore, strain gage characteristics can be stated only on a statistical basis.

1.7 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety, health, and environmental practices and determine the applicability of regulatory limitations prior to use.*

1.8 *This international standard was developed in accordance with internationally recognized principles on standardization established in the Decision on Principles for the Development of International Standards, Guides and Recommendations issued by the World Trade Organization Technical Barriers to Trade (TBT) Committee.*

2. Referenced Documents

2.1 ASTM Standards:²

[E6 Terminology Relating to Methods of Mechanical Testing](#)

[E83 Practice for Verification and Classification of Extensometer Systems](#)

[E228 Test Method for Linear Thermal Expansion of Solid Materials With a Push-Rod Dilatometer](#)

[E289 Test Method for Linear Thermal Expansion of Rigid Solids with Interferometry](#)

[E1237 Guide for Installing Bonded Resistance Strain Gages](#)

2.2 Other Standards:³

[OIML International Recommendation No. 62 Performance Characteristics of Metallic Resistance Strain Gages](#)

3. Terminology

3.1 The vocabulary included ~~herein~~ in these test methods have been chosen so that specialized terms in the strain gage field are clearly defined. A typical strain gage nomenclature is provided in **Appendix X1**.

3.2 ~~Definitions of Terms Specific to This Standard~~: Definitions: Terms Common to Mechanical Testing:

3.2.1 The terms accuracy, extensometer, extensometer system, lead wire, Poisson's ratio, precision, reduced section, residual stress, resolution, and verification are used as defined in Terminology **E6**. In addition, the following terms common to strain gages from Terminology **E6** are defined.

3.2.2 ~~batch~~ batch, n—for strain gages, a group of strain gages of the same type and lot, manufactured as a set (made at the same time and under the same conditions).

3.2.2 ~~calibration apparatus~~ —equipment for determining a characteristic of a bonded resistance strain gage by accurately producing the necessary strains, temperatures, and other conditions; and, by accurately measuring the resulting change of gage resistance.

3.2.3 ~~error strain gage~~ —the value obtained by subtracting the actual value of the strain, determined from the calibration apparatus, from the indicated value of the strain given by the strain gage output.

3.2.3.1 ~~Discussion~~—

~~Errors attributable to measuring systems are excluded.~~

3.2.3 ~~gage factor~~ —factor, n—for strain gages, the ratio between the unit change in strain gage resistance due to strain and the causing strain.

3.2.3.1 ~~Discussion~~—

The gage factor is dimensionless and is expressed as follows:

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

³ Available from OIML International Organization of Legal Metrology, BIML, 11, rue Turgot, F-75009 Paris, France, <http://www.oiml.org/en>

$$K = \frac{\frac{R - R_0}{R_0}}{\frac{L - L_0}{L_0}} = \frac{\frac{\Delta R}{R_0}}{\varepsilon} \quad (1)$$

where:

K = the gage factor,

R = the strain gage resistance at test strain,

R_0 = the strain gage resistance at test strain

L = the test structure length under the strain gage at test strain,

L_0 = the test structure length under the strain gage at zero or reference strain,

ΔR = the change in strain gage resistance when strain is changed from zero (or reference strain to test strain),

$\frac{\Delta R}{R_0}$ = the change in strain gage resistance when strain is changed from zero (or reference strain to test strain),

ε = the mechanical strain $\frac{L - L_0}{L_0}$.

ε = the mechanical strain $\frac{L - L_0}{L_0}$.

ε = the mechanical strain $\frac{L - L_0}{L_0}$.

3.2.4 *gage length*—lead wire, n —(see for Fig. 1)—the length of the strain sensitive strain gages, section of an electrical conductor used to connect a strain gage in the measurement axis direction to its instrumentation.

3.2.5.1 Discussion

An approximation of this length is the distance between the inside of the strain gage end loops. Since the true gage length is not known, gage length may be measured by other geometries (such as the outside of the end loops) providing that the deviation is defined.

3.2.6 *grid* (see Fig. 1)—that portion of the strain-sensing material of the strain gage that is primarily responsible for resistance change due to strain.

3.2.5 *lot*—lot, n —for strain gages, a group of strain gages with grid elements from a common melt, subjected to the same mechanical and thermal processes during manufacturing.

3.2.8 *matrix*—(see Fig. 1)—an electrically nonconductive layer of material used to support a strain gage grid.

3.2.8.1 Discussion

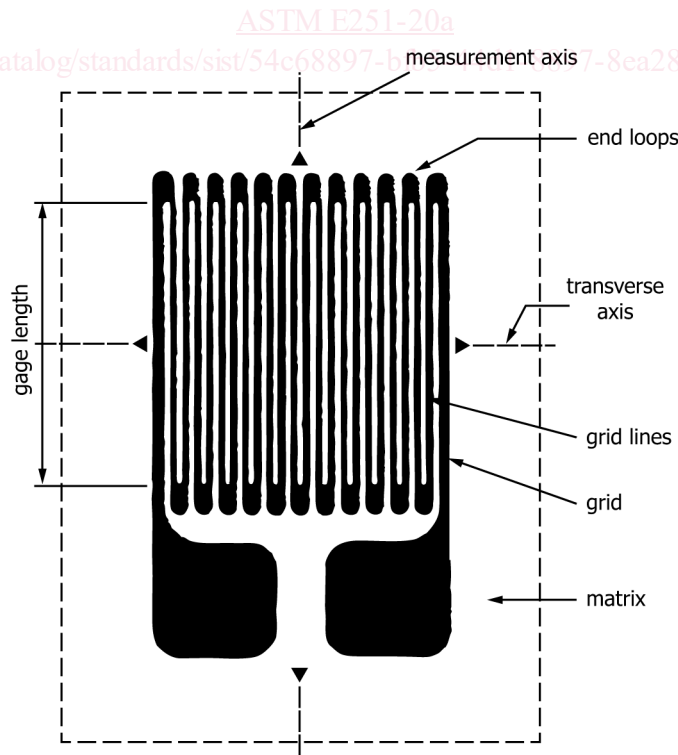


FIG. 1 Typical Strain Gage

The two main functions of a matrix are to act as an aid for bonding the strain gage to a structure and as an electrically insulating layer in cases where the structure is electrically conductive:

3.2.9 *measurement axis (grid)* (see Fig. 1)—that axis that is parallel with the grid lines:

3.2.6 *metallic resistance bonded strain gage, metallic, n—resistive, bonded* (see Fig. 1)—a resistive element, with or without a matrix that is attached to a solid body by cementing, welding, or other suitable techniques so that the resistance of the element will vary as the surface to which it is attached is deformed.

3.2.6.1 *Discussion*—

These test methods apply to gages where the instantaneous gage resistance, R , is given by the equation:

$$R = R_0(1 + \varepsilon K) \quad (2)$$

$$R = R_0(1 + \varepsilon K) \quad (2)$$

where:

R_0 = element resistance at reference strain and temperature levels (frequently initial test or balanced circuit conditions);
 ε = linear strain of the surface in the direction of the strain-sensitive axis of the gage, and
 K = a proportionality factor (see gage factor):

R_0 = element resistance at reference strain and temperature levels (frequently initial test or balanced circuit conditions),
 ε = linear strain of the surface in the direction of the measurement axis of the strain gage produced either by a stress field (mechanical strain) or by a temperature change (thermal expansion), and
 K = the gage factor.

3.2.11 *strain, linear*—the unit elongation induced in a specimen either by a stress field (mechanical strain) or by a temperature change (thermal expansion):

3.2.12 *temperature coefficient of gage factor*—the ratio of the unit variation of gage factor to the temperature variation, expressed as follows:

$$\left(\frac{K_{T1} - K_{T0}}{K_{T0}} \right) \left(\frac{1}{T_1 - T_0} \right) \quad (3)$$

where:

T_1 = the test temperature,
 T_0 = the reference temperature,
 K_{T1} = the gage factor at test temperature, and
 K_{T0} = the gage factor at reference temperature:

3.2.13 *thermal expansion*—the dimensional change of an unconstrained specimen subject to a change in temperature that is uniform throughout the material:

3.2.14 *thermal output*—the reversible part of the temperature induced indicated strain of a strain gage installed on an unrestrained test specimen when exposed to a change in temperature:

3.2.15 *transverse axis* (see Fig. 1)—the strain gage axis at 90° to the measurement axis:

3.2.16 *transverse sensitivity*—the ratio, expressed as a percentage, of the unit change of resistance of a strain gage mounted perpendicular to a uniaxial strain field (transverse gage) to the unit resistance change of a similar gage mounted parallel to the same strain field (longitudinal gage):

3.2.7 *type—type, n—for strain gages*, a group of strain gages that are nominally identical with respect to physical and manufacturing characteristics.

3.3 Definitions of Terms Specific to This Standard:

3.3.1 *calibration apparatus, n*—equipment for determining a performance characteristic of a metallic bonded resistance strain gage by accurately producing the necessary strains, temperatures, and other conditions and by accurately measuring the resulting change of strain gage resistance.

3.3.2 *error, n—for strain gages*, the value obtained by subtracting the actual value of the strain, determined from the calibration apparatus, from the indicated value of the strain given by the strain gage output.

3.3.2.1 *Discussion*—

Errors attributable to measuring systems are excluded.

3.3.3 *gage length, n*—(see Fig. 1)—the length of the strain sensitive section of a strain gage in the measurement axis direction.

3.3.3.1 Discussion—

An approximation of the gage length is the distance between the inside of the strain gage end loops. Since the true gage length is not known, gage length may be measured by other geometries (such as the outside of the end loops) providing that the deviation is defined.

3.3.4 *grid, n*—(see Fig. 1)—that portion of the strain-sensing material of the strain gage that is primarily responsible for resistance change due to strain.

3.3.5 *matrix, n*—(see Fig. 1)—an electrically nonconductive layer of material used to support a strain gage grid.

3.3.5.1 Discussion—

The two main functions of a matrix are to act as an aid for bonding the strain gage to a structure and as an electrically insulating layer in cases where the structure is electrically conductive.

3.3.6 *measurement axis, n*—(see Fig. 1)—the axis that is parallel with the grid lines.

3.3.7 *strain gage, n*—the term “strain gage” is equivalent to the longer, but more accurate, “metallic bonded resistance strain gage.”

3.3.8 *temperature coefficient of gage factor*—the ratio of the unit variation of gage factor to the temperature variation, expressed as follows:

$$\left(\frac{K_{t1} - K_{t0}}{K_{t0}}\right)\left(\frac{1}{T_1 - T_0}\right) \quad (3)$$

where:

T_1 = the test temperature,

T_0 = the reference temperature,

K_{t1} = the gage factor at test temperature, and

K_{t0} = the gage factor at reference temperature.

3.3.9 *thermal expansion*—the dimensional change of an unconstrained specimen subject to a change in temperature that is uniform throughout the material.

3.3.10 *thermal output*—the reversible part of the temperature induced indicated strain of a strain gage installed on an unrestrained test specimen when exposed to a change in temperature.

3.3.11 *transverse axis* (see Fig. 1)—the strain gage axis at 90° to the measurement axis.

3.3.12 *transverse sensitivity*—the ratio, expressed as a percentage, of the unit change of resistance of a strain gage mounted perpendicular to a uniaxial strain field (transverse strain gage) to the unit resistance change of a similar gage mounted parallel to the same strain field (longitudinal strain gage).

4. Significance and Use

4.1 Strain gages are the most widely used devices for the determination of materials, properties and for analyzing stresses in structures. However, performance parameters/characteristics of strain gages are affected by both the materials from which they are made and their geometric design. These test methods detail the minimum information that must accompany strain gages if they are to be used with acceptable accuracy of measurement.

4.2 Most performance parameters/characteristics of strain gages require mechanical testing that is destructive. Since test strain gages cannot be used again, it is necessary to treat data statistically and then apply values to the remaining population from the same lot or batch. Failure to acknowledge the resulting uncertainties can have serious repercussions. Resistance measurement is non-destructive and can be made for each strain gage.

4.3 Properly designed and manufactured strain gages, whose properties—performance characteristics have been accurately determined and with appropriate uncertainties applied, represent powerful measurement tools. They can determine small dimensional changes in structures with excellent accuracy, far beyond that of other known devices. It is important to recognize, however, that individual strain gages cannot be calibrated. If calibration and traceability to a standard are required, strain gages should not be employed.

4.4 To be used, strain gages must be bonded to a structure. Good results depend heavily on the materials used to clean the bonding surface, to bond the strain gage, and to provide a protective coating. Skill of the installer is another major factor in success. Finally, instrumentation systems must be carefully designed to assure that they do not unduly degrade the performance of the strain gages. In many cases, it is impossible to achieve this goal. If so, allowance must be made when considering accuracy of data. Test

conditions can, in some instances, be so severe that error signals from strain gage systems far exceed those from the structural deformations to be measured. Great care must be exercised in documenting magnitudes of error signals so that realistic values can be placed on associated uncertainties.

5. Interferences

5.1 To assure that strain gage test data are within a defined accuracy, the strain gages must be properly bonded and protected with acceptable materials. It is normally simple to ascertain that strain gages are not performing properly. The most common symptom is instability with time or temperature change. If strain gages do not return to their zero reading when the original conditions are repeated, or there is low or changing resistance to ground, the installation is suspect. Aids in strain gage installation and verification thereof of strain gage can be found in Guide E1237.

6. Hazards

6.1 In the specimen surface cleaning, strain gage bonding, and protection steps of strain gage installation, hazardous chemicals may be used. Users of these test methods are responsible for contacting manufacturers of these chemicals for applicable Material Safety Data Sheets and to adhere to the required precautions.

7. Test Requirements

7.1 General Environmental Requirements:

7.1.1 *Ambient Conditions at Room Temperature*—The nominal temperature and relative humidity shall be 23 °C (73 °F) and 50 %, respectively. In no case shall the temperature be less than 18 °C (64 °F) nor greater than 25 °C (77 °F) and the relative humidity less than 35 % nor more than 60 %. The fluctuations during any room temperature test of any strain gage shall not exceed $\pm 2^\circ\text{C}$ and $\pm 5\%$ exceed $\pm 2^\circ\text{C}$ and $\pm 5\%$ RH.

7.1.2 *Ambient Conditions at Elevated and Lower Temperatures*—The temperature adjustment error shall not exceed $\pm 2^\circ\text{C}$ $\pm 2^\circ\text{C}$ ($\pm 3.6^\circ\text{F}$) or $\pm 2\%$ – $\pm 2\%$ of the deviation from room temperature, whichever is greater. The total uncertainty of temperature shall not exceed $\pm 2^\circ\text{C}$ ($\pm 3.6^\circ\text{F}$), or $\pm 1\%$ – $\pm 2^\circ\text{C}$ ($\pm 3.6^\circ\text{F}$), or $\pm 1\%$ of the deviation from room temperature, whichever is greater. At elevated temperatures the mixing ratio shall be constant, that means independent of temperature, at a nominal value of ~~0.009 g~~ 0.009 g of water per ~~1 g~~ 1 g of air at a pressure of ~~1 bar~~ 100 kPa (1 bar). This value corresponds to a relative humidity of 50 % at 23 °C (73 °F).

NOTE 1—This mixing ratio, independent of temperature, can be realized by a furnace that is well connected to an atmosphere meeting the conditions of 7.1.1.

7.2 Test Measurement Requirements:

7.2.1 Several methods are available for measuring the change of strain gage resistance with sufficient resolution and accuracy. In general, any of these methods that are convenient may be used after it has been shown that the particular combination of instruments or components used produce a system with the required accuracy.

7.2.2 Examples of potentially satisfactory methods are as follows:

7.2.2.1 *Balanced Bridge Circuit*—In this circuit, a change in strain gage resistance is matched by an equal unit resistance change in a calibrated arm of ~~the a~~ Wheatstone bridge circuit so as to produce a balanced condition with zero electrical output. This circuit is not sensitive to excitation voltage changes except for self-heating effects. A sensitive null detector (galvanometer) is required to obtain adequate resolution. Direct-current excitation is usually, but not necessarily, used. Thermal emfs generated within the circuit and reactive changes in the circuit may cause errors. This circuit is shown in Fig. 2.

7.2.2.2 *Unbalanced Bridge Circuit*—This circuit is similar to the Wheatstone unbalanced bridge circuit except that the bridge components are not adjusted after a nearly balanced initial condition is obtained. The output voltage of an unbalanced bridge circuit in which one arm is varying, E_o , is given by the equation:

$$E_o = E_i \left[\frac{\Delta R}{4R_o + 2\Delta R} \right] \tag{4}$$

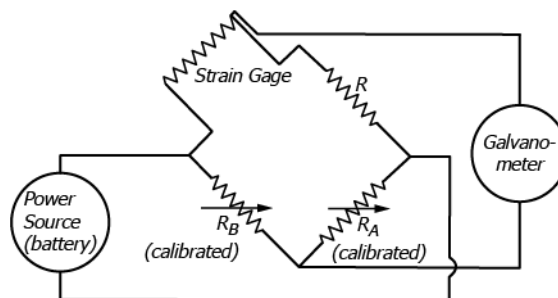


FIG. 2 Wheatstone-Bridge-Balanced Bridge Circuit

$$E_o = E_i \left[\frac{\Delta R}{4R_o + 2\Delta R} \right] \quad (4)$$

where:

- E_i = input voltage,
- R_o = resistance required for initial bridge balance, and
- ΔR = ~~difference between the instantaneous resistance and R_o .~~
- ΔR = difference between the instantaneous strain gage resistance and R_o .

This circuit is readily adaptable to automatic recording of data. Either ac or dc excitation may be used, but errors due to thermal emfs and reactive changes are possible. Loading effects due to the impedance of the recording instruments may be significant and must be considered. To avoid the necessity of accurate absolute measurement of the input and output voltages, the readout (recording) system may be calibrated in terms of unit resistance change of a bridge arm by use of a calibrating resistor that can be varied so that the total arm resistance changes in accurately known steps. This resistor should be in the opposite arm of the bridge circuit from the strain gage. This circuit is shown in Fig. 3.

7.2.2.3 Several types of instruments are available for obtaining strain data directly from a ~~resistance-strain gage~~. These instruments use various types of excitation and ~~read-out systems~~ system indicators. Such strain indicators may be used only after their resolution, accuracy, and stability have been verified by connecting a resistor that can be varied in accurately known increments in place of the strain gage and calibrating the strain indicator over the entire range for which it will be used. The calibrating resistor steps shall be accurate to 0.1 % of the resistance change or $2 \text{ ppm} \times 10^{-6}$ of the total resistance, whichever is greater. The effects of the following factors should be determined: thermal emf's within the bridge circuit and within the ~~leads~~ lead wires to the strain gage; reactive changes within the bridge and lead wire circuits; initial bridge unbalance; ~~and~~ and battery conditions or power line fluctuations.

7.3 Strain Gage Attachment:

7.3.1 The attachment conditions shall correspond exactly to the instructions published by the strain gage manufacturer.

8. Test Method for Determining Strain Gage Resistance at Ambient Conditions

8.1 The standard 23 °C (73 °F) temperature resistance of each unbonded strain gage shall be measured and stated. Alternatively, strain gages may be combined in sets (4, 5, or 10, for example) from the same batch that have close resistance values. All strain gages combined in sets shall fall within the stated nominal resistance value and uncertainty from all sources.

8.2 The unpackaged strain gages selected for testing should be stored under the ambient conditions described in 7.1.1 for at least 72 h before and during resistance measurement.

8.3 The uncertainty of the strain gage resistance measurement shall be less than ~~$\pm 0.1\%$~~ $\pm 0.1\%$. Repeated measurements shall have a range no greater than $\pm 0.04\%$ of the measured value. The influence of the measuring current on the strain gage shall not be greater than ~~$\pm 0.1\%$~~ $\pm 0.1\%$ of the resistance value.

8.4 For the resistance measurement no particular mechanical requirements are necessary. However, if the influence of the flatness of the strain gage on the resistance measurement exceeds ~~$\pm 0.1\%$~~ $\pm 0.1\%$ of the actual value, the strain gage must be held in contact with a substantially flat surface using a suitable pressing device. Care must be exercised to ~~assure~~ ensure that the probes used to contact the tabs of strain gages without ~~leads~~ lead wires do not damage foil areas.

9. Test Methods for Determining the Gage Factor of Resistance-Strain Gages at a Reference Temperature

9.1 These test methods describe procedures for the determination of the gage factor of ~~bonded~~ resistance-strain gages. It is suggested that gage factor values be obtained for at least five strain gage installations of one type.

9.2 For gage factor determination, the uncertainty of the relative resistance change measurement shall not exceed ~~$\pm 2 \mu\Omega$~~ $\pm 2 \mu\Omega$ or ~~$\pm 0.1\%$~~ $\pm 0.1\%$ of the actual value, whichever is greater. Any of the test methods described in Section 7 may be

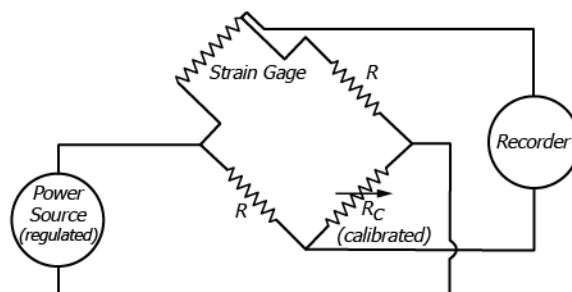


FIG. 3 Unbalanced Bridge Unbalanced Bridge Circuit

used. In addition, special circuits designed to compare the strain gages being tested to a calibrated reference strain gage may be used if it is shown that equal accuracy is obtained.

9.3 Determination of the gage factor K requires mechanical equipment calibration apparatus consisting of a test specimen and a loading device capable of producing a uniform uniaxial stress in the test specimen corresponding to nominal mean principal strain values of $\pm 1000 \mu\text{m/m}$ ($\mu\text{in./in.}$), $\pm 1000 \mu\text{m/m}$ ($\mu\text{in./in.}$) and $\pm 1100 \mu\text{m/m}$ ($\mu\text{in./in.}$). The Poisson's ratio of the test specimen shall be 0.28 ± 0.01 or suitable corrections must be made. The mean principal strain shall be within $\pm 50 \mu\text{m/m}$ ($\mu\text{in./in.}$) of the nominal value. The strain at the various strain gage stations shall differ by no more than $\pm 0.5\%$ of the mean value and the strain within a strain gage station shall vary by no more than $\pm 0.5\%$ of the nominal value. The uncertainty of the mean strain measurement shall be less than $\pm 2 \mu\text{m/m}$ ($\mu\text{in./in.}$) or $\pm 0.2\%$ of the actual value, whichever is greater. Any test apparatus that meets these criteria may be used for determination of gage factor.

9.4 To the extent possible, test specimens with attached strain gages for tests of the gage factor should be stored under the ambient conditions described in 7.1.1 for at least 72 h before being tested

9.5 For the determination of the gage factor, the strain gages under test should be prestrained three times with strain cycles similar to the ones used for the measurement, but with maximum strain levels about 10 % higher. That means that the loading strain cycle should nominally be:

$$\begin{aligned}
 &0 \mu\text{m/m}(\mu\text{in./in.}), \\
 &+1100 \mu\text{m/m}(\mu\text{in./in.}), \quad -1100 \mu\text{m/m}(\mu\text{in./in.}), \\
 &+1100 \mu\text{m/m}(\mu\text{in./in.}), \quad -1100 \mu\text{m/m}(\mu\text{in./in.}), \\
 &+1100 \mu\text{m/m}(\mu\text{in./in.}), \quad -1100 \mu\text{m/m}(\mu\text{in./in.}), \\
 &0 \mu\text{m/m}(\mu\text{in./in.}), \quad +1000 \mu\text{m/m}(\mu\text{in./in.}), \\
 &0 \mu\text{m/m}(\mu\text{in./in.}), \quad -1000 \mu\text{m/m}(\mu\text{in./in.}), \\
 &0 \mu\text{m/m}(\mu\text{in./in.}).
 \end{aligned} \tag{5}$$

If possible, one half of the group of strain gages to be tested should be strained this way and the other half of the sample should be subjected to strains of the same magnitude but opposite sign. The gage factor is determined from the slope of the straight line between the measurement points at $+1000 \mu\text{m/m}$ ($\mu\text{in./in.}$) and $-1000 \mu\text{m/m}$ ($\mu\text{in./in.}$). Although less desirable, it is permissible to use the strain cycles of:

$$0, +1100 \mu\text{m/m}(\mu\text{in./in.}), -1100 \mu\text{m/m}(\mu\text{in./in.}), \tag{5}$$

$$\begin{aligned}
 &+1100 \mu\text{m/m}(\mu\text{in./in.}), -1100 \mu\text{m/m}(\mu\text{in./in.}), \\
 &+1100 \mu\text{m/m}(\mu\text{in./in.}), -1100 \mu\text{m/m}(\mu\text{in./in.}), \\
 &0, +1000 \mu\text{m/m}(\mu\text{in./in.}), 0, -1000 \mu\text{m/m}(\mu\text{in./in.}), 0.
 \end{aligned} \tag{6}$$

$$\begin{aligned}
 &0 \mu\text{m/m}(\mu\text{in./in.}), +1100 \mu\text{m/m}(\mu\text{in./in.}), \\
 &0 \mu\text{m/m}(\mu\text{in./in.}), +1100 \mu\text{m/m}(\mu\text{in./in.}), \\
 &0 \mu\text{m/m}(\mu\text{in./in.}), +1100 \mu\text{m/m}(\mu\text{in./in.}), \\
 &0 \mu\text{m/m}(\mu\text{in./in.}), +1000 \mu\text{m/m}(\mu\text{in./in.}), \\
 &0 \mu\text{m/m}(\mu\text{in./in.}).
 \end{aligned} \tag{6}$$

for one half of the sample and strain cycles of:

$$\begin{aligned}
 &0 \mu\text{m/m}(\mu\text{in./in.}), \quad -1100 \mu\text{m/m}(\mu\text{in./in.}), \\
 &0 \mu\text{m/m}(\mu\text{in./in.}), \quad -1100 \mu\text{m/m}(\mu\text{in./in.}), \\
 &0 \mu\text{m/m}(\mu\text{in./in.}), \quad -1100 \mu\text{m/m}(\mu\text{in./in.}), \\
 &0 \mu\text{m/m}(\mu\text{in./in.}), \quad -1000 \mu\text{m/m}(\mu\text{in./in.}), \\
 &0 \mu\text{m/m}(\mu\text{in./in.}).
 \end{aligned} \tag{7}$$

for the other half of the sample.

If possible, one half of the sample (group of gages to be tested) should be strained this way and the other half of the sample should be subjected to strains of the same magnitude but opposite sign. The gage factor is determined from the slope of the straight line between the measurement points at $+1000 \mu\text{m/m}$ ($\mu\text{in./in.}$) and $-1000 \mu\text{m/m}$ ($\mu\text{in./in.}$). Although less desirable, it is permissible to use the strain cycles of:

$$0, +1100 \mu\text{m/m}(\mu\text{in./in.}), 0, +1100 \mu\text{m/m}(\mu\text{in./in.}), \tag{6}$$

$$0, +1100 \mu\text{m/m}(\mu\text{in./in.}), 0, +1000 \mu\text{m/m}(\mu\text{in./in.}), 0$$

for one half of the sample and strain cycles of:

$$0, -1100 \mu\text{m/m}(\mu\text{in./in.}), 0, -1100 \mu\text{m/m}(\mu\text{in./in.}), \tag{7}$$

$$0, -1100 \mu\text{m/m}(\mu\text{in./in.}), 0, -1000 \mu\text{m/m}(\mu\text{in./in.}), 0$$

for the other half of the sample.

The gage factor is determined from the average of the slopes, of the straight lines between the measurement points at $0 \mu\text{m}/\text{m}$ ($\mu\text{in.}$ and $+1000 \mu\text{m}/\text{m}$) and $+1000 \mu\text{m}/\text{m}$ ($\mu\text{in.}/\text{in.}$) and $\mu\text{m}/\text{m}$ ($\mu\text{in.}/\text{in.}$) and 0 and $-1000 \mu\text{m}/\text{m}$ ($\mu\text{in.}/\text{in.}$) and $-1000 \mu\text{m}/\text{m}$ ($\mu\text{in.}/\text{in.}$).

9.6 As a guide, three separate test methods are described, the choice of the test method used being determined by the particular application and by the facilities that are available. These test methods do not classify strain gages according to accuracy or other performance characteristics. The three test methods that are described differ primarily in the manner of producing an accurately known surface strain, and they are thereby classified. These test methods are described in the following sections:

9.6.1 *Constant Bending Moment Beam Test Method:*

9.6.1.1 *Summary of Test Method*—This test method utilizes a strain on the surface of a test bar produced by loading it as a constant moment beam by the application of dead-weight loads.

9.6.1.2 *Mechanical System—Calibration Apparatus*—A typical mechanical system calibration apparatus is shown in Fig. 4. The test beam may be of any suitable material that meets the requirements of 9.3, and shall have minimum dimensions of 19 mm by 25 mm by 760 mm (0.75 in. by 1 in. by 30 in.). The minimum distance between the pivot points on the supports shall be 2.45 m (96 in.). The beam assembly shall be symmetrical about a vertical line through its midpoint. The positions of the pivots and the weight values shall be adjusted to provide the required strains. The strain over the usable section of the beam shall vary by not more than 1 % of the strain at the reference point. The usable portion of the beam shall be at least one half of the exposed length.

9.6.1.3 *Verification*—The need for measuring calibration strain directly during each test is eliminated by maintaining a calibration of the system. Such a calibration is made by measuring with a Class A extensometer (see Practice E83) the actual strain produced on the surface of the beam when it is loaded. Measurements shall be made with the extensometer centered over each station of the beam. At least three measurements shall be made at each station to verify the strain distribution over the width of the beam. The dimensions of the beam shall be checked at each station periodically. A change of 0.2 % in the thickness at any station shall disqualify that station. Other dimensional changes that would cause a change of surface strain of 0.2 % shall disqualify the beam. The strain at the reference station shall be determined each time the beam is used either with a Class A extensometer, or with a carefully selected, permanently mounted resistance-strain gage that has been calibrated by spanning with a Class A extensometer. The response of this reference strain gage shall be verified periodically to assure compliance with specifications using a Class A extensometer. The beam shall be completely recalibrated after 50 applications or 6 months, whichever comes last.

9.6.1.4 *Procedures*—Mount test strain gages with any appropriate installation technique that will not change the characteristics of the test beam (for example, excessive cure temperatures could be damaging). Mount the strain gages at the stations on the beam where the strain level has been determined by the calibration procedure outlined in 9.6.1.3.

9.6.1.5 Install the test specimen bearing previously unstrained strain gages in the loading system and test environment. After temperature equilibrium has been attained, follow the loading sequence of 9.5. Take readings from the strain gages before applying the load, with the load applied, and after the load is removed for each loading cycle. Obtain compression strains by mounting the beam with the gaged surface up. Obtain tension strains by mounting the beam with the gaged surface down.

9.6.1.6 Calculate the gage factors.

9.6.2 *Constant Stress Cantilever Beam Test Method:*

9.6.2.1 *Summary of Test Method*—This test method produces strain on the surface of a cantilever beam that is designed to have a constant stress over the major portion of its length when loaded in the prescribed manner.

9.6.2.2 *Mechanical System—Calibration Apparatus*—A typical mechanical system calibration apparatus is shown in Fig. 5 and detailed design of a beam that has been used satisfactorily is shown in Fig. 6 (Note 2). The size and arrangement of the equipment

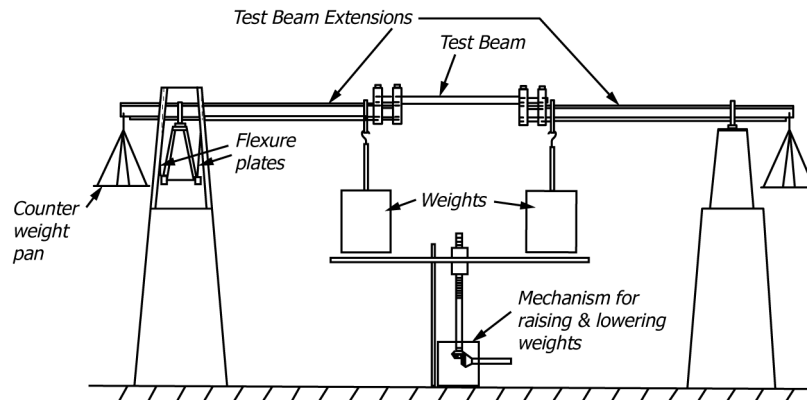


FIG. 4 Constant Bending-Moment Beam Method for Gage Factor Determination

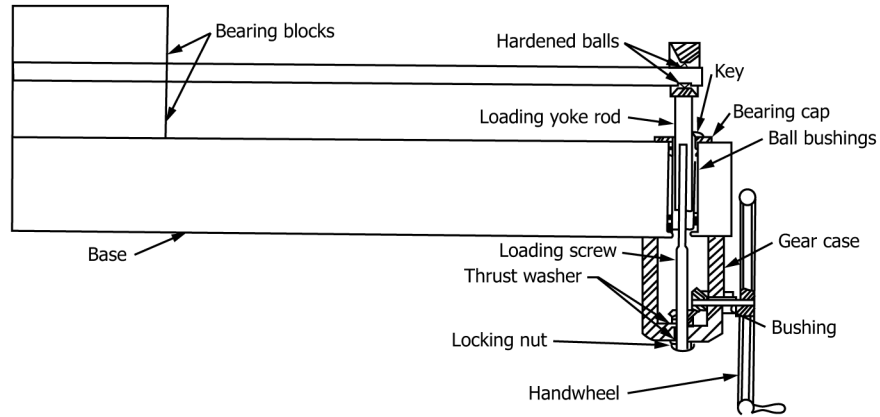


FIG. 5 Constant-Stress Cantilever Beam Method for Gage Factor Determination

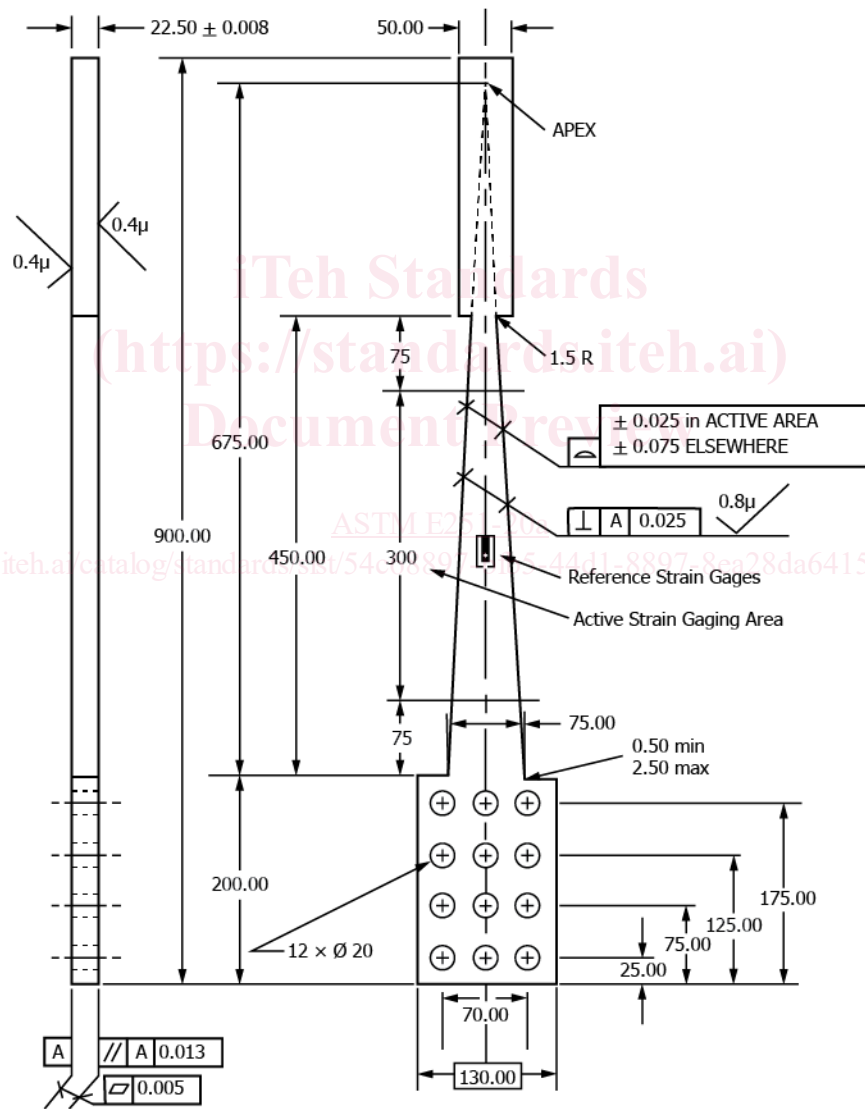


FIG. 6 Constant Stress Cantilever Beam

must be such that the beam may be bent sufficiently in either direction to produce a surface strain of at least 1100 $\mu\text{m}/\text{m}$ ($\mu\text{in.}/\text{in.}$). Two or more carefully selected calibrated reference strain gages, for use as reference standards, shall be permanently bonded to the constant-stress section of the beam as shown in Fig. 6. Great care must be taken to install these strain gages, using the best

current techniques to ensure bonding integrity and long-term stability. These calibrated reference strain gages shall be individually calibrated to determine their gage factor by placing a Class A extensometer system (Practice E83) so as to span the strain gage, bending the beam by means of the deflecting apparatus, and measuring the resulting change in strain gage resistance and strain. Readings shall be taken for the strain cycles stipulated in 9.5 and the gage factor ~~computed~~ calculated (Note 3 and Note 4).

NOTE 2—In order for the beam to fulfill the requirements of a constant-stress beam, the drive rod must be attached to the beam at the apex of the angle formed by the sides of the beam. The ratio of the free length of the beam to width at the base should not be less than 9:1.

NOTE 3—For the calibrated reference strain gage, the gage factor for compression strains may differ from the gage factor for tension strains and it must be determined for both directions of loading.

NOTE 4—It may be convenient to obtain strain of the beam surface as a function of the deflection of the end of the beam as measured by a dial gauge while the strain gages are being calibrated.

9.6.2.3 Verification of Beam—the calibration apparatus—The constant-stress area of the beam of the calibration apparatus shall be explored with a Class A extensometer system to determine the area where the strain is the same as that experienced by the calibrated reference strain gages. The gauge length of the extensometer shall not exceed 25 mm (1 in.). Only areas of the beam where differences between the strains indicated by the extensometer and the calibrated reference strain gage do not exceed 10 $\mu\text{m}/\text{m}$ ($\mu\text{in.}/\text{in.}$) at a strain of ~~1000~~ 1000 $\mu\text{m}/\text{m}$ ($\mu\text{in.}/\text{in.}$) are acceptable for testing strain gages. The beam of the calibration apparatus shall be verified after each ~~50 uses~~ 50 uses or 6 months, whichever comes last.

9.6.2.4 Procedure—Install the strain gages to be tested on the beam in the areas that have been found to be satisfactory; connect them to instruments for measuring their change of resistance. The ~~active~~ measurement axes of the strain gages shall be parallel to the center line of the beam. A selector switch may be used to connect several strain gages into the measuring circuits if it is shown that repeated switchings do not change indicated strain readings by more than 2 $\mu\text{m}/\text{m}$ ($\mu\text{in.}/\text{in.}$).

9.6.2.5 Follow the ~~loading schedule~~ strain cycle of 9.5 and calculate gage factors.

9.6.3 Direct Tension or Compression Test Method:

9.6.3.1 Summary of Test Method—This test method produces strain in a test bar by applying direct tensile or compressive ~~loads~~ forces to the bar.

9.6.3.2 Mechanical System—Calibration Apparatus—A typical ~~mechanical system~~ calibration apparatus is shown in Fig. 7. In this system the test bar is strained directly in tension or compression by a testing machine or other device capable of applying an axial load force to the specimen. The horizontal position of the bar is convenient for mounting the reference extensometer, but it is not necessary. The load force may be applied by hydraulic, mechanical, or other means, but care must be taken to prevent any twisting or bending of the test bar. Twisting in the ~~mechanical system~~ calibration apparatus of Fig. 7 is prevented by the torque arm. Fig. 8 shows a test bar that has been used successfully for both tension and compression loading. The strain gage under test shall be mounted at the center of the reduced section; and a Class A reference extensometer system shall be mounted so as to span the strain gage. The reference extensometer should have a gauge length as near that of the strain gage as possible in order to minimize the effect of nonuniform strain along the length of the test bar.

9.6.3.3 Verification—Since the calibration strain is measured during each test, no calibration of the ~~system~~ calibration apparatus is necessary. The thickness and width of the test bar must be uniform within $\pm 0.25\%$ ~~$\pm 0.25\%$~~ of their average values over a length extending 13 mm (0.5 in) beyond the extensometer gauge points in each direction. The absence of twisting and bending of the test bar must be verified.

9.6.3.4 Procedure—Mount a test strain gage by any appropriate technique so that the center of its sensitive portion measurement axis coincides with the center line of the test bar. Mount the test bar in the loading device taking care to avoid bending or loading

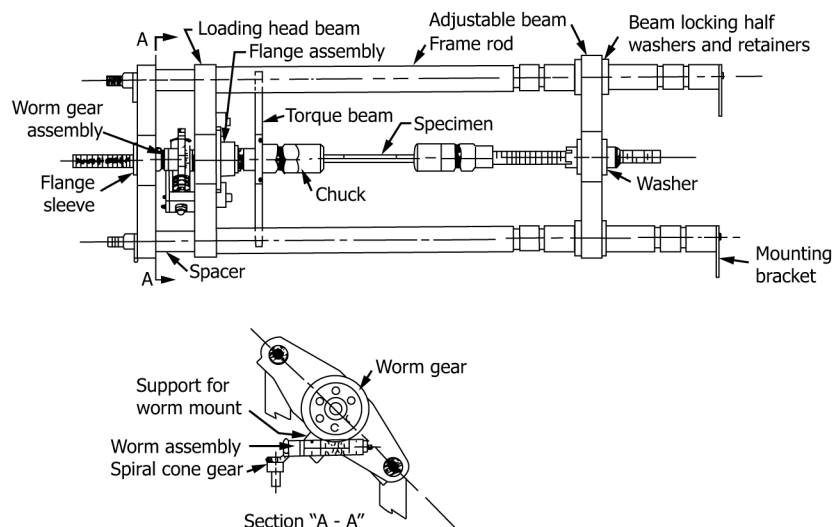


FIG. 7 Testing Machine for Gage Factor Measurements Determining the Gage Factor using the Direct Tension of Compression Method