

Designation: **B571 - 18** B571 - 23

## Standard Practice for Qualitative Adhesion Testing of Metallic Coatings<sup>1</sup>

This standard is issued under the fixed designation B571; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon ( $\varepsilon$ ) indicates an editorial change since the last revision or reapproval.

This standard has been approved for use by agencies of the U.S. Department of Defense.

### 1. Scope

- 1.1 This practice covers simple, qualitative tests for evaluating the adhesion of metallic coatings on various substances.
- 1.2 The values stated in SI units are to be regarded as standard. No other units of measurement are included in this standard.
- 1.3 This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety, health, and environmental practices and determine the applicability of regulatory limitations prior to use.
- 1.4 This international standard was developed in accordance with internationally recognized principles on standardization established in the Decision on Principles for the Development of International Standards, Guides and Recommendations issued by the World Trade Organization Technical Barriers to Trade (TBT) Committee.

#### 2. Significance and Use

- 2.1 These tests are useful for production control and for acceptance testing of products.
- 2.2 Interpreting the results of qualitative methods for determining the adhesion of metallic coatings is often a controversial subject. If more than one test is used, failure to pass any one test is considered unsatisfactory. In many instances, the end use of the coated article or its method of fabrication will suggest the technique that best represents functional requirements. For example, an article that is to be subsequently formed would suggest a draw or a bend test; an article that is to be soldered or otherwise exposed to heat would suggest a heat-quench test. If a part requires baking or heat treating after plating, adhesion tests should be carried out after such posttreatment as well.
- 2.3 Several of the tests are limited to specific types of coatings, thickness ranges, <u>duetilities; ductility</u>, or compositions of the substrate. These limitations are noted generally in the test descriptions and are summarized in <u>Table 1</u> for certain metallic coatings.
- 2.4 "Perfect" adhesion exists if the bonding between the coating and the substrate is greater than the cohesive strength of either. Such adhesion is usually obtained if good electroplating practices are followed.
- 2.5 For many purposes, the adhesion test has the objective of detecting any adhesion less than "perfect." For such a test, one uses any means available to attempt to separate the coating from the substrate. This may be prying, hammering, bending, beating,

<sup>&</sup>lt;sup>1</sup> This practice is under the jurisdiction of ASTM Committee B08 on Metallic and Inorganic Coatings and is the direct responsibility of Subcommittee B08.10 on Test Methods.

Current edition approved Aug. 1, 2018 Nov. 1, 2023. Published August 2018 November 2023. Originally approved in 1979. Last previous edition approved in 2013 2018 as B571 – 97 (2013):B571 – 18. DOI: 10.1520/B0571-18.10.1520/B0571-23.

**TABLE 1 Adhesion Tests Appropriate for Various Coatings** 

Adhesion Test	Coating Material <sup>A</sup>											
	Cadmium	Chromium	Copper	Lead and Lead/Tin Alloy	Nickel	Nickel and Chromium	Palladium	Rhodium	Silver	Tin and Tin/Lead Alloy	Zinc and Zinc Alloys	Gold
Bend	+	_	+	+	+	+	+	+	+	+	+	+
Burnish	_	+	+	-	+	+	-	_	+	-	+	-
Chisel/knife	+	+	+	+	+	-	+	_	+	+	_	+
Draw	_	_	+	-	+	+	-	_	-	-	+	-
File	_	+	+	+	+	+	-	+	+	+	_	+
Grind and saw	+	+	-	-	+	+	+	-	-	+	+	-
Heat/quench	_	+	+	+	+	+	_	_	+	+	+	+
Impact	+	_	+	_	+	+	_	_	_	_	+	_
Peel	_	+	+	_	+	_	_	_	+	+	_	+
Push	_	_	_	-	+	+	-	_	-	-	+	-
Scribe	_	_	+	_	+	_	_	_	_	_	_	_

<sup>&</sup>lt;sup>A</sup> + Appropriate; - not appropriate.

**TABLE 2 Temperature Test Guide** 

_	Coating Material										
Substrate	Chromium, Nickel, Nickel + Chromium, Copper, Temperature, °C	Tin, Temperature, °C	Lead, Tin/Lead, Temperature, °C	Zinc, and Zinc Alloys Temperature, °C	Gold and Silver, Temperature, °C	Palladium, Temperature, °C	Rhodium, Temperature, °C				
Steel	250	150	150	150	250	350	185				
Zinc alloys	150	150	150	150	150	150	150				
Copper and copper alloys	250	150	150	150	250	350	185				
Aluminum and aluminum alloys	220	150	150	150	220	220	185				

# Document Preview

heating, sawing, grinding, pulling, scribing, chiseling, or a combination of such treatments. If the coating peels, flakes, or lifts from the substrate, the adhesion is less than perfect.

- 2.6 If evaluation of adhesion is required, it may be desirable to use one or more of the following tests. These tests have varying degrees of severity; and one might serve to distinguish between satisfactory and unsatisfactory adhesion in a specific application. The choice for each situation must be determined.
- 2.7 When this guideline is used for acceptance inspection, the method or methods to be used must be specified. Because the results of tests in cases of marginal adhesion are subject to interpretation, agreement shall be reached on what is acceptable.
- 2.8 If the size and shape of the item to be tested precludes use of the designated test, equivalent test panels may be appropriate. If permitted, test panels shall be of the same material and have the same surface finish as the item to be tested and shall be processed through the *same* preplating, electroplating, and postplating cycle withas the parts they represent.

#### 3. Bend Tests

- 3.1 Bend the part with the coated surface away over a mandrel until its two legs are parallel. The mandrel diameter should be four times the thickness of the sample. Examine the deformed area visually under low magnification, for example, 4×, for peeling or flaking of the coating from the substrate, which is evidence of poor adhesion. If the coating fractures or blisters, a sharp blade may be used to attempt to lift off the coating. With hard or brittle coatings, cracking usually occurs in the bend area. Such cracks may or may not propagate into the substrate. In either case, cracks are not indicative of poor adhesion unless the coating can be peeled back with a sharp instrument.
- 3.2 Bend the part repeatedly, back and forth, through an angle of 180° until failure of the basis metal occurs. Examine the region at low magnification, for example, 10×, for separation or peeling of the coating. Prying with a sharp blade will indicate unsatisfactory adhesion by lift off of the coating.