



Designation: **E2218–14^{e1}** **E2218–15**

Standard Test Method for Determining Forming Limit Curves¹

This standard is issued under the fixed designation E2218; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

^{e1} NOTE—Editorial corrections were made to 3.2 and throughout the standard in May 2015.

1. Scope

1.1 This method gives the procedure for constructing a forming limit curve (FLC) for a metallic sheet material by using a hemispherical deformation punch test and a uniaxial tension test to quantitatively simulate biaxial stretch and deep drawing processes.

1.2 FLCs are useful in evaluating press performance by metal fabrication strain analysis.

1.3 The method applies to metallic sheet from 0.5 mm (0.020 in.) to 3.3 mm (0.130 in.).

1.4 The values stated in SI units are to be regarded as the standard. The inch-pound equivalents are approximate.

1.5 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

2. Referenced Documents

2.1 *ASTM Standards:*²

A568/A568M Specification for Steel, Sheet, Carbon, Structural, and High-Strength, Low-Alloy, Hot-Rolled and Cold-Rolled, General Requirements for

E6 Terminology Relating to Methods of Mechanical Testing

E8/E8M Test Methods for Tension Testing of Metallic Materials

E517 Test Method for Plastic Strain Ratio r for Sheet Metal

E646 Test Method for Tensile Strain-Hardening Exponents (n -Values) of Metallic Sheet Materials

E2208 Guide for Evaluating Non-Contacting Optical Strain Measurement Systems

3. Terminology standards.iteh.ai/catalog/standards/sist/a6e16309-de34-4551-bb6f-55f18dc33d82/astm-e2218-15

3.1 Terminology **E6** shall apply including the special terms used in this method shown in 3.2.

3.2 *Definitions:*

3.2.1 *biaxial stretching*—a mode of metal sheet forming in which positive strains are observed in all directions at a given location.

¹ This method is under the jurisdiction of ASTM Committee **E28** on Mechanical Testing and is the direct responsibility of Subcommittee **E28.02** on Ductility and Formability.

Current edition approved April 1, 2014; Oct. 1, 2015. Published June 2014; December 2015. Originally published in 2002. Last previous edition approved in 2008 as **E2218–02(2008)**; **E2218–14^{e1}**. DOI: 10.1520/E2218-14E010.1520/E2218-15

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

3.2.1.1 *Discussion*—

See **Fig. 1**.

3.2.2 *deep drawing*—a metal sheet forming operation in which strains on the sheet surface are positive in the direction of the punch travel (e_1) and negative at 90° to that direction.

3.2.2.1 *Discussion*—

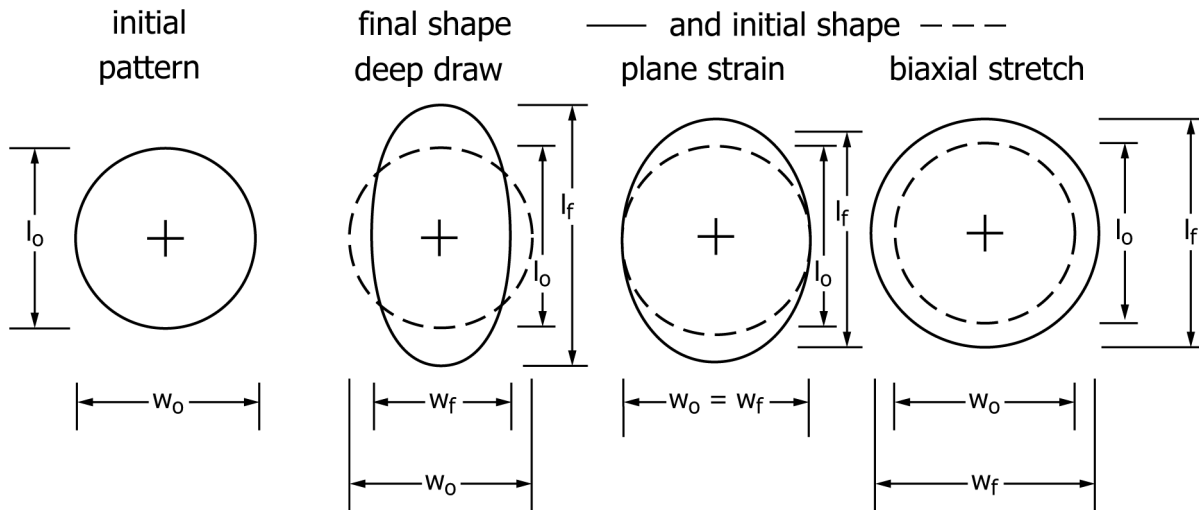


FIG. 1 Possible Changes in Shape of the Grid Pattern Caused by Forming Operations on Metallic Sheet Products

Deep drawing, see Fig. 1, occurs in the walls of a drawn cylinder or the corner walls of a deep drawn part when the flange clamping force is sufficient to restrain metal movement and wrinkling, while permitting the punch to push the center area of the blank into the cavity of the die. Strain conditions that can cause wrinkling or thickening are shown in Fig. 2.

3.2.2.2 Discussion—

In forming a square pan shape, metal from an area of the flange under a reduced clamping force is pulled into the die to form the side wall of the part.

3.2.3 forming limit diagram (FLD)—a graph on which the measured major (e_1) and associated minor (e_2) strain combinations are plotted to develop a forming limit curve.

3.2.3.1 Discussion—

See Fig. 2.

3.2.4 forming limit curve (FLC)—an empirically derived curve showing the biaxial strain levels beyond which localized through-thickness thinning (necking) and subsequent failure occur during the forming of a metallic sheet.

3.2.4.1 Discussion—

See Fig. 3.

3.2.4.2 Discussion—

The curve of Fig. 3 is considered the forming limit for the material when the metal is subjected to a stamping press operation. It was obtained for a drawing quality aluminum killed steel sheet. The curve of Fig. 3 correlates with the upper curve of Fig. 2, a generic curve representing a metallic sheet material with a FLD_0 of 40 %.


3.2.4.3 Discussion—

The strains are given in terms of percent major and minor strain measured after forming a series of test specimen blanks by using a grid pattern. The gauge lengths before and after forming the part are measured to obtain the percent strain. The curve for negative (e_2) strains will generally follow a constant surface area relationship to the associated (e_1) strain.

3.2.4.4 Discussion—

The range of possible major strain (e_1) is from 0 % to over 200 %. The range of possible minor strain (e_2) is from -40 % to over +60 %.

Major Strain
% e_1

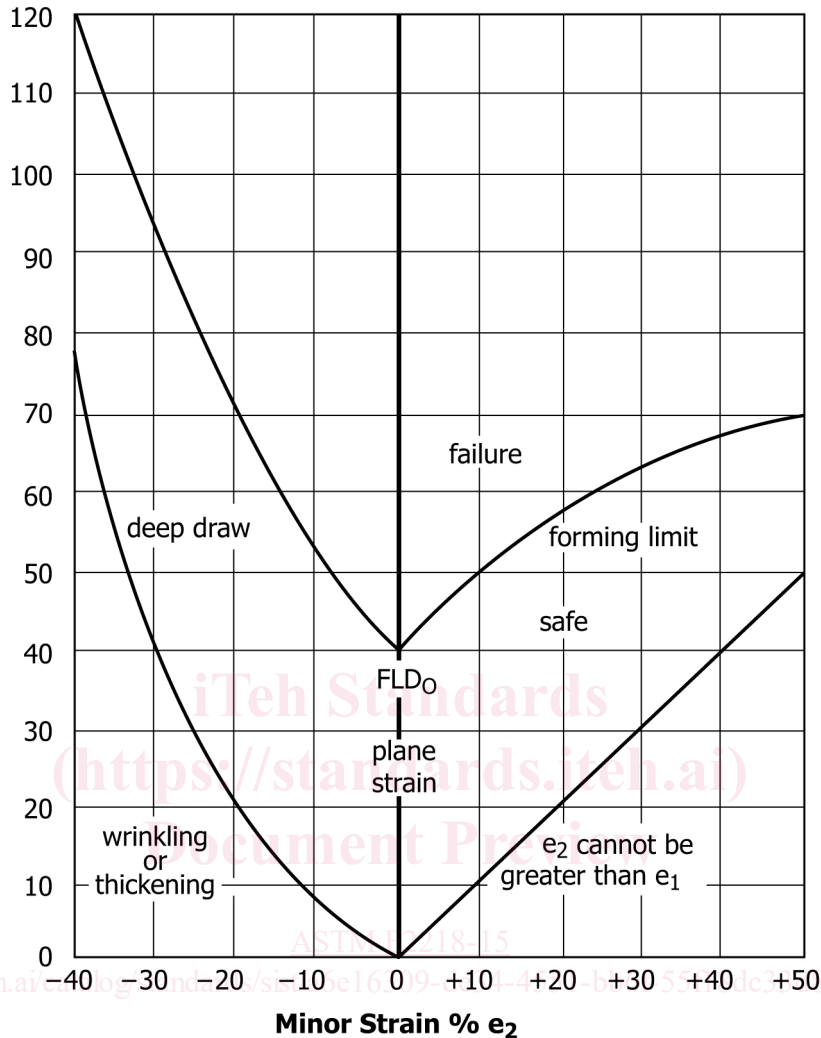

NOTE 1—The upper curve is representative of the forming limit. Strains below the lower curve do not occur during forming metallic sheet products in the most stamping press operations. Curves to the left of % $e_2 = 0$ are for constant area of the sheet surface.

FIG. 2 Forming Limit Diagram

3.2.5 *limiting dome height (LDH) test*—an evaluative test for metal sheet deformation capability employing a hemispherical punch and a circumferential clamping force sufficient to prevent metal in the surrounding flange from being pulled into the die cavity.

3.3 *Definitions of Terms Specific to This Standard:*

3.3.1 *grid pattern*—a pattern applied to the surface of a metal sheet to provide an array of precisely spaced gauge points prior to forming the metal into a final shape by the application of a force.

3.3.2 *major strain, (e_1)*—the largest strain, developed at a given location in the sheet specimen surface.


3.3.2.1 *Discussion*—

The major strain (e_1) is measured either along the stretched line of a square pattern, or along the major axis of the ellipse resulting from deformation of a circular grid pattern, or along the direction of the maximum surface strain using a non-contacting optical strain measurement technique.

3.3.3 *minor strain, (e_2)*— the strain in the sheet surface in a direction perpendicular to the major strain.

3.3.3.1 *Discussion*—

Major Strain

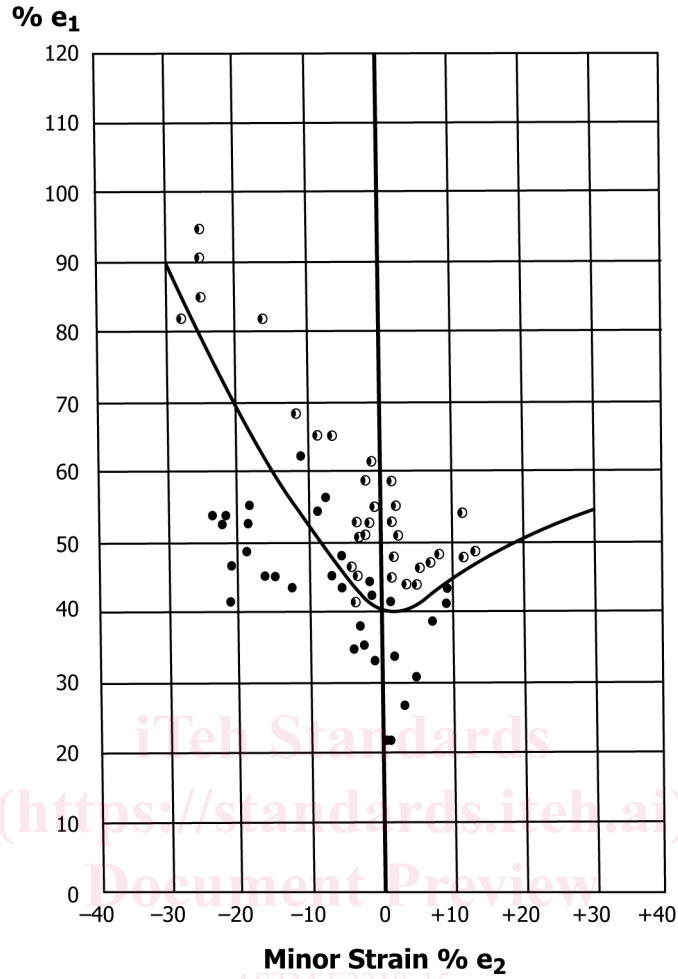

Code: ● good ○ Marginal (necked)

Material properties:

Thickness 0.866 mm (0.034 in.)
 Strain hardening (n) 0.230
 Plastic Strain (r) 1.710

Cold Rolled Drawing Quality Aluminum Killed Steel
 Longitudinal Mechanical Properties

Thickness		Yield Strength		Tensile Strength		% El in 50 mm	n Value	r Value
mm	(in.)	MPa	(ksi)	MPa	(ksi)			
0.866	(0.034)	163.4	(23.7)	304.7	(44.2)	43.5	0.230	1.71

Chemical Composition

Element Percent	C	S	N	Mn	Al	P	Si
	0.035	0.006	0.006	0.19	0.29	0.006	0.004

FIG. 3 Forming Limit Curve (FLC) for a Cold Rolled Drawing Quality Aluminum Killed Steel Sheet.

The minor strain (e_2) is measured at 90° to the major strain, either along the shorter dimension of the final rectangular shape of a part formed using a square pattern, or along the shorter axis of the ellipse resulting from deformation of a circular grid pattern, or along the direction of the minimum surface strain using a non-contacting optical strain measurement technique.

3.3.4 *plane strain, FLD_o*—the condition in metal sheet forming that maintains a near zero (0 to +5 %) minor strain (e_2) while the major strain (e_1) is positive (in tension)

3.3.4.1 Discussion—

Plane strain is the most severe deformation mode and causes a low point in the forming limit curve (FLC). For convenience, many FLCs are shown with the low point at 0 % (e_2), however, such an abrupt reversal of (e_1) strain does not occur. See Fig. 3 and Figs. X2.1-X2.3.

4. Summary of Test Method

4.1 Determination of a forming limit curve (FLC) involves selecting a style of testing apparatus, deforming multiple specimens biaxially, measuring the resulting strain (including judging if these strains are localized), and drawing a curve through the measured points.

4.2 Various test apparatus (see Section 6) may be used to deform specimens biaxially including a hemispherical punch testing machine such as an LDH tester, a sub press in a universal testing machine, or a hydraulic bulge testing machine.

4.2.1 Contact surfaces of the blank and punch are lubricated for the hemispherical punch test.

4.2.2 The flanges of a blank are securely clamped in serrated or lock bead, blank-holder dies for the hemispherical punch and hydraulic bulge tests.

4.3 Stretching the central area of the blank biaxially or pulling in the tension test is performed without interrupting the force.

4.3.1 A series of grid pattern blanks is prepared with different widths and a common length suitable for being securely gripped in the test apparatus.

4.3.2 Negative (e_2) strains can be obtained using sheared narrow strips stretched over the punch of a hemispherical punch tester.

4.3.3 If possible, the punch advance or the force is stopped when a localized through-thickness neck (localized necking) is observed, or as soon as the specimen fractures.

4.4 The procedure (for determining a) and the (e_2 forming limit curve (FLC) involves the following: strains of the grid pattern on the surface area are measured near the neck of all the test specimens for the series and recorded.

4.4.1 Using a hemispherical punch testing machine (LDH tester). Sometimes called a bulge tester. The LDH test employs a 100 mm (4 in.) diameter machined surface punch. The strain measurements may include good (no localized necking), marginal (localized necking), and fracture areas.

4.4.1.1 A universal testing machine for tension load application and a sub-press for against the metal sheet surface loading with a ball punch of 75 mm (3 in.), 100 mm (4 in.), or larger diameter can be used in place of the LDH test equipment.

4.4.2 Preparing a series of grid pattern. The measured strain combinations are plotted on a forming limit diagram (see Fig. 3) blanks with different widths and a common length suitable for being securely gripped in the test apparatus.

4.4.2.1 All specimens for a series shall have their long dimension in the same orientation, relative to the original process rolling direction of the sample and that direction noted in the report.

4.4.2.1.1 Lubricating the contact surfaces of the blank and punch for the hemispherical punch test.

4.4.2.1.2 Securely clamping the flanges of a blank in the serrated, or lock bead, blank-holder dies of the hemispherical punch test.

4.4.2.1.3 Stretching the central area of the blank biaxially over the nose of the hemispherical punch, or pulling in the tension test, without interrupting the force.

4.4.2.1.3.1 Negative (e_2) strains may be obtained using sheared narrow strips stretched over the punch of the LDH tester.

4.4.2.1.3.2 Stopping the punch advance or the force when a localized through thickness neck (localized necking) is observed, if possible, or as soon as the specimen fractures.

4.4.2.1.3.3 Removing the specimen from the testing machine grips and then proceeding with another, different width, blank in the test series of the same material.

4.4.3 Measuring and recording the (If other than good) and the (no localized necking) e_2 strains of the grid pattern on the surface area near the neck of all the locations are included, then each measured point is visually evaluated and noted as illustrated in Fig. 3 test specimens for the series.

4.4.3.1 These measurements may include good (no localized necking), marginal (localized necking), and fracture areas.

4.4.3.2 If other than good (no localized necking) locations are included, each measured point shall be visually evaluated and noted as illustrated in Fig. 3.

4.4.3.3 Plotting the measured strain combinations on a FLD. See Fig. 3.

4.4.3.4 Establishing the forming limit curve (FLC) by connecting the uppermost good (no localized necking) (e_1) strains over the associated (e_2) strain range used in the study.

4.1.10.1 For practical purposes, the specimens that have been strained to a localized neck-down, or through thickness fracture, condition may be measured at a location on the opposite side of the hemispherical bulge from the fracture, in a good (no localized necking) location, to obtain values to establish the FLC.

4.1.10.2 Another acceptable procedure is to measure the grid near the necked, or fracture, location and identify these data points in determining the forming limit curve. This procedure was used in locating the FLC of Fig. 3.

4.1.10.3 Establishing the FLC depends on judgement. Note that in Fig. 3 there are several good (no localized necking) data points above the FLC and two marginal points below the FLC.

4.1.10.4 The FLC curve shall not include an area where there is a preponderance of marginal data points at an (e_1) strain level below the measured good (no localized necking) data points.

4.5 The FLC is established by drawing a curve on the FLD based on the criteria in 13.4.

5. Significance and Use

5.1 A forming limit curve (FLC) defines the maximum (limiting) strain that a given sample of a metallic sheet can undergo for a range of forming conditions, such as deep drawing, stretching and bending over a radius in a press and die drawing operation, without developing a localized zone of thinning (localized necking) that would indicate incipient failure.

5.1.1 FLCs may be obtained empirically by using a laboratory hemispherical punch biaxial stretch test and also a tension test to strain metal sheet specimens from a material sample beyond their elastic limit, just prior to localized necking and fracture.

5.1.1.1 Since this cannot be predetermined, one or both surfaces of specimens are covered with a grid pattern of gauge lengths usually as squares or small diameter circles, by a suitable method such as scribing, photo-grid, or electro-etching, and then each specimen is formed to the point of localized necking, or fracture.

5.1.2 Strains in the major (e_1) and minor (e_2) directions are measured using points on the grid pattern in the area of the localized necking or fracture.

5.1.2.1 Blanks of varied widths are used to produce a wide range of strain states in the minor (e_2) direction.

5.1.2.2 The major (e_1) strain is determined by the capacity of the material to be stretched in one direction as simultaneous surface forces either stretch, do not change, or compress, the metal in the (e_2) direction.

5.1.2.3 In the tension test deformation process, the (e_2) strains are negative and the metal is narrowed both through the thickness and across its width.

5.1.3 These strains are plotted on a forming limit diagram (FLD) and the forming limit curve (FLC) is drawn to connect the highest measured (e_1 and e_2) strain combinations that include good data points.

5.1.3.1 When there is intermixing and no clear distinction between good and necked data points, a best fit curve is established to follow the maximum good data points as the FLC.

5.1.4 The forming limit is established at the maximum (e_1) strain attained prior to necking.

5.1.5 The FLC defines the limit of useful deformation in forming metallic sheet products.

5.1.6 FLCs are known to change with material (specifically with the mechanical or formability properties developed during the processing operations used in making the material), and the thickness of the sheet sample.

5.1.6.1 The strain hardening exponent (n value), defined in Test Method E646, affects the forming limit. A high n value will raise the limiting major strain (e_1), allowing more stretch under positive ($+e_2$) strain conditions.

5.1.6.2 The plastic strain ratio (r value), defined in Test Method E517, affects the capacity of a material to be deep drawn. A high r value will move the minor ($-e_2$) strain into a less severe area to the left of the FLD₀, thus permitting deeper draws for a given major (e_1) strain.

5.1.6.3 The thickness of the material will affect the FLC since a thicker specimen has more volume to respond to the forming process.

5.1.6.4 The properties of the steel sheet product used in determining the FLC of Fig. 3 included the n value and the r value.

5.1.7 FLCs serve as a diagnostic tool for material strain analysis and have been used for evaluations of stamping operations and material selection.

5.1.8 The FLC provides a graphical basis for comparison with strain distributions on parts formed by sequential press operations.

5.1.9 The FLC obtained by this method follows a constant proportional strain path where there is a fixed ratio of major (e_1) to minor (e_2) strain.

5.1.9.1 There is no interrupted loading, or reversal of straining, but the rate of straining may be slowed as the specimen approaches neck-down, or fracture.

5.1.9.2 The FLC can be used for conservatively predicting the performance of an entire class of material provided the n value, r value and thickness of the material used are representative of that class.

5.1.10 Complex forming operations, in which the strain path changes, or the strain is not homogeneous through the metal sheet thickness, may produce limiting strains that do not agree with the forming limit obtained by this method.

5.1.11 Characterization of a material's response to plastic deformation can involve strain to fracture as well as to the onset of necking. These strains are above the FLC.

5.1.12 The FLC is not suitable for lot-to-lot quality assurance testing because it is specific to that sample of a material which is tested to establish the forming limit.

6. Apparatus

6.1 Data points for minor strains (e_2) near 0 % and for positive strains ($+e_2$) associated with major strains (e_1) may be obtained using a hemispherical punch testing machine such as a LDH tester, a sub press in a universal testing machine, or a hydraulic bulge testing machine.

NOTE 1—The LDH test was designed to give a repeatable measure of punch movement among specimens of a specific metal sheet sample; thus the only measured value would be the punch height at incipient fracture. Problems with maintaining a secure clamp result in variation of the measured LDH value. A modification of the LDH test using a strip in the range of 200 mm (8 in.) wide was found to give (e_1) values near 0 % (e_2), when the surface strains were measured using a grid pattern. On this basis, a test was developed to use a sheared strip of metal sheet 200 mm (8 in.) wide and sufficiently long to be securely clamped in the LDH test fixture. The height at incipient fracture was to correlate with FLD_0 . The test was not sufficiently repeatable to be employed for evaluation of metal sheet samples. The equipment is used to stretch specimens, with grid patterns that have been sheared to various widths and is one method to obtain a range of (e_2) and associated (e_1) values for plotting a FLC on a FLD.

6.1.1 The hydraulic bulge may employ a liquid or a soft elastic material as the forming force.

6.2 Data points for the negative minor ($-e_2$) strain associated with a major (e_1) strain may be obtained using various width strips in a LDH tester and also a universal testing machine and Test Method E8/E8M for a tension test of a specimen that has a grid pattern on the surface.

6.2.1 A series of specimens having different widths of reduced parallel sections or a series of sheared full length strips with grid patterns may be used to obtain a range of (e_2) strains.

6.3 The press apparatus shall be capable of securely clamping the test blank to prevent, or minimize, draw-in of flange metal.

6.3.1 Serrated dies work well with equipment using 75 mm (3 in.), or 100 mm (4 in.) diameter punches. If an interlocking ring bead is used, the fit between the two clamping parts shall be such that no area of the specimen flange is pulled-in by the forming force.

NOTE 2—Restriction of the pull-in of flange metal is not critical in obtaining strips for measuring (e_1) and associated (e_2) strains to establish the forming limit.

6.3.2 Secure clamping of the flange is critical for the LDH test in which only the punch height is recorded.

6.4 The test system shall have sufficient force and stroke to ensure the hemispherical punch can be driven until the metal sheet ruptures.

6.5 The apparatus shall produce sufficient force to both hold down the flanges and advance the punch to complete the deformation of the blank.

6.6 Although no punch displacement or load measuring capabilities are required for determining data, such devices are helpful in conducting the test.

6.7 The hemispherical punch is advanced against the center of the clamped specimen at a constant rate until the material exhibits localized necking (through thickness thinning) and a fracture appears in the surface of the specimen.

6.7.1 The punch advance may be slowed at the end of the forming process to aid in stopping at the start of localized necking, or when fracture begins.

6.7.2 The nominal punch speed shall be measured and reported.

6.7.3 Unless there is a defect in the material, it should not split across the nose of the punch. Instead, when the punch is advanced beyond the forming limit of the material, necking or fracturing, or both, will occur in a ring encircling the round cap of the formed region.

NOTE 3—Lubrication improves sliding of the material over the surface of the punch and causes rupture to occur closer to the top. This does not change the forming limit, as the minor (e_2) strain adjusts to the increased major (e_1) strain.

6.8 The punch shall have a hemispherical nose with a nominal diameter of at least 75 mm (3 in.). Diameters of 100 mm (4 in.) and 200 mm (8 in.) have been used.

6.8.1 The 100 mm (4 in.) diameter limiting dome height (LDH) testing equipment is well suited to straining narrow strips and full size (square, or round) specimen blanks to obtain data for determining the forming limit curve (FLC).

6.8.2 A 75mm (3 in.) round ball seated in a spherical mount may be used as a hemispherical nose punch.

6.9 Clearance between the forming punch and hold down dies shall be large enough to prevent pinching of the metal if the punch advances to full penetration of the die.

6.10 The draw approach radius of the hold down die shall be sufficient to avoid fracture of the test blank in that area during stretching.

6.10.1 Wide blanks may wrinkle or produce an edge tear in the periphery near the hold down bead areas. This is not considered a failure.

6.11 The punch nose and hold down dies shall have a hardness of 50.0 HRC \pm 5.0.

7. Materials

7.1 Grid Pattern—The grid pattern shall adhere to the metal so that it will not be moved on the surface or rubbed off by the forming operation.

7.1.1 An array of squares, or circles, or both, is printed on the surface of the specimen. Suggested patterns are shown in Fig. 4. ~~The pattern shall adhere to the metal so that it will not be moved on the surface or rubbed off by the forming operation. Refer to Specification A568/A568M, Appendix X4—Procedures for Determining the Extent of Plastic Deformation Encountered in Forming or Drawing, for procedures to apply photographic and electrochemically printed grid patterns and a review of strain analysis.~~

7.1.1 Suggested dimensions—The suggested dimension for the gauge lengths are 2.5 mm (0.100 in.) for the sides of a square pattern, or diameter of a circle pattern. After the part has been formed, critical areas are measured for the resulting gauge length changes in the long dimension from (l_0 is 2.5 mm (0.10 in.)) to (l_f) of the pattern, and in the width dimension (w_0) to (w_f) at 90° to the long dimension as shown in Fig. 1. The major strain (e_1) and associated minor strain (e_2) at 90° to (e_1) are calculated from these gauge length changes. The strains may be either engineering strain based on the original gauge length, or true strain.

7.1.1.1 After the part has been formed, critical areas are measured for the resulting gauge length changes in the long dimension from (l_0) to (l_f) of the pattern, and in the width dimension (w_0) to (w_f) at 90° to the long dimension as shown in Fig. 1. The major strain (e_1) and associated minor strain (e_2) at 90° to (e_1) are calculated from these gauge length changes. The strains may be either engineering strain based on the original gauge length, or true strain.

7.1.2 Larger patterns, gauge lengths, of 6 mm (0.25 in.) up to 125 mm (5 in.), may be used to measure low strain levels on formed parts, but shall not be used in determining the FLC.

7.1.4 Circles should be used for deformations where the major strain (e_1) does not align with the lines of a square pattern. This condition is less likely in the process of determining the FLC than in production stamping evaluations. These circles commonly have diameters of 2.5 mm (0.100 in.) and may be spaced up to 2.5 mm (0.100 in.) apart. They are measured across the diameter of the circle when the line width is minimal. For wider lines, the enclosed area of the etched circle should be consistent from one circle to another and the measurement made across the inside diameter. This is more critical with wider line width patterns and at high e_1 strains when the line spreads as the metal surface stretches.

7.1.5 An alternative to circles is a pattern of solid dots of precise diameter that are measured across the diameter of the dot.

7.2 A grid pattern may be printed on one or both surfaces of the test specimen.

7.2.1 Printing on both surfaces is sometimes necessary when studying a production formed part, but not for the specimens used in establishing the FLC.

7.3 The grid pattern shall cover an area of the specimen blank sufficient to encompass the critically strained areas.

7.4 The type (for example, square, circle, random) of grid pattern and the application method are specific to the measurement technique and the sample material.


7.5 The preferred grid pattern consists of 2.50 mm (0.100 in.) squares, or circle diameters, as the gauge length. Other grid patterns, such as random designs, may be used in conjunction with non-contacting optical strain measurement techniques using 2.5 mm (0.10 in.) as the effective gauge length.

7.6 An alternative to circles is a pattern of solid dots of precise diameter that are measured across the diameter of the dot.

7.7 Prepared stencils of suitable size and accurate dimensions may be used with electrochemical etching equipment, photo grid, or other transfer method to produce grid patterns of squares, circles, or dots, or combination thereof. For the preferred pattern, an array of squares, or circles, or both, is printed on the surface of the specimen. Suggested patterns are shown in Fig. 4.

NOTE 4—Refer to Specification A568/A568M, Appendix X4—Procedures for Determining the Extent of Plastic Deformation Encountered in Forming or Drawing, for procedures to apply photographic and electrochemically printed grid patterns and a review of strain analysis.

7.7.1 Suggested dimensions for the gauge lengths are 2.5 mm (0.100 in.) for the sides of a square pattern, or a diameter of a circle pattern.

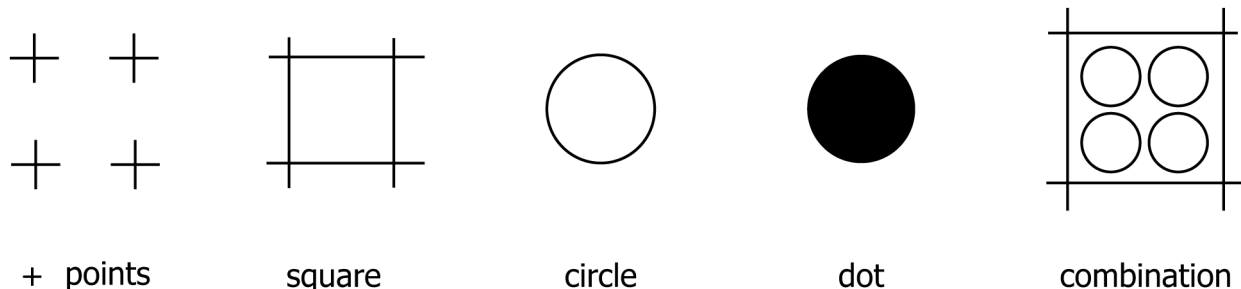

NOTE 1—The basic pattern is repeated over the area of the part to be studied on a flat specimen blank.

FIG. 4 Examples of patterns for Gauge Length measurement units used in Determining Forming Limit Curves (FLC)

7.7.2 Circles should be used for deformations where the major strain (ϵ_1) does not align with the lines of a square pattern. This condition is less likely in the process of determining the FLC than in production stamping evaluations. These circles commonly have diameters of 2.5 mm (0.100 in.) and may be spaced up to 2.5 mm (0.100 in.) apart. They are measured across the diameter of the circle when the line width is minimal. For wider lines, the enclosed area of the etched circle should be consistent from one circle to another and the measurement made across the inside diameter. This is more critical with wider line width patterns and at high ϵ_1 strains when the line spreads as the metal surface stretches.

7.7.3 The dimensions of the grid pattern shall be checked for each stencil at the start and periodically during use to ensure that dimensions are not changing due to stretching or shrinking. Prepared stencils of suitable size and accurate dimensions may be used with electrochemical etching equipment, photo grid, or other transfer method to produce grid patterns of squares, circles, or dots, or combination thereof.

7.7.3.1 The dimensions of the grid pattern shall be checked for each stencil at the start and periodically during use to ensure that dimensions are not changing due to stretching or shrinking.

7.7.3.2 Wrinkling of the stencil shall be prevented to ensure precise gauge lengths over the pattern area.

7.7.3.3 Dimensions of transferred patterns on the metal sheet blank shall be confirmed by measuring at random locations on the specimen.

7.7.4 Wrinkling of the stencil shall be prevented to Techniques for applying grids are explained in [Appendix X1](#) insure precise gauge lengths over the pattern area of this method.

7.7.4.1 Refer to Specification [A568/A568M](#), Appendix X4, for the photographic and electrochemical etching techniques. Improper application of the electric current and time can affect the line appearance so that establishing the line edge becomes difficult when the pattern is magnified for measurement.

7.7.4.2 A grid pattern with a dark thin line maximizes the precision of readings.

7.7.5 Dimensions of transferred patterns on the metal sheet blank shall be confirmed by measuring at random locations on the specimen. Rectangular and circle grid patterns made with a metal scribing tool may be used.

7.7.5.1 It is necessary to measure each scribed circle and rectangle prior to forming the test blank to establish the initial gauge length in the final measured directions.

7.7.6 The length of each side of the square pattern and the diameters of all circles shall be within ± 0.025 mm (0.001 in.) of the established gauge length.

7.7.6.1 Due to possible line width variations within a printed pattern, the measurements shall be from the inside of the line on one side of the square, or circle, to the inside of the opposite line. This is important when measuring high strains where the line width has increased.

7.7.7 Solid dots may be used in place of square or open circle patterns. These are preferred for some electronic measuring devices employing a camera and a programmed computer.

7.8 Techniques for applying grids are explained in When using non-contacting optical strain measurement techniques, [Appendix X1](#) of this method: a grid pattern and an application method specific to the technique shall be used.

7.3.1 Refer to Specification [A568/A568M](#), Appendix X4, for the photographic and electrochemical etching techniques. Improper application of the electric current and time can affect the line appearance so that establishing the line edge becomes difficult when the pattern is magnified for measurement.

NOTE 5—[Appendix X3](#) has suggested guidance for the use of digital image correlation.

7.3.2 A grid pattern with a dark thin line maximizes the precision of readings.

7.4 Rectangular and circle grid patterns made with a metal scribing tool may be used.

7.4.1 It is necessary to measure each scribed circle and rectangle prior to forming the test blank to establish the initial gauge length in the final measured directions.

7.5 A grid pattern with precise gauge lengths may be printed on one or both surfaces of the test specimen.

7.5.1 This is sometimes necessary when studying a production formed part, but not for the specimens used in establishing the FLC.

7.6 The preferred grid consists of 2.50 mm (0.100 in.) squares, or circle diameters, as the gauge length.

7.6.1 Examples of patterns are shown in [Fig. 4](#).

7.7 The length of each side of the square pattern and the diameters of all circles shall be within ± 0.025 mm (0.001 in.) of the established gauge length.

7.7.1 Due to possible line width variations within a printed pattern, the measurements shall be from the inside of the line on one side of the square, or circle, to the inside of the opposite line.

7.7.1.1 This is important when measuring high strains where the line width has increased.

7.8 The grid pattern shall cover an area of the specimen blank sufficient to encompass the critically strained areas.

7.9 Solid dots may be used in place of square or open circle patterns. These are preferred for some electronic measuring devices employing a camera and a programmed computer.

8. Sampling

8.1 Blanks to be tested shall be representative of the properties of the material, as specified in the applicable product specification, and shall be from a common known source, such as a single sample.

8.1.1 For coil processed materials, the rolling direction shall be identified on the sample and the specimens.

NOTE 6—The forming limit curve (FLC) is specific to the tested sample of a material. It is possible for the forming limit curve (FLC) to be different for separate samples of a given grade of metal. Some causes of this are differences in the strain hardening exponent (n value), material non-homogeneity, specimen thickness, and the cold rolling and annealing processing methods used in producing the material.

9. Sample Preparation

9.1 Several specimen blanks are required to establish the forming limit curve (FLC).

9.1.1 For example, the 64 data points of Fig. 3 are from 32 specimens of different widths that were formed by several methods.

9.1.2 Specimens over a range of widths are used to obtain different (e_2) strains.

9.1.3 All specimens for a series shall have their long dimension in the same orientation, relative to the original process rolling direction of the sample and that direction noted in the report.

9.2 The blanks shall be sufficiently long in the major strain direction of the forming operation to allow secure clamping in the holding grips and allow a free span over which stretching occurs.

9.2.1 For the tension strain applied in a universal testing machine, either standard reduced-section 50 mm (2 in.) sheet specimens, or sheared parallel strips of various widths, may be used.

9.2.2 For hemispherical punch tests, the blanks must be sufficiently long to be securely clamped in the holding die without excessive pull-in.

9.2.2.1 This secure clamping condition for the flange is not critical for the FLC determination, but it is necessary for the limiting dome height (LDH) test.

9.2.3 Example lengths are 180 to 225 mm (7 to 9 in.) for a test using a hemispherical punch diameter of 100 mm (4 in.) and also for the tension test specimen.

9.3 The width of each set of specimen blanks is different in order to produce a range of minor strain (e_2) values.

9.3.1 Several sets of specimens may be needed to provide sufficient data.

9.3.2 Rectangular strips are cut to various widths, typically ranging from 12 mm (0.50 in.) up to 180 or 200 mm (7 to 8 in.) in increments of 12 mm (0.50 in.), or 25 mm (1 in.).

9.4 Test blanks from a given sample shall all be sheared to width in the same direction, either across the rolling direction or along the rolling direction, of the sheet product.

9.5 The width cut shall be made using a shear with sharp blades and a blade clearance of approximately 10 % of sheet thickness to minimize double shear and edge burr effects that could be a safety hazard when handling test specimens.

9.5.1 A moderate amount of shear burr will not affect the test results.

9.5.2 The rake angle of the upper shear blade should be less than 3° to prevent curling of the narrow specimens.

9.6 Edges of the specimen blanks may be polished to remove excessive edge burr.

9.7 Specimens shall have edges that are parallel within 1 % of their length.

10. Calibration

10.1 Tests for forming limit curves made in hemispherical punch forming presses and universal testing machines do not require measurements of the forces applied.

10.2 The measurements of (e_1) and (e_2) strain shall be accurate to ± 2.5 % strain.

10.3 The procedure used to make these measurements when the preferred grid pattern (that is, square, circles, spots, or combination of these) is used may involve one of the five following devices, or it may be a comparable technique and device that gives equivalent precision:

10.3.1 A machinist's microscope with 10 \times magnification and incorporating a calibrated scale.

10.3.1.1 The surface being measured shall be held perpendicular to the microscope.

10.3.2 A steel scale with 0.25 mm (0.01 in.) divisions. The scale lines shall be read from center to center of the line widths.

10.3.3 A magnifier that incorporates a calibrated scale.

10.3.4 A tapered wedge scale on clear plastic (Mylar) that gives the strain in percent for an established gauge length, which effectively magnifies the strain.

10.3.5 A circle grid analyzer employing a camera and computer imaging that makes multiple simultaneous readings.

10.4 The procedure to measure the strains when using a non-contacting optical strain measurement technique should follow the suggestions of the measurement equipment manufacturer.

10.4.1 If the measurements are made while the force is still applied to the specimen, then this should be noted in the report along with the method that was used.