INTERNATIONAL STANDARD

ISO/ASTM 51401

Practice for use of a dichromate dosimetry system

Pratique de l'utilisation d'un système dosimétrique au dichromate

PDF disclaimer

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. Neither the ISO Central Secretariat nor ASTM International accepts any liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies and ASTM members. In the unlikely event that a problem relating to it is found, please inform the ISO Central Secretariat or ASTM International at the addresses given below.

iTeh STANDARD PREVIEW
(standards.iteh.ai)

ISO/ASTM 51401:2002
https://standards.iteh.ai/catalog/standards/sist/350f6e35-4b08-49a2-883b-
2c37e25044e6/iso-astm-51401-2002

Contents

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75% of the member bodies casting a vote.

ASTM International is one of the world's largest voluntary standards development organizations with global participation from affected stakeholders. ASTM technical committees follow rigorous due process balloting procedures.

A pilot project between ISO and ASTM International has been formed to develop and maintain a group of ISO/ASTM radiation processing dosimetry standards. Under this pilot project, ASTM Subcommittee E10.01, Dosimetry for Radiation Processing, is responsible for the development and maintenance of these dosimetry standards with unrestricted participation and input from appropriate ISO member bodies.

Attention is drawn to the possibility that some of the elements of this International Standard may be the subject of patent rights. Neither ISO nor ASTM International shall be held responsible for identifying any or all such patent rights.

International Standard ISO/ASTM 51401 was developed by ASTM Committee E10, Nuclear Technology and Applications, through Subcommittee E10.01, and by Technical Committee ISO/TC 85, Nuclear Energy.

ISO/ASTM 51401:2002(E)

Standard Practice for
Use of a Dichromate Dosimetry System[1]

This standard is issued under the fixed designation ISO/ASTM 51401; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision.

1. Scope

1.1 This practice covers the preparation, testing, and procedure for using the acidic aqueous silver dichromate dosimetry system to measure absorbed dose in water when exposed to ionizing radiation. The system consists of a dosimeter and appropriate analytical instrumentation. For simplicity, the system will be referred to as the dichromate system. It is classified as a reference standard dosimetry system (see ISO/ASTM Guide 51261).

1.2 This practice describes the spectrophotometric analysis procedures for the dichromate system.

1.3 This practice applies only to γ-rays, X rays, and high energy electrons.

1.4 This practice applies provided the following conditions are satisfied:

1.4.1 The absorbed dose range is from 2×10^3 to 5×10^4 Gy.

1.4.2 The absorbed dose rate does not exceed 600 Gy/pulse with a pulse repetition rate not to exceed 12.5 Hz, or does not exceed an equivalent dose rate of 7.5 kGy/s from continuous sources (1).[2]

1.4.3 For radionuclide gamma-ray sources, the initial photon energy shall be greater than 0.6 MeV. For bremsstrahlung photons, the initial energy of the electrons used to produce the bremsstrahlung photons shall be equal to or greater than 2 MeV. For electron beams, the initial electron energy shall be greater than 8 MeV.

NOTE 1—The lower energy limits given are appropriate for a cylindrical dosimeter ampoule of 12 mm diameter. Corrections for displacement effects and dose gradient across the ampoule may be required for electron beams (2). The dichromate system may be used at lower energies by employing thinner (in the beam direction) dosimeter containers (see ICRU Report 35).

1.4.4 The irradiation temperature of the dosimeter shall be above 0°C and should be below 80°C.

NOTE 2—The temperature coefficient of dosimeter response is known only in the range of 5° to 50°C (see 10.1.8). Use outside this range is not recommended.

1.5 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.* Specific precautionary statements are given in Note 7.

2. Referenced Documents

2.1 *ASTM Standards:*
C 912 Practice for Designing a Process for Cleaning Technical Glasses[3]
E 170 Terminology Relating to Radiation Measurements and Dosimetry[4]
E 177 Practice for Use of the Terms Precision and Bias in ASTM Test Methods[5]
E 178 Practice for Dealing with Outlying Observations[5]
E 275 Practice for Describing and Measuring Performance of Ultraviolet, Visible and Near Infrared Spectrophotometers[6]
E 456 Terminology Relating to Quality and Statistics[5]
E 666 Practice for Calculating Absorbed Dose from Gamma or X-Radiation[4]
E 668 Practice for Application of Thermoluminescence Dosimetry (TLD) Systems for Determining Absorbed Dose in Radiation-Hardness Testing of Electronic Devices[4]
E 925 Practice for the Periodic Calibration of Narrow Band-Pass Spectrophotometers[6]
E 958 Practice for Measuring Practical Spectral Bandwidth of Ultraviolet-Visible Spectrophotometers[6]
E 1026 Practice for Using the Fricke Reference Standard Dosimetry System[4]
2.2 *ISO/ASTM Standards:*
51205 Practice for Use of a Ceric-Cerous Sulfate Dosimetry System[4]
51261 Guide for Selection and Calibration of Dosimetry Systems for Radiation Processing[4]
51400 Practice for Characterization and Performance of a High-Dose Radiation Dosimetry Calibration Laboratory[4]
51707 Guide for Estimating Uncertainties in Dosimetry for Radiation Processing[4]
2.3 *International Commission on Radiation Units and Measurements (ICRU) Reports:[7]*
ICRU Report 14 Radiation Dosimetry: X-Rays and Gamma

---

[1] This practice is under the jurisdiction of ASTM Committee E10 on Nuclear Technology and Applications and is the direct responsibility of Subcommittee E10.01 on Dosimetry for Radiation Processing, and is also under the jurisdiction of ISO/TC 85/WG 3.

Current edition approved Jan. 22, 2002. Published March 15, 2002. Originally published as E 1401 – 91. Last previous ASTM edition E 1401 – 96ᵉ¹. ASTM E 1401 – 96ᵉ¹ was adopted by ISO in 1998 with the intermediate designation ISO 15561:1998(E). The present International Standard ISO/ASTM 51401:2002(E) is a revision of ISO 15561.

[2] The boldface numbers in parentheses refer to the bibliography at the end of this practice.

[3] *Annual Book of ASTM Standards*, Vol 15.02.

[4] *Annual Book of ASTM Standards*, Vol 12.02.

[5] *Annual Book of ASTM Standards*, Vol 14.02.

[6] *Annual Book of ASTM Standards*, Vol 03.06.

[7] Available from the Commission on Radiation Units and Measurements (ICRU), 7910 Woodmont Ave., Bethesda, MD 20814, U.S.A.

Rays with Maximum Photon Energies Between 0.6 and 60 MeV

ICRU Report 34 The Dosimetry of Pulsed Radiation

ICRU Report 35 Radiation Dosimetry: Electrons With Initial Energies Between 1 and 50 MeV

ICRU Report 37 Stopping Powers for Electrons and Positrons

ICRU Report 60 Radiation Quantities and Units

3. Terminology

3.1 *Definitions:*

3.1.1 *absorbed dose (D)*—quantity of ionizing radiation energy imparted per unit mass of a specified material. The SI unit of absorbed dose is the gray (Gy), where 1 gray is equivalent to the absorption of 1 joule per kilogram of the specified material (1 Gy = 1 J/kg). The mathematical relationship is the quotient of $d\bar\epsilon$ by dm, where $d\bar\epsilon$ is the mean incremental energy imparted by ionizing radiation to matter of incremental mass dm (see ICRU Report 60).

$$D = \frac{d\bar\epsilon}{dm} \tag{1}$$

3.1.1.1 *Discussion*—The discontinued unit for absorbed dose is the rad (1 rad = 100 erg/g = 0.01 Gy). Absorbed dose is sometimes referred to simply as dose.

3.1.2 *calibration facility*—combination of an ionizing radiation source and its associated instrumentation that provides a uniform and reproducible absorbed dose, or absorbed-dose rate traceable to national or international standards at a specified location and within a specific material, and that may be used to derive the dosimetry system's response function or calibration curve.

3.1.3 *dosimetry system*—a system used for determining absorbed dose, consisting of dosimeters, measurement instruments, and their associated reference standards, and procedures for the system's use.

3.1.4 *measurement quality assurance plan*—a documented program for the measurement process that ensures on a continuing basis that the overall uncertainty meets the requirements of the specific application. This plan requires traceability to, and consistency with, nationally or internationally recognized standards.

3.1.5 *net absorbance, (ΔA)*—change in measured optical absorbance at a selected wavelength determined as the absolute difference between the pre-irradiation absorbance, A_0, and the post-irradiation absorbance, A, as follows:

$$\Delta A = |A - A_0| \tag{2}$$

3.1.6 *reference–standard dosimeter*—a dosimeter of high metrological quality, used as a standard to provide measurements traceable to and consistent with measurements made using primary–standard dosimeters.

NOTE 3—For other terms, see ASTM Terminology E 170.

4. Significance and Use

4.1 The dichromate system provides a reliable means for measuring absorbed dose in water. It is based on a process of reduction of dichromate ions to chromic ions in acidic aqueous solution by ionizing radiation.

4.2 The dosimeter is a solution containing silver and dichromate ions in perchloric acid in an appropriate container such as a flame-sealed glass ampoule. The solution indicates absorbed dose by a change (decrease) in optical absorbance at a specified wavelength(s) (**3**). A calibrated spectrophotometer is used to measure the absorbance.

4.3 *Effect of Irradiation Temperature*:

4.3.1 The dosimeter response has a temperature dependence during irradiation that is approximately equal to –0.2 % per degree Celsius between 25 and 50°C. At temperatures below 25°C, the dependence is smaller. The dosimeter response between 5 and 50°C is shown in Table 1, where the response at a given temperature is tabulated relative to the response at 25°C (**4**).

4.3.2 The data in Table 1 may be fitted with an appropriate formula for convenience of interpolation as follows:

$$R_T = b_0 + b_1 T^{b_2} \tag{3}$$

where:

R_T = dosimeter response at temperature T relative to that at 25°C.

The fitted data is shown in Fig. 1.

4.4 No effect of ambient light (even direct sunlight) has been observed on dichromate solutions in glass ampoules (**5**).

4.5 For calibration with photons, the dichromate dosimeter shall be irradiated under conditions that approximate electron equilibrium.

4.6 The absorbed dose in other materials irradiated under equivalent conditions may be calculated. Procedures for making such calculations are given in ASTM Practices E 666, E 668 and ISO/ASTM Guide 51261.

NOTE 4—For a comprehensive discussion of various dosimetry methods applicable to the radiation types and energies discussed in this practice, see ICRU Reports 14, 34, 35, and 37.

4.7 The dosimeter response is dependent on the type and energy of the radiation employed. For example, the response in high energy (10 MeV) electron beams is reported to be approximately 3 % lower than the response in cobalt-60 radiation (**2**). The dosimeter shall be calibrated in a radiation field of the same type and energy as that in which it is to be used.

5. Interferences

5.1 The dichromate dosimetric solution response is sensitive to impurities, particularly organic impurities. Even in trace quantities, impurities can cause a detectable change in the observed response (**5**). For high accuracy results, organic

TABLE 1 Effect of Irradiation Temperature on Dosimeter Response

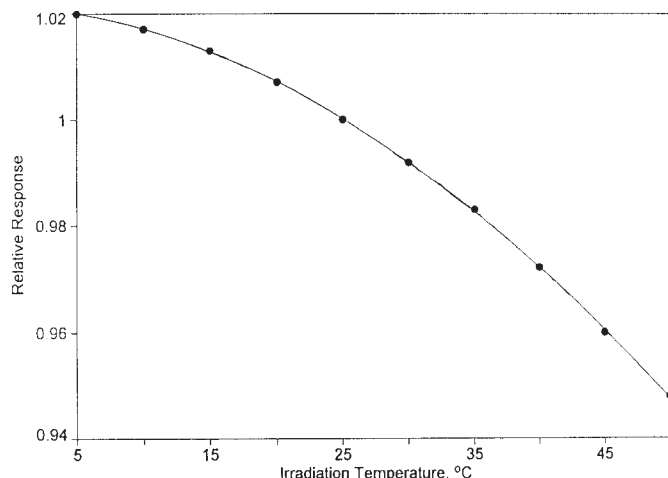| Temperature, °C	Response	Temperature, °C	Response
5	1.020	30	0.992
10	1.017	35	0.983
15	1.013	40	0.972
20	1.007	45	0.960
25	1.000	50	0.948

FIG. 1 Relative Response of Dichromate Dosimeter as a Function of Irradiation Temperature. A Fit of the Data Using Eq 3 Yields Fit Parameters as Follows: $b_0 = 1.021$; $b_1 = -6.259 \times 10^{-5}$; $b_2 = 1.806$.

materials shall not be used for any component in contact with the solution. The effect of trace impurities may be minimized by pre-irradiation of the bulk dichromate solution (see Ref **(5)** and 8.2).

5.2 Undesirable chemical changes in the dosimetric solution can occur if care is not taken during flame-sealing of the ampoules (see 8.4).

6. Apparatus

6.1 *High-Precision Spectrophotometer*—For the analysis of the dosimetric solution, use a high-precision spectrophotometer capable of measuring absorbance values up to 2 with an uncertainty of no more than ±1 % in the region of 350 to 440 nm. Use a quartz cuvette with 5 or 10 mm path length for spectrophotometric measurements of the solution. The cuvette capacity must be small enough to allow it to be thoroughly rinsed by the dosimeter solution and still leave an adequate amount of that solution to fill the cuvette to the appropriate level for the absorbance measurement. For dosimeter ampoules of 2 mL or less, this may require the use of micro-capacity cuvettes. Other solution handling techniques, such as the use of micro-capacity flow cells, may be employed provided precautions are taken to avoid cross-contamination. Control the temperature of the dosimetric solution during measurement at 25 ± 1°C. If this is not possible, determine the solution temperature during the spectrophotometric analysis and correct the measured absorbance to 25°C. The temperature coefficient during measurement is –0.1 % per degree Celsius within the range of 20 to 30°C **(5)**.

NOTE 5—The dosimetric ampoule commonly used has a capacity of about 2 mL.

6.2 *Glassware*—Use borosilicate glass or equivalent chemically resistant glass to store the reagents and the prepared dosimetric solution. Clean all apparatus used in the preparation of the solution, as well as the glass ampoules or other irradiation containers using chromic acid solution or an equivalent cleaning agent. Rinse at least three times with double-distilled water (see ASTM Practice C 912). Dry thoroughly and store in a dust-free environment (see ASTM Practice E 1026).

7. Reagents

7.1 Analytical reagent grade (or better) chemicals shall be used in this practice for preparing all solutions.

7.2 Use of double-distilled water from coupled all-glass and silica stills is recommended. Water purity is very important since it is the major constituent of the dosimetric solutions, and therefore may be the prime source of contamination. Use of deionized water is not recommended.

NOTE 6—Double-distilled water distilled from an alkaline permanganate ($KMnO_4$) solution (2 g $KMnO_4$ plus 5 g sodium hydroxide (NaOH) pellets in 2 dm^3 of distilled water) has been found to be adequate for routine preparation of the dichromate dosimetric solution. High purity water is commercially available from some suppliers. Such water labelled HPLC (high pressure liquid chromatography) grade is usually sufficiently free of organic impurities to be used in this practice.

8. Preparation of Dosimeters

8.1 The recommended concentrations for the dichromate dosimeter to measure absorbed doses from about 2 to 10 kGy (hereafter called the low-range dosimeter) are 0.5×10^{-3} mol dm^{-3} silver dichromate ($Ag_2Cr_2O_7$) in 0.1 mol dm^{-3} aqueous perchloric acid **(6)**. For measurement of absorbed doses from about 5 to 50 kGy (using the dosimeter hereafter called the high-range dosimeter), the recommended concentrations are 0.5×10^{-3} mol dm^{-3} silver dichromate and 2.0×10^{-3} mol dm^{-3} potassium dichromate ($K_2Cr_2O_7$) in 0.1 mol dm^{-3} aqueous perchloric acid **(5)**. Air saturate both solutions before use. Silver dichromate dissolves slowly and normally requires at least 18 h to dissolve completely. For the high range dosimeter, it is preferable to dissolve the silver dichromate before adding the potassium dichromate.

NOTE 7—**Precaution:** Concentrated perchloric acid is a strong oxidizer and dichromate salts are skin irritants. Appropriate precautions should be exercised in handling these materials.

NOTE 8—Dichromate dosimeters of other formulations have been described **(7,8)**.

8.2 If appropriate, irradiate the bulk solution to minimize the effects of impurities.

8.2.1 The exact dose is not critical, but a minimum dose of 1.0 kGy is recommended **(5)**.

8.2.2 Choose the size of the container for this bulk solution so that the dose delivered to any part of the solution is 1.1 ± 0.1 kGy.

8.2.3 Mix the solution thoroughly after irradiation.

8.3 Rinse the dosimeter ampoules or other containers as prepared in 6.2 at least once with the dosimeter solution before filling them for irradiation.

8.4 Exercise care in filling ampoules to avoid depositing solution in the ampoule neck. Subsequent heating during sealing may cause an undesirable chemical change in the dosimetric solution remaining inside the ampoule neck. For the same reason, exercise care to avoid heating the body of the ampoule during sealing.

9. Spectrophotometer Calibration

9.1 Check the wavelength scale of the spectrophotometer

and establish its accuracy. The emission spectrum from a low-pressure mercury arc lamp can be used for this purpose. Such a lamp may be obtained from the spectrophotometer manufacturer or other scientific laboratory instrument suppliers. Other appropriate wavelength standards are holmium-oxide filters or solutions. For more details, see ASTM Practices E 275, E 925, and E 958.

NOTE 9—For example, holmium-oxide solutions in sealed cuvettes are available as certified wavelength standards (SRM 2034) for use in the wavelength region of 240 nm to 650 nm.[8]

9.2 Check the accuracy of the photometric (absorbance) scale of the spectrophotometer. Certified absorbance standard filters or solutions are available for this purpose.

NOTE 10—Examples of absorbance standards are solutions of various concentrations such as SRM 931d and SRM 935 (9) and metal-on-quartz filters such as SRM 2031.[8]

10. Calibration Procedures

10.1 *Irradiation*:

10.1.1 Separate five dosimeters from the remainder of the batch and do not irradiate them. Use them in determining A_0 (see 10.3.1).

10.1.2 Calibrate the dosimeters, using an irradiation facility that has a dose rate traceable to national standards and that meets the requirements specified in ISO/ASTM Practice 51400. Use a reference or transfer dosimetry system to establish this traceability (see ISO/ASTM Guide 51261, ASTM Practice E 1026, and ISO/ASTM Practice 51205).

10.1.3 Specify the calibration dose in terms of absorbed dose in water (for example, see ASTM Practice E 1026 and ISO/ASTM Practice 51205).

10.1.4 Position the dosimeters in the calibration radiation field in a defined, reproducible location.

10.1.5 When using a gamma-ray source for calibration, surround the dosimeters with a sufficient amount of material to achieve approximate electron equilibrium conditions.

NOTE 11—The appropriate thickness of such material depends on the energy of the radiation (see ASTM Practices E 666 and E 668). For measurement of absorbed dose in water, use materials that have radiation absorption properties essentially equivalent to water. For example, for a ^{60}Co source, 3 to 5 mm of polystyrene (or equivalent polymeric material) should surround the dosimeter in all directions.

10.1.6 When using an electron beam for calibration, locate the dosimeters in a well characterized position within the radiation field.

10.1.7 Make the calibration field within the volume occupied by the dosimeter(s) as uniform as possible. The variation in dose rate within this volume should be within ±1 %.

10.1.8 Control (or monitor) the temperature of the dosimeters during irradiation. Calculate or measure the mean irradiation temperature of each dosimeter to an accuracy of ±2°C, or better.

10.1.9 Calibrate each batch of dosimeters prior to routine use.

___

[8] Available from National Institute of Standards and Technology (NIST), Gaithersburg, MD 20899, U.S.A.

10.1.10 Use a set of at least three dosimeters for each absorbed dose value.

10.1.11 Irradiate these sets of dosimeters to at least five known dose values covering the range of utilization in order to determine the calibration curve for the dosimetry system.

10.2 *Measurement*:

10.2.1 For the low-range dosimeter, set the wavelength of the spectrophotometer at 350 nm, and use a spectral bandwidth of no more than 1 nm. For the high-range dosimeter, set the wavelength at 440 nm, and use a spectral bandwidth of no more than 1 nm.

10.2.2 Set the balance of the spectrometer to zero with air only (no cuvette) in the light path(s).

10.2.3 Fill a clean cuvette (or flow cell) of 5 or 10 mm pathlength with double-distilled water and measure the absorbance. Record this value.

NOTE 12—Choice of pathlength depends on the maximum absorbance that can be accurately measured by the spectrophotometer. For example, a pathlength of 10 mm will result in an absorbance of about 1.3 (or 0.65 for a pathlength of 5 mm) for the unirradiated dosimetric solution. The absorbance of irradiated solutions will be less than 1.3, that is, the absorbance decreases with increasing dose.

10.2.4 Empty the water from the cuvette (or flow cell) and rinse it at least once with the solution from an ampoule. Discard the rinse solution and fill to the appropriate level with more solution from the same ampoule. Carefully wipe off any solution on the exterior surfaces of the cuvette and measure the absorbance. Repeat this procedure for all unirradiated and irradiated solutions.

NOTE 13—Inadequate rinsing of the cuvette (or flow cell) between dosimeter solutions can lead to errors due to solution carryover (cross-contamination). Techniques for minimizing this effect are discussed in Ref (9).

10.2.5 Check the zero balance after each sample with air only in the light beam(s). Periodically during the measurement process, remeasure the absorbance of distilled water to detect any contamination of the cuvette (or flow cell) and take appropriate corrective actions if required.

10.3 *Analysis*:

10.3.1 Calculate the mean absorbance of the unirradiated dosimeters, A_0 (see 10.1.1). Calculate the net absorbance, ΔA, for each irradiated dosimeter by subtracting its absorbance, A_i, from A_0 as follows:

$$\Delta A = A_0 - A_i \qquad (4)$$

10.3.1.1 Using the data in Table 1 and Eq 3, correct the measured net absorbance ΔA to the net absorbance expected for an irradiation temperature of 25°C using the formula:

$$\Delta A_{25} = \Delta A_t / R_t \qquad (5)$$

10.3.2 Prepare a calibration curve by plotting the ΔA values versus absorbed dose, D. Fit the data by means of a least-squares method with an appropriate analytical form that provides a best fit to the data. The data for these dichromate dosimeters should fit a second-order polynomial of the form:

$$\Delta A = b_0 + b_1 D + b_2 D^2 \qquad (6)$$

10.3.2.1 Examples of calibration test data of solutions

known to produce good dosimetric results are given in Table 2. The conditions during irradiation and measurement for these data were as follows:

Radiation type:^{60}Co
Irradiation and measurement temperature: 25°C
Optical path length during analysis: 10 mm
Wavelength for analysis of high-range dosimeter: 440 nm
Wavelength for analysis of low-range dosimeter: 350 nm

Note 14—Computer software is available commercially for performing least-squares fits of data with polynomials or other analytical forms.

10.3.3 Graphs of the data in Table 2 are shown in Fig. 2 and Fig. 3. The curves should tend towards $\Delta A = 0$ at zero dose. An appreciable ΔA intercept value is indicative of contamination of the dosimetric solution with impurities.

10.3.4 Compare the net absorbances determined by a given calibration with the examples given in Table 2. For cobalt-60 radiation, agreement should be within ± 3 % if the dosimetric solutions were properly prepared and all associated analysis equipment was properly calibrated. Values for high energy electron beam irradiation should be approximately 3 % lower. Agreement of the dosimetric response values from batch to batch over the useful range of the system should be within ± 1 %.

10.3.5 Estimate the precision (random uncertainty) of the individual dosimeter results either from the results of replicate measurements or from the statistics of the least-squares fit to the data. The precision provides a measure of acceptable performance of the dosimetry system. The precision, expressed as one standard deviation, should not exceed 0.002 absorbance units for the high-range dosimeter or 0.003 absorbance units for the low range dosimeter for an optical pathlength of 10 mm. Suspected data outliers should be tested using statistical procedures such as those found in ASTM Practice E 178.

11. Application of Dosimetry System

11.1 For most applications, use a minimum of three dosimeters for each dose measurement. The number of dosimeters required for the measurement of absorbed dose on or within a material is determined by the precision of the dosimetry system and the required precision associated with the application. Appendix X3 of ASTM Practice E 668 describes a statistical method for determining this number.

11.2 Use the irradiation and measurement procedures in accordance with 10.1.1, 10.1.3, 10.1.8, 10.2.1-10.2.5, and 10.3.1.

TABLE 2 Typical Dichromate Calibration Data

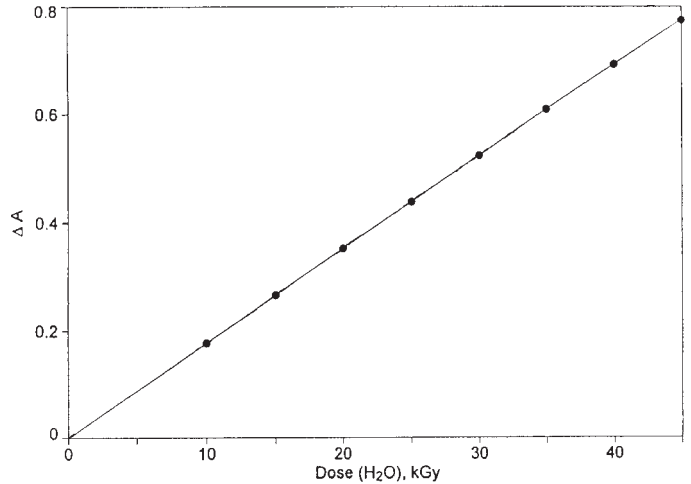| High-Range Dosimeter Approximate ΔA = 1.1		Low-Range Dosimeter Approximate ΔA = 1.3	
Dose, kGy	ΔA	Dose, kGy	ΔA
10.0	0.1769	1.0	0.1185
15.0	0.2648	2.0	0.2374
20.0	0.3518	3.0	0.3557
25.0	0.4381	4.0	0.4733
30.0	0.5235	5.0	0.5902
35.0	0.6081	6.0	0.7065
40.0	0.6918	7.0	0.8220
45.0	0.7748	8.0	0.9369
		9.0	1.0511
		10.0	1.1646

FIG. 2 Response of High-Range Dosimeter in Terms of ΔA as a Function of Absorbed Dose in Water. A Least-Squares Second Order Polynomial Fit (see Eq 6) of the Data Yields Fit Parameters as Follows: $b_0 = 1.338 \times 10^{-3}$; $b_1 = 1.799 \times 10^{-2}$; $b_2 = 1.648 \times 10^{-5}$.
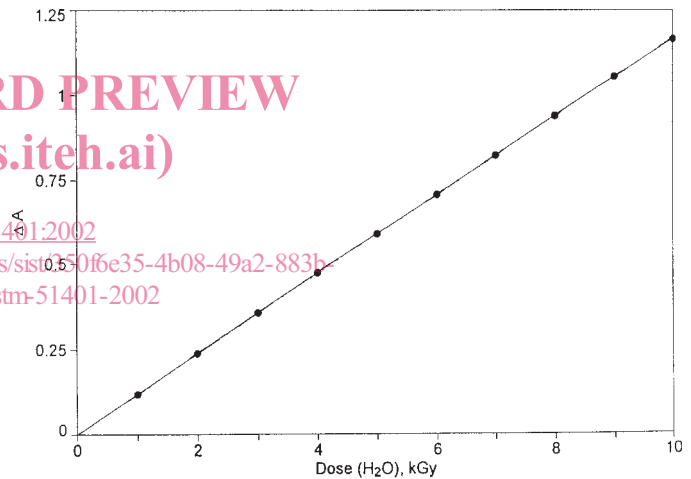

FIG. 3 Response of the Low-Range Dosimeter in Terms of ΔA as a Function of Absorbed Dose in Water. A Least-Squares Second Order Polynomial Fit (see Eq 6) of the Data Yields Fit Parameters as Follows: $b_0 = 1.162 \times 10^{-3}$; $b_1 = 1.200 \times 10^{-1}$; $b_2 = 3.398 \times 10^{-4}$.

11.3 Determine the absorbed dose from the net absorbance values and the calibration curve.

11.4 Record the calculated absorbed dose values and all other relevant data as outlined in Section 12.

12. Minimum Documentation Requirements

12.1 *Calibration*:

12.1.1 Record the dosimeter type and batch number (code).

12.1.2 Record or reference the date, irradiation temperature, temperature variation (if any), dose range, radiation source, and associated instrumentation used to calibrate and analyze the dosimeters.

12.2 *Application*:

12.2.1 Record the date and temperature of irradiation, temperature variation (if any), and the date and temperature of absorbance measurement, for each dosimeter.