INTERNATIONAL STANDARD

ISO
812

Second edition
2006-06-01

Rubber, vulcanized or thermoplastic — Determination of low-temperature brittleness

Caoutchouc vulcanisé ou thermoplastique — Détermination de la fragilité à basse température

© ISO 2006

PDF disclaimer

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

iTeh STANDARD PREVIEW

(standards.iteh.ai)

ISO 812:2006
https://standards.iteh.ai/catalog/standards/sist/bfe25b51-42f8-4d52-b1ae-
4adb35590be0/iso-812-2006

Contents

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 812 was prepared by Technical Committee ISO/TC 45, *Rubber and rubber products*, Subcommittee SC 2, *Testing and analysis*.

This second edition cancels and replaces the first edition (ISO 812:1991), which has been technically revised.

Rubber, vulcanized or thermoplastic — Determination of low-temperature brittleness

WARNING — Persons using this International Standard should be familiar with normal laboratory practice. This standard does not purport to address all of the safety problems, if any, associated with its use. It is the responsibility of the user to establish appropriate safety and health practices and to ensure compliance with any national regulatory conditions.

1 Scope

This International Standard specifies a method for determining the lowest temperature at which rubber materials do not exhibit brittle failure or the temperature at which half of the test pieces used in a test fail when impacted under specified conditions.

The temperatures thus determined do not necessarily relate to the lowest temperature at which the material can be used since the brittleness will be affected by the conditions of test and especially by the rate of impact. Data obtained by this method should, therefore, be used to predict the behaviour of rubbers at low temperatures only in applications in which the conditions of deformation are similar to those specified in the test.

Three procedures are described:

— procedure A, in which the brittleness temperature is determined;

— procedure B, in which the brittleness temperature for 50 % failure is determined;

— procedure C, in which the test piece is impacted at a specified temperature.

Procedure C is used in the classification of rubber materials and for specification purposes.

NOTE   A similar test for rubber-coated fabrics is described in ISO 4646, *Rubber- or plastics-coated fabrics — Low-temperature impact test*.

2 Normative references

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 23529, *Rubber — General procedures for preparing and conditioning test pieces for physical test methods*

3 Terms and definitions

For the purposes of this document, the following terms and definitions apply.

3.1
brittleness temperature
lowest temperature at which none of a set of of test pieces fractures due to low-temperature embrittlement when tested under the specified conditions

3.2
50 % brittleness temperature
temperature at which 50 % of a set of test pieces fracture due to low-temperature embrittlement when tested under the specified conditions

3.3
testing speed
relative linear velocity at impact between the striking edge of the test apparatus and a clamped test piece.

4 Apparatus and materials

4.1 Test piece clamp and striker, meeting the requirements of 4.1.1 to 4.1.3.

4.1.1 The test piece clamp shall be rigid and designed to hold the test piece(s) as cantilever beam(s). Each individual test piece shall be held firmly and securely in the clamp without distortion. A suitable example of a clamp is shown in Figure 1.
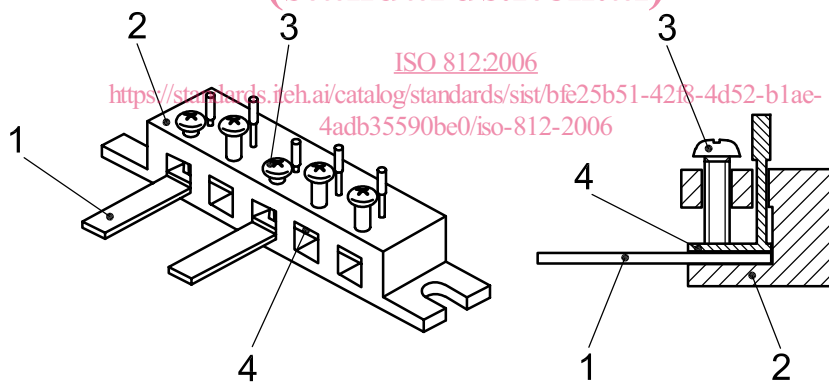
Key

1 test piece
2 body of clamp
3 holding screw
4 test piece holder

Figure 1 — Example of test piece clamp

4.1.2 The striking edge shall move relative to the test piece(s) along a path normal to the upper surface of the test piece(s) at a linear testing speed of 2,0 m/s ± 0,2 m/s at impact. The speed shall be maintained within this range for at least 6 mm of travel following the impact.

In order to obtain a speed within the specified limits during and after impact, care shall be taken to ensure that the striking energy is sufficient. It has been found that a striking energy of at least 3,0 J per test piece is necessary. It may therefore be necessary to limit the number of test pieces impacted at one time.

4.1.3 The principal dimensions of the apparatus [see Figures 2a) and 2b)] shall be as follows:

a) the striking edge shall have a radius of 1,6 mm ± 0,1 mm;

b) the clearance between the striker and the test piece clamp at impact shall be 6,4 mm ± 0,3 mm;

c) the separation between the point of impact of the striking edge and the test piece clamp shall be 8 mm ± 0,3 mm.

NOTE   Commercial apparatus is available meeting the requirements of this International Standard in which the striking edge is rotated by a motor, or travels in a straight line under the action of a solenoid, gravity or a spring. A method for the speed calibration of a solenoid-actuated-type low-temperature impact tester is given in Annex A.

Dimensions in millimetres

a) **Straight-line motion**   b) **Rotational motion**

Key
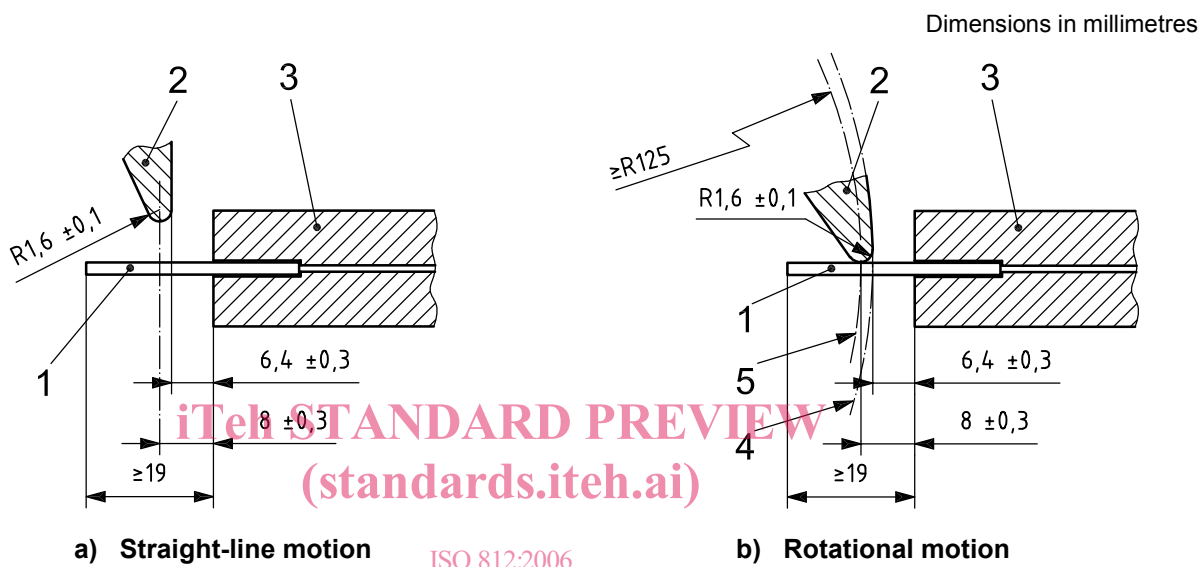
1   test piece
2   striker
3   test piece clamp
4   locus described by point on striker closest to test piece clamp
5   locus described by impact point on striker

Figure 2 — Test piece clamp and striker

4.2   Temperature indicator, comprising a thermocouple, thermometer or other temperature-sensing device capable of covering the range of temperatures in which testing is being carried out and accurate to within ± 0,5 °C.

The temperature sensor shall be placed as near to the test pieces as possible.

4.3   Bath or test chamber, capable of holding the heat-transfer medium (4.4) and of maintaining it at the test temperature to within ± 0,5 °C.

4.4   Heat-transfer medium, liquid or gaseous, which remains fluid at the test temperature and which does not appreciably affect the material being tested.

NOTE   The following fluids have been used satisfactorily:

a) for temperatures down to – 60°C, silicone fluids of kinematic viscosity 5 mm^2/s at ambient temperature, which are usually suitable owing to their chemical inertness towards rubbers, their non-flammability and their non-toxicity;

b) for temperatures down to – 70 °C, ethanol;

c) for temperatures down to – 120 °C, methylcyclohexane cooled by liquid nitrogen (found to be satisfactory with the use of suitable apparatus).

5   Test pieces

Test pieces shall be

— either type A: a strip 26 mm to 40 mm long, 6 mm $\pm$ 1 mm wide and 2,0 mm $\pm$ 0,2 mm thick;

— or type B: a test piece 2,0 mm $\pm$ 0,2 mm thick and of the shape and dimensions given in Figure 3.

Test pieces shall be prepared in accordance with ISO 23529. They shall normally be punched from sheet using a suitable sharp die. Alternatively, type A test pieces may be prepared using sharp, parallel double-bladed cutters, in a single stroke. The strip so formed is then cut to the correct length.
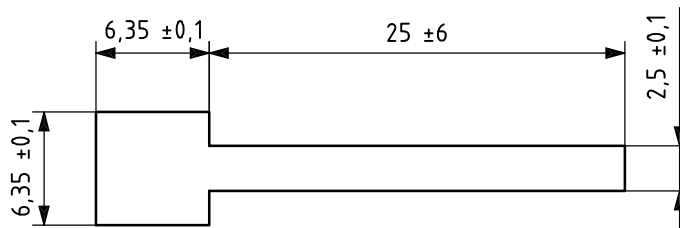
Dimensions in millimetres

Figure 3 — Type B test piece

iTeh STANDARD PREVIEW

6   Time interval between manufacture and testing (standards.iteh.ai)

Unless otherwise specified, the time interval between the date the material was formed and testing shall be in accordance with ISO 23529.

7   Procedure

7.1   Procedure A (determination of brittleness temperature)

7.1.1   Bring the bath or test chamber to a temperature below the expected lowest temperature of non-failure. In the case of a liquid heat-transfer medium, place sufficient liquid in the bath to ensure approximately 25 mm depth or more of the liquid over the test piece(s). Pre-cool the test piece clamp by immersing it in the cooled bath or test chamber.

7.1.2   Quickly mount the test piece(s) in the test piece clamp and immerse them for 5 min at the test temperature when using a liquid medium or for 10 min when using a gaseous medium (see also ISO 23529).

NOTE 1   For very soft materials, it may be necessary to use a device to support the test piece horizontally until just before the striker is released.

The free length of the test piece(s) shall be greater than 19 mm.

Test five type A or type B test pieces. If the available striking energy has the minimum value specified in 4.1.2, they may all be tested at the same time.

Proper tightening of the clamp is of the utmost importance. The clamp shall be tightened so that each test piece is held with approximately the same clamping torque.

NOTE 2   It has been reported that the temperature at which a test piece fails may be affected by the clamping torque. Clamping to a torque of 0,15 N to 0,25 N is suggested.

7.1.3   After immersion for the specified time at the test temperature, record the temperature and deliver a single impact blow to the test piece(s).

7.1.4   Remove the test pieces from the test piece clamp and allow them to reach standard laboratory temperature. Examine each test piece to determine whether or not it has failed. Failure is defined as any crack, fissure or hole visible to the naked eye, or complete separation into two or more pieces. Where a test piece has not completely separated, bend it to an angle of 90° in the same direction as the bend caused by the impact. Then examine it for cracks at the bend.

7.1.5   Repeat the test at each of a series of successively higher temperatures 10 °C apart, using a new set of test pieces at each temperature, until no failure is obtained. Then decrease the temperature to the highest value at which a failure was observed and carry out tests at temperatures increasing at 2 °C intervals to determine the temperature at which no failure is observed. Record this as the brittleness temperature.

NOTE   If crystallization or time-dependent effects of plasticizers are to be studied, longer conditioning periods in a gaseous medium may be used.

7.2   Procedure B (determination of 50 % brittleness temperature)

7.2.1   Carry out the procedure described in 7.1.1 to 7.1.4, except that the starting temperature is that at which 50 % failure is expected.

7.2.2   If all of the test pieces fail at the starting temperature, increase the temperature by 10 °C and repeat the test. If none of the test pieces fail at the starting temperature, decrease the temperature by 10 °C and repeat the test. Increase or decrease the temperature in increments of 2 °C and repeat the test until the lowest temperature at which none of the test pieces fails and the highest temperature at which all of the test pieces fail is determined. Record the number of failures at each temperature. Use a new set of test pieces at each temperature. Determine the 50 % brittleness temperature by calculation using the equation in 7.2.3 or by the graphical method described in 7.2.4.

7.2.3   **Calculation**: From the number of failures at each temperature, calculate the percentage of failures at each temperature to determine the 50 % brittleness temperature from the following equation:

$$T_b = T_h + \Delta T \left(\frac{S}{100} - \frac{1}{2} \right)$$

where

T_b is the 50 % brittleness temperature (°C);

T_h is the highest temperature at which all test pieces fail (°C);

ΔT is the interval between the test temperatures (°C);

S is the total of the percentages of failures at each temperature, from the temperature at which no test piece fails to the temperature at which they all fail, T_h (%).

7.2.4   **Graphical method**: From the number of failures at each temperature, calculate the percentage of failures at each temperature. Next, using normal probability paper as shown in Figure 4, plot these percentages against the temperature, taking the temperature on the linear scale and the percentage of failures on the probability scale, and draw the best-fit straight line through the points. The temperature at the point of intersection of this line and the 50 % probability line is T_b, the 50 % brittleness temperature.

5