ASTM INTERNATIONAL

Designation: E 399 – 05

Standard Test Method for
Linear-Elastic Plane-Strain Fracture Toughness K_{Ic} of Metallic Materials[1]

This standard is issued under the fixed designation E 399; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ε) indicates an editorial change since the last revision or reapproval.

This standard has been approved for use by agencies of the Department of Defense.

1. Scope

1.1 This test method covers the determination of fracture toughness (K_{Ic}) of metallic materials under predominantly linear-elastic, plane-strain conditions using fatigue precracked specimens having a thickness of 1.6 mm (0.063 in.) or greater[2] subjected to slowly, or in special (elective) cases rapidly, increasing crack-displacement force. Details of test apparatus, specimen configuration, and experimental procedure are given in the Annexes.

NOTE 1—Plane-strain fracture toughness tests of thinner materials that are sufficiently brittle (see 7.1) can be made using other types of specimens (1).[3] There is no standard test method for such thin materials.

1.2 This test method is divided into two parts. The first part gives general recommendations and requirements for K_{Ic} testing. The second part consists of Annexes that give specific information on displacement gage and loading fixture design, special requirements for individual specimen configurations, and detailed procedures for fatigue precracking. Additional annexes are provided that give specific procedures for beryllium and rapid-force testing.

1.3 General information and requirements common to all specimen configurations:

1.4 Specific requirements related to test apparatus:

1.5 Specific requirements related to individual specimen configurations:

---

[1] This test method is under the jurisdiction of ASTM Committee E08 on Fatigue and Fracture and is the direct responsibility of Subcommittee E08.07 on Linear-Elastic Fracture.

Current edition approved April 1, 2005. Published June 2005. Originally approved in 1970. Last previous edition approved in 1997 as E 399 – 90 (1997).

[2] For additional information relating to the fracture toughness testing of aluminum alloys, see Practice B 645.

[3] The boldface numbers in parentheses refer to the list of references at the end of this standard.

1.6 Specific requirements related to special test procedures:

1.7 The values stated in SI units are to be regarded as the standard. The values given in parentheses are for information only.

1.8 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

2. Referenced Documents

2.1 *ASTM Standards:* [4]

B 645 Practice for Plane-Strain Fracture Toughness Testing of Aluminum Alloys

E 4 Practices for Force Verification of Testing Machines

E 8 Test Methods for Tension Testing of Metallic Materials

E 337 Test Method for Measuring Humidity with a Psychrometer (the Measurement of Wet- and Dry-Bulb Temperatures)

E 1820 Test Method for Measurement of Fracture Toughness

E 1823 Terminology Relating to Fatigue and Fracture Testing

E 1921 Test Method for Determination of Reference Temperature, T_o, for Ferritic Steels in the Transition Range

3. Terminology

3.1 *Definitions:Terminology E 1823 is applicable to this test method*:

3.1.1 *stress-intensity factor, K, K_I, K_{II}, K_{III} [FL$^{-3/2}$]*—magnitude of the ideal-crack-tip stress field (a stress-field singularity), for a particular mode of crack displacement, in a homogeneous, linear-elastic body.

3.1.1.1 *K* is a function of applied force and test specimen size, geometry, and crack size, and has the dimensions of force times length$^{-3/2}$.

3.1.1.2 Values of *K* for modes I, II, and III are given as:

$$K_I = \lim_{r\to 0} \left[\sigma_{yy}(2\pi r)^{1/2}\right] \qquad (1)$$

$$K_{II} = \lim_{r\to 0} \left[\tau_{xy}(2\pi r)^{1/2}\right] \qquad (2)$$

$$K_{III} = \lim_{r\to 0} \left[\tau_{yz}(2\pi r)^{1/2}\right] \qquad (3)$$

where *r* is the distance directly forward from the crack tip to the location where the significant stress is calculated.

3.1.1.3 Throughout this test method, mode I crack displacement is assumed.

3.1.2 *plane-strain fracture toughness*—crack extension resistance under conditions of crack-tip plane strain.

3.1.2.1 For example, in mode I for slow rates of loading and under predominantly linear-elastic conditions and negligible plastic-zone adjustment, plain-strain fracture toughness is the value of stress-intensity factor designated K_{Ic} [FL$^{-3/2}$] measured using the operational procedure (and satisfying all of the validity requirements) specified in this test method, which provides for the measurement of crack-extension resistance at the "onset" (2 % or less) of crack extension and provides operational definitions of crack-tip sharpness, onset of crack extension, and crack-tip plane strain.

3.1.2.2 See also definitions of crack-extension resistance, crack-tip plane strain, and mode.

3.1.2.3 In this test method, mode I crack displacement is assumed.

3.1.3 *crack plane orientation*—identification of the plane and direction of crack extension in relation to the characteristic directions of the product. A hyphenated code defined in Terminology E 1823 is used wherein the letter(s) preceding the hyphen represents the direction normal to the crack plane and the letter(s) following the hyphen represents the anticipated direction of crack extension (see Fig. 1).

3.1.3.1 *Wrought Products*—the fracture toughness of wrought material depends on, among other factors, the orientation and propagation direction of the crack in relation to the material's anisotropy, which depends, in turn, on the principal directions of mechanical working and grain flow. Orientation of the crack plane shall be identified wherever possible. In addition, product form shall be identified (for example, straight-rolled plate, cross-rolled plate, pancake forging, and so forth) along with material condition (for example, annealed, solution treated plus aged, and so forth). The user shall be referred to product specifications for detailed processing information.
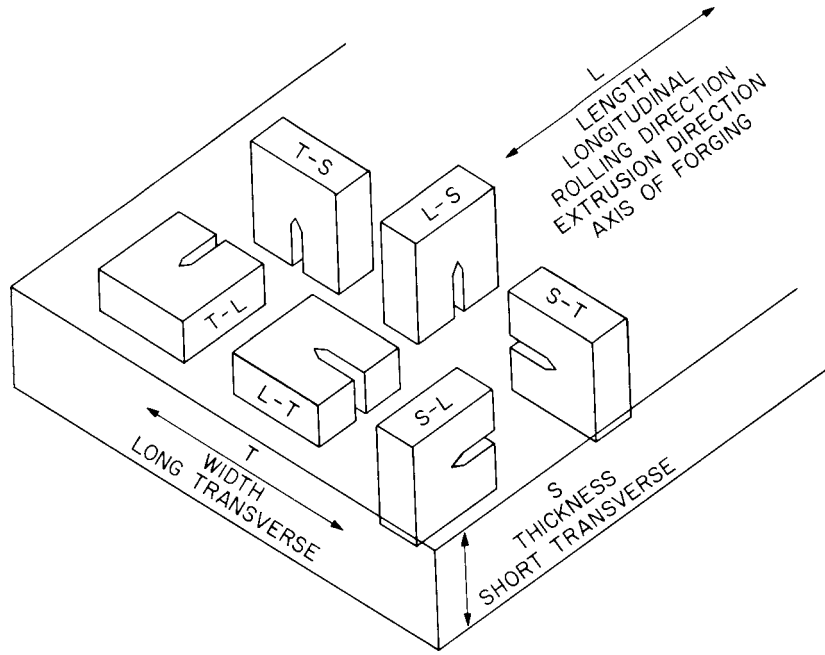
3.1.3.2 For rectangular sections, the reference directions are identified as in Fig. 1(a) and Fig. 1(b), which give examples for rolled plate. The same system is used for sheet, extrusions, and forgings with nonsymmetrical grain flow.

L = direction of principal deformation (maximum grain flow)
T = direction of least deformation
S = third orthogonal direction

3.1.3.3 Using the two-letter code, the first letter designates the direction normal to the crack plane, and the second letter the expected direction of crack propagation. For example, in Fig. 1(a), the T-L specimen fracture plane normal is in the width direction of a plate and the expected direction of crack propagation is coincident with the direction of maximum grain flow (or longitudinal) direction of the plate.

3.1.3.4 For specimens tilted in respect to two of the reference axes as in Fig. 1(b), crack plane orientation is identified by a three-letter code. The designation L-TS, for example, indicates the crack plane to be perpendicular to the principal deformation (L) direction, and the expected fracture direction to be intermediate between T and S. The designation TS-L means that the crack plane is perpendicular to a direction intermediate between T and S, and the expected fracture direction is in the L direction.

(a) Rectangular Sections—Specimens Aligned with Reference Directions
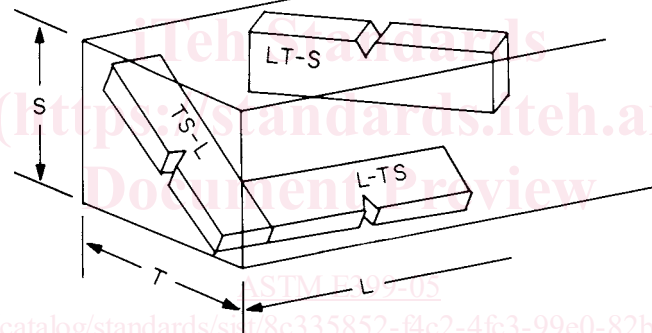
(b) Rectangular Sections—Specimens Not Aligned with Reference Directions
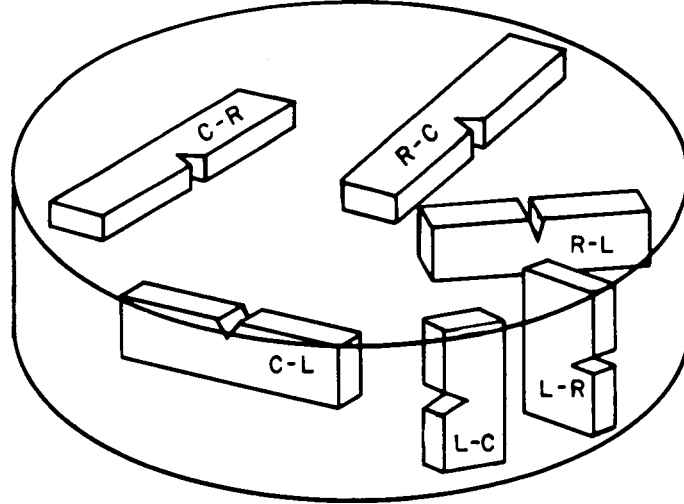
(c) Cylindrical Bars and Tubes

L = direction of maximum grain flow
R = radial direction
C = circumferential or tangential direction

FIG. 1 Crack Plane Identification

3

3.1.3.5 For cylindrical sections with principal deformation parallel to the longitudinal axis of the cylinder, the reference directions are identified as in Fig. 1(c), which depicts a drawn bar. The same system is useful for extrusions or forged parts having circular cross section.

> L = direction of maximum grain flow
> R = radial direction
> C = circumferential or tangential direction

3.1.3.6 In the case of complex structural shapes, where the grain flow is not uniform, specimen location and crack plane orientation shall reference component geometry and be noted on component drawings.

3.1.3.7 *Non-Wrought Products*—for non-wrought products, specimen location and crack plane orientation shall be defined on the part drawing. The result of a fracture toughness test from a non-wrought product shall not carry an orientation designation.

3.1.3.8 *Discussion*—when products are to be compared on the basis of fracture toughness, it is essential that specimen location and orientation with respect to product characteristic directions be comparable and that the results not be generalized beyond these limits.

3.2 *Definitions of Terms Specific to This Standard*:

3.2.1 *crack mouth opening displacement (CMOD)*, V_m *[L]*—component of clip gage displacement taken at the crack starter-notch mouth.

3.2.2 *stress-intensity factor rate, $\dot{K}$ ($FL^{-3/2}t^{-1}$)*—change in stress-intensity factor, K, per unit time.

4. Summary of Test Method

4.1 This test method covers the determination of the plane-strain fracture toughness (K_{Ic}) of metallic materials by increasing-force tests of fatigue precracked specimens. Force is applied either in tension or three-point bending. Details of the test specimens and experimental procedures are given in the Annexes. Force versus crack-mouth opening displacement (CMOD) is recorded either autographically or digitally. The force at a 5 % secant offset from the initial slope (corresponding to about 2.0 % apparent crack extension) is established by a specified deviation from the linear portion of the record (**1**). The value of K_{Ic} is calculated from this force using equations that have been established by elastic stress analysis of the specimen configurations specified in this test method. The validity of the K_{Ic} value determined by this test method depends upon the establishment of a sharp-crack condition at the tip of the fatigue crack in a specimen having a size adequate to ensure predominantly linear-elastic, plane-strain conditions. To establish the suitable crack-tip condition, the stress-intensity factor level at which specimen fatigue precracking is conducted is limited to a relatively low value.

4.2 The specimen size required for test validity increases as the square of the material's toughness-to-yield strength ratio. Therefore a range of proportional specimens is provided.

5. Significance and Use

5.1 The property K_{Ic} determined by this test method characterizes the resistance of a material to fracture in a neutral environment in the presence of a sharp crack under essentially linear-elastic stress and severe tensile constraint, such that *(1)* the state of stress near the crack front approaches tritensile plane strain, and *(2)* the crack-tip plastic zone is small compared to the crack size, specimen thickness, and ligament ahead of the crack.

5.1.1 Variation in the value of K_{Ic} can be expected within the allowable range of specimen proportions, *a/W* and *W/B*. K_{Ic} may also be expected to rise with increasing ligament size. Notwithstanding these variations, however, K_{Ic} is believed to represent a lower limiting value of fracture toughness (for 2 % apparent crack extension) in the environment and at the speed and temperature of the test.

5.1.2 Lower values of K_{Ic} can be obtained for materials that fail by cleavage fracture; for example, ferritic steels in the ductile-to-brittle transition region or below, where the crack front length affects the measurement in a stochastic manner independent of crack front constraint. The present test method does not apply to such materials and the user is referred to Test Method E 1921 and E 1820 . Likewise this test method does not apply to high toughness or high tearing-resistance materials whose failure is accompanied by appreciable amounts of plasticity. Guidance on testing elastic-plastic materials is given in Test Method E 1820.

5.1.3 The value of K_{Ic} obtained by this test method may be used to estimate the relation between failure stress and crack size for a material in service wherein the conditions of high constraint described above would be expected. Background information concerning the basis for development of this test method in terms of linear elastic fracture mechanics may be found in Refs (**1**) and (**3**).

5.1.4 Cyclic forces can cause crack extension at K_I values less than K_{Ic}. Crack extension under cyclic or sustained forces (as by stress corrosion cracking or creep crack growth) can be influenced by temperature and environment. Therefore, when K_{Ic} is applied to the design of service components, differences between laboratory test and field conditions shall be considered.

5.1.5 Plane-strain fracture toughness testing is unusual in that there can be no advance assurance that a valid K_{Ic} will be determined in a particular test. Therefore, compliance with the specified validity criteria of this test method is essential.

5.2 This test method can serve the following purposes:

5.2.1 In research and development, to establish in quantitative terms significant to service performance, the effects of metallurgical variables such as composition or heat treatment, or of fabricating operations such as welding or forming, on the fracture toughness of new or existing materials.

5.2.2 In service evaluation, to establish the suitability of a material for a specific application for which the stress conditions are prescribed and for which maximum flaw sizes can be established with confidence.

5.2.3 For specifications of acceptance and manufacturing quality control, but only when there is a sound basis for specifying minimum K_{Ic} values, and then only if the dimensions of the product are sufficient to provide specimens of the size required for valid K_{Ic} determination. The specification of K_{Ic} values in relation to a particular application should signify that a fracture control study has been conducted for the
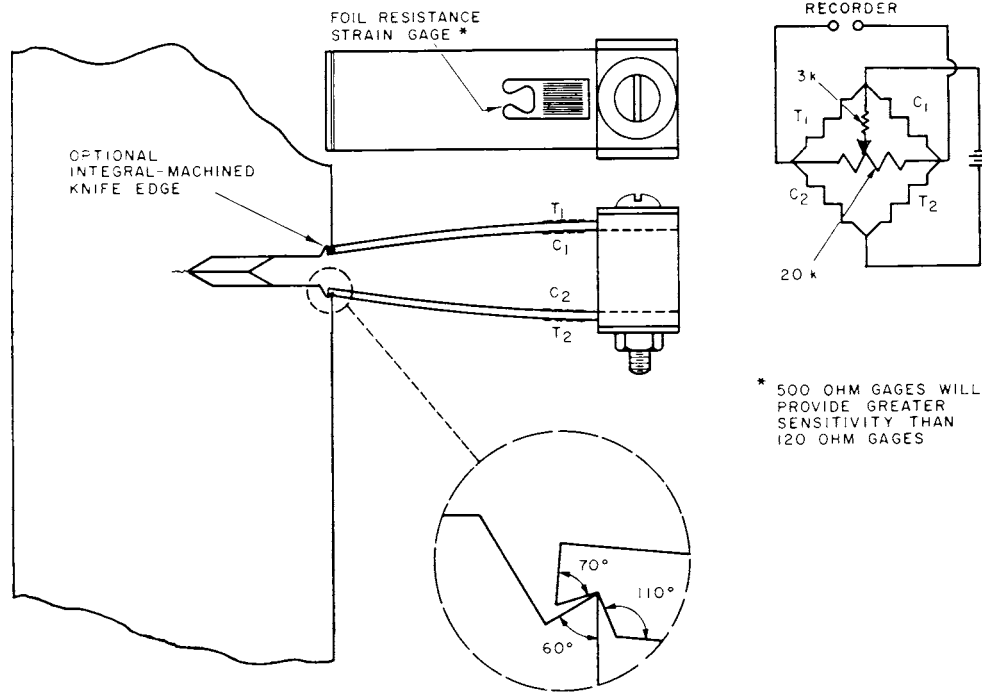
NOTE — Gage details are given in the Annex.

FIG. 2 Double–Cantilever Clip-In Displacement Gage Showing Mounting by Means of Integral Knife Edges
(Gage Design Details are Given in Annex A1)

component in relation to the expected loading and environment, and in relation to the sensitivity and reliability of the crack detection procedures that are to be applied prior to service and subsequently during the anticipated life.

6. Apparatus

6.1 *Testing Machine and Force Measurement*—The calibration of the testing machine shall be verified in accordance with Practices E 4. The test machine shall have provisions for autographic recording of the force applied to the specimen; or, alternatively, a computer data acquisition system that may be used to record force and CMOD for subsequent analysis.

6.2 *Fatigue Precracking Machine*—When possible, the calibration of the fatigue machine and force-indicating device shall be verified statically in accordance with Practices E 4. If the machine cannot be calibrated and verified statically, the applied force shall otherwise be known to ±2.5 %. Careful alignment of the specimen and fixturing is necessary to encourage straight fatigue cracks. The fixturing shall be such that the stress distribution is uniform across the specimen thickness and symmetrical about the plane of the prospective crack.

6.3 *Loading Fixtures*—Fixtures suitable for loading the specified specimen configurations are shown in the Annexes. The fixtures are designed to minimize friction contributions to the measured force.

6.4 *Displacement Gage*—The displacement gage electrical output represents relative displacement (V) of two precisely located gage positions spanning the crack starter notch mouth. Exact and positive positioning of the gage on the specimen is essential, yet the gage must be released without damage when the specimen breaks. Displacement gage and knife-edge designs shall provide for free rotation of the points of contact between the gage and the specimen. A recommended design for a self-supporting, releasable displacement gage is shown in Fig. 2 and described in Annex A1. The gage's strain gage bridge arrangement is also shown in Fig. 2.

6.4.1 The specimen shall be provided with a pair of accurately machined knife edges to support the gage arms and serve as displacement reference points. The knife edges may be machined integral with the specimen as shown in Figs. 2 and 3, or they may be separate pieces affixed to the specimen. A suggested design for attachable knife edges is shown in Fig. 4. This design features a knife edge spacing of 5 mm (0.2 in.). The effective gage length is established by the points of contact between the screw and the hole threads. For the design shown, the major diameter of the screw is used in setting this gage length. A No. 2 screw will permit the use of attachable knife edges for specimens having $W > 25$ mm (1.0 in.).

6.4.2 Each gage shall be verified for linearity using an extensometer calibrator or other suitable device. The resolution of the calibrator at each displacement interval shall be within 0.00051 mm (0.000020 in.). Readings shall be taken at ten equally spaced intervals over the working range of the gage (see Annex A1). The verification procedure shall be performed three times, removing and reinstalling the gage in the calibration fixture after each run. The required linearity shall correspond to a maximum deviation of 0.003 mm (0.0001 in.) of the individual displacement readings from a least-squares-best-fit straight line through the data. The absolute accuracy, as such, is not important in this application, since the test method is concerned with relative changes in displacement rather than
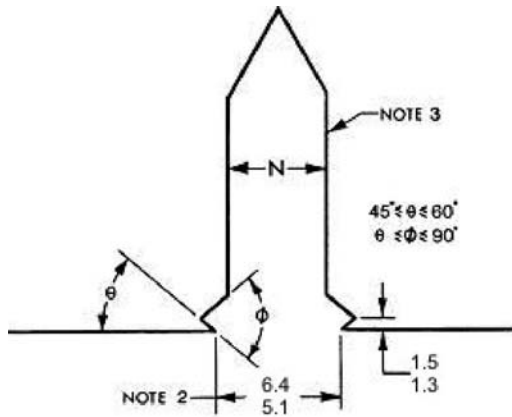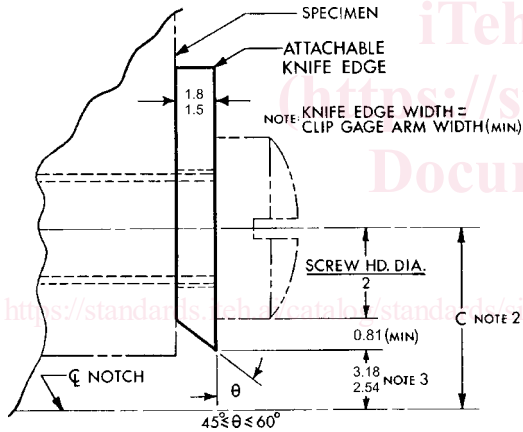
NOTE 1—Dimensions in mm.

NOTE 2— Gage length shown corresponds to clip gage spacer block dimensions shown in Annex A1, but other gage lengths may be used provided they are appropriate to the specimen (see 6.4.3).

NOTE 3—For starter notch configurations see Fig. 5.

Inch-Pound Units Equivalents

mm	1.3	1.5	5.08	6.35
in.	0.050	0.060	0.200	0.250

FIG. 3 Example of Integral Knife Edge Design

NOTE 1—Dimensions are in mm.

NOTE 2—Effective gage length = 2C + Screw Thread Diameter ≤ W/2. (This will always be greater than the gage length specified in A1.1.)

NOTE 3—Dimension shown corresponds to clip gage spacer block dimension in Annex A1.

Inch-Pound Units Equvalients

mm	0.81	1.5	1.8	2.54	3.18
in.	0.032	0.060	0.070	0.100	0.125

FIG. 4 Example of Attachable Knife Edge Design

absolute values (see 9.1). Verification of gage calibration shall be performed at the temperature of test ±5.6°C (10°F). The gage shall be verified during the time the gage is in use at time intervals defined by established quality assurance practices. Commercial gages are typically verified annually.

6.4.3 It is not the intent of this test method to exclude the use of other types of gages or gage-fixing devices provided the gage used meets the requirements listed above and provided the gage length does not exceed those limits given in the Annex appropriate to the specimen being tested.

7. Specimen Size, Configurations, and Preparation

7.1 *Specimen Size*:

7.1.1 In order for a result to be considered valid according to this test method (see also 3.1.2.1), the specimen ligament size $(W – a)$ must be not less than $2.5(K_{Ic}/\sigma_{YS})^2$, where σ_{YS} is the 0.2 % offset yield strength of the material in the environment and orientation, and at the temperature and loading rate of the test (**1, 4, 5**). Meeting this requirement cannot be assured in advance. Thus, specimen dimensions shall be conservatively selected for the first test in a series. If the form of the material available is such that it is not possible to obtain a test specimen with ligament size equal to or greater than $2.5(K_{Ic}/\sigma_{YS})^2$, then it is not possible to make a valid K_{Ic} measurement according to this test method.

7.1.2 The initial selection of specimen size for a valid K_{Ic} measurement is often based on an estimated value of K_{Ic} for the material.

7.1.3 Alternatively, the ratio of yield strength to elastic modulus may be used for selecting a specimen size that will be adequate for all but the toughest materials:

σ_{YS}/E	Minimum Recommended Ligament Size	
	mm	in.
0.0050 to 0.0057	76	3
0.0057 to 0.0062	64	2½
0.0062 to 0.0065	51	2
0.0065 to 0.0068	44	1¾
0.0068 to 0.0071	38	1½
0.0071 to 0.0075	32	1¼
0.0075 to 0.0080	25	1
0.0080 to 0.0085	19	¾
0.0085 to 0.0100	13	½
0.0100 or greater	6.4	¼

When it has been established that $2.5(K_{Ic}/\sigma_{YS})^2$ is substantially less than the minimum recommended ligament size given in the preceding table, then a correspondingly smaller specimen can be used.

7.2 *Specimen Configurations*—Recommended specimen configurations are shown in Figs. A3.1-A6.1 and Fig. A7.1.

7.2.1 *Recommended Specimen Proportions*—Thickness, *B* is nominally one-half the specimen width, *W* . Crack size, *a* , is nominally between 0.45 and 0.55 times the width, *W* , and nominally equal to the thickness, *B*.

7.2.2 *Alternative Specimens*—In certain cases it may be necessary or desirable to use specimens having *W/B* ratios other than that specified in 7.2.1.

7.2.2.1 *Alternative W/B Ratios*—Allowable alternative *W/B* ratios for bend specimen configurations are 1.0 ≤ *W/B* ≤ 4.0 and those for tension specimen configurations are 2.0 ≤ *W/B* ≤ 4.0. These alternative specimens shall nevertheless have the same crack size-to-specimen width ratio as the recommended specimens.

NOTE 2—Alternative *W/B* ratios are useful, especially for quality control or lot releases purposes, because they allow a continuous range of product thicknesses to be tested using a discrete number of specimen widths while still maintaining specimens of full product thickness. However, because specimen width influences the amount of crack extension corresponding to the 95 % slope, K_{Ic} obtained with alternative *W/B* ratios may not agree with those obtained using the recommended *W/B* ratio, particularly in products exhibiting a Type I force-CMOD record (**6**). As an example, for a given specimen thickness (B), a specimen with the
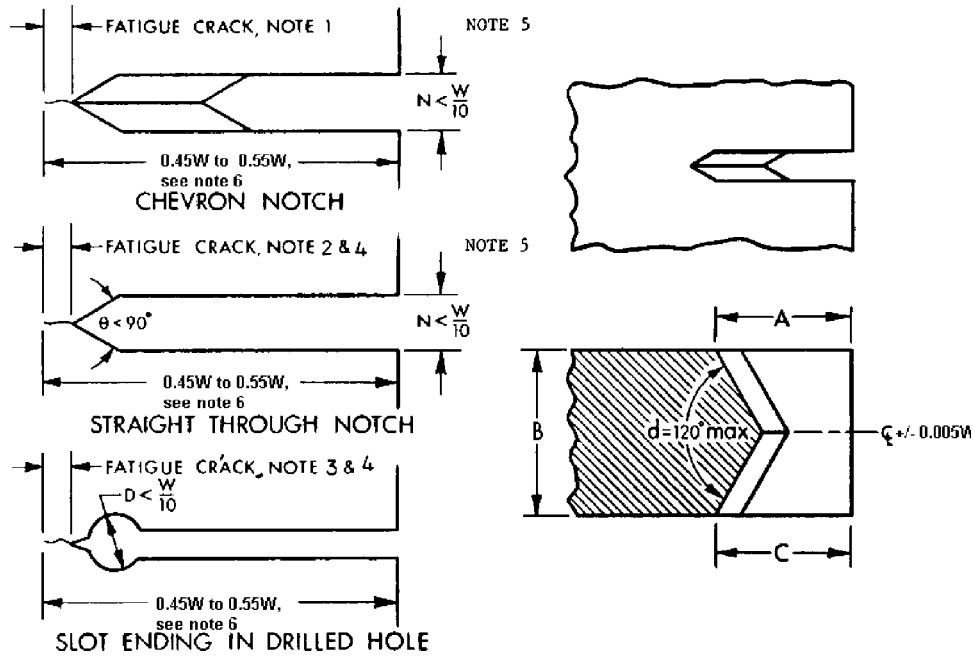
(a) Starter Notches and Fatigue Cracks

(b) Detail of Chevron Notch

Note 1—For a chevron crack starter notch the fatigue crack shall emerge on both surfaces of the specimen.

Note 2—Fatigue crack extension on each surface of the specimen containing a straight-through notch shall be at least 0.025 W or 1.3 mm (0.050 in.), whichever is larger.

Note 3—Fatigue crack extension on each surface of the specimen from the stress raiser tipping the hole shall be at least 0.5 D or 1.3 mm (0.050 in.), whichever is larger.

Note 4—Crack starter notch shall be perpendicular to the specimen surfaces and to the intended direction of crack propagation within ±2°.

Note 5—Notch width N need not be less than 1.6 mm (1/16 in.).

Note 6—From notched edge or centerline of loading holes, as appropriate.

Note 1—A = C within 0.010 W.

Note 2—Cutter tip angle 90° max.

Note 3—Radius at chevron notch bottom 0.25 mm (0.010 in.) max.

FIG. 5 Crack Starter Notch and Fatigue Crack Configurations

recommended proportion W/B =2 would tend to yield a lower K_{Ic} than a specimen with an alternative proportion W/B = 4. Also, because a shorter ligament length may hinder resistance curve development, an alternative specimen with a lesser W/B ratio than the recommended proportion (allowed only for bend specimens) may pass the P_{max}/P_Q requirement, while a specimen with the recommended W/B ratio would fail. Conversely, an alternative specimen with a greater W/B ratio than the recommended proportion (allowed in both tension and bend specimens) may fail the P_{max}/P_Q requirement, while a specimen with the recommended W/B would pass.

7.3 *Specimen Preparation*—All specimens shall be tested in the finally heat-treated, mechanically-worked, and environmentally-conditioned state. Specimens shall normally be machined in this final state. However, for material that cannot be machined in the final condition, the final treatment may be carried out after machining provided that the required dimensions and tolerances on specimen size, shape, and overall finish are met (see specimen drawings of Figs. A3.1-A6.1 and Fig. A7.1), and that full account is taken of the effects of specimen size on metallurgical condition induced by certain heat treatment procedures; for example, water quenching of steels.

7.3.1 *Fatigue Crack Starter Notch*—Three fatigue crack starter notch configurations are shown in Fig. 5. To facilitate fatigue precracking at low stress intensity levels, the suggested root radius for a straight-through slot terminating in a V-notch is 0.08 mm (0.003 in.) or less. For the chevron form of notch, the suggested root radius is 0.25 mm (0.010 in.) or less. For the slot ending in a drilled hole, it is necessary to provide a sharp stress raiser at the end of the hole. Care shall be taken to ensure that this stress raiser is so located that the crack plane orientation requirements of 8.2.4 can be met.

7.3.2 *Fatigue Precracking*—Fatigue precracking procedures are described in Annex A8. Fatigue cycling is continued until a crack is produced that satisfies the requirements of 7.3.2.1 and 7.3.2.2 that follow.

7.3.2.1 Crack size (total size of crack starter plus fatigue crack) shall be between 0.45W and 0.55W.

7.3.2.2 The size of the fatigue crack on each face of the specimen shall not be less than the larger of 0.025W or 1.3 mm (0.050 in.) for the straight-through crack starter configuration, not less than the larger of 0.5D or 1.3 mm (0.050 in.) for the

slot ending in a hole (of diameter $D < W/10$), and need only emerge from the chevron starter configuration.

8. General Procedure

8.1 *Number of Tests*—It is recommended that triplicate tests, minimum, be made for each material condition.

8.2 *Specimen Measurement*—Specimen dimensions shall conform to the drawings of Figs. A3.1-A6.1 and Fig. A7.1. Measurements essential to the calculation of K_{Ic} are specimen thickness, B, crack size, a, and width, W.

8.2.1 Specimen thickness, B, shall be measured before testing to the nearest 0.03 mm (0.001 in.) or to 0.1 %, whichever is larger, at not less than three equally spaced positions along the anticipated crack extension path. The average of these three or more measurements shall be taken as the thickness, B.

8.2.2 Specimen width, W, shall be measured, in conformance with the procedure of the annex appropriate to the specimen configuration, to the nearest 0.03 mm (0.001 in.) or 0.1 %, whichever is larger, at not less than three positions near the notch location, and the average value recorded.

8.2.3 Specimen crack size, a, shall be measured after fracture to the nearest 0.5 % at mid-thickness and the two quarter-thickness points. The average of these three measurements shall be taken as the crack size, a. The difference between any two of the three crack size measurements shall not exceed 10 % of the average. The crack size shall be measured also at each surface. For the straight-through notch starter configuration, no part of the crack front shall be closer to the machined starter notch than $0.025W$ or 1.3 mm (0.050 in.), whichever is larger; furthermore, neither surface crack size measurement shall differ from the average crack size by more than 15 % and their difference shall not exceed 10 % of the average crack size. For the chevron notch starter configuration, the fatigue crack shall emerge from the chevron on both surfaces; furthermore, neither surface crack size measurement shall differ from the average crack size by more than 15 %, and their difference shall not exceed 10 % of the average crack size.

8.2.4 The plane of the fatigue precrack and subsequent 2 % crack extension (in the central flat fracture area; that is, excluding surface shear lips) shall be parallel to the plane of the starter notch to ±10° and there shall be no evidence of multiple cracking (that is, more than one crack) (7).

8.3 *Loading Rate*—For conventional (quasi-static) tests, the specimen shall be loaded such that the rate of increase of stress-intensity factor is between 0.55 and 2.75 MPa√m/s (30 and 150 ksi√in./min) during the initial elastic displacement. Loading rates corresponding to these stress-intensity factor rates are given in the Annex appropriate to the specimen being tested. For rapid-force tests, loading rates are to be as specified in Annex A10.

8.4 *Test Record*—A record shall be made of the output of the force-sensing transducer versus the output of the displacement gage. The data acquisition system shall be set such that not less than 50 % of full range is used for the test record. If an autographic recorder is used, it shall be adjusted such that the slope of the initial portion of the force-CMOD record is between 0.7 and 1.5. Alternatively, if a computer data acqui-

sition system is used, it shall be programmed to capture enough data to permit the calculations of Section 9.

8.4.1 The test shall be continued until the specimen can sustain no further increase in applied force. The maximum force (P_{max}) shall be noted and recorded.

9. Calculation and Interpretation of Results

9.1 *Interpretation of Test Record and Calculation of K_{Ic}*—In order to substantiate the validity of a K_{Ic} determination, it is first necessary to calculate a conditional result, K_Q, which involves a construction on the test record, and then to determine whether this result is consistent with the size and yield strength of the specimen according to 7.1. The procedure is as follows:

9.1.1 When an autographic recorder is used, the conditional value P_Q is determined by drawing the secant line OP_5, (see Fig. 6) through the origin (point O) of the test record with slope $(P/V)_5$ equal to $0.95(P/V)_o$, where $(P/V)_o$ is the slope of the tangent OA to the initial linear portion of the record (Note 3). The force P_Q is then defined as follows: if the force at every point on the record which precedes P_5 is lower than P_5 (Fig. 6, Type I), then P_5 is P_Q; if, however, there is a maximum force preceding P_5 which exceeds it (Fig. 6, Types II and III), then this maximum force is P_Q.

NOTE 3—Slight initial nonlinearity of the test record is frequently observed, and is to be ignored. However, it is important to establish the initial slope of the record with high precision. Therefore it is advisable to minimize this nonlinearity by preliminarily loading the specimen to a maximum force corresponding to a stress-intensity factor level not exceeding that used in the final stage of fatigue cracking, then unloading.

NOTE 4—Residual stresses can affect the indicated K_Q and K_{Ic} values. The effect can be especially significant for specimens removed from as-heat treated or otherwise non-stress relieved stock, from weldments, from complex wrought parts, or from parts with intentionally induced residual stresses. The residual stresses are superimposed on the applied stress, resulting in stress intensity different from that based solely on the externally applied forces. Indications of residual stress can be gleaned from distortion during specimen machining, specimen configuration dependence, and irregular fatigue precrack growth (either excessive crack front curvature or out-of-plane growth). The effect of the residual stresses is a shift in the zero-force value of crack mouth opening displacement (CMOD).

9.1.2 When a computer data acquisition system is used, the data reduction program shall determine the same forces (P_Q and P_{max}) as above. The algorithms for doing this are discretionary.

9.1.3 The ratio P_{max}/P_Q, where P_{max} is the maximum force the specimen was able to sustain (see 8.4.1), shall be calculated. If this ratio does not exceed 1.10, proceed to calculate K_Q as described in the Annex appropriate to the specimen configuration. If P_{max}/P_Q does exceed 1.10, then the test is not a valid K_{Ic} test and the user is referred to Test Method E 1820 on elastic-plastic fracture toughness.

9.1.4 The value $2.5(K_Q/\sigma_{YS})^2$, where σ_{YS} is the 0.2 % offset yield strength in tension (see Test Methods E 8), shall be calculated. If this quantity is less than the specimen ligament size, $W–a$ then K_Q is equal to K_{Ic}. Otherwise, the test is not a valid K_{Ic} test. Expressions for calculating K_Q are given in the Annexes for each specified specimen configuration.
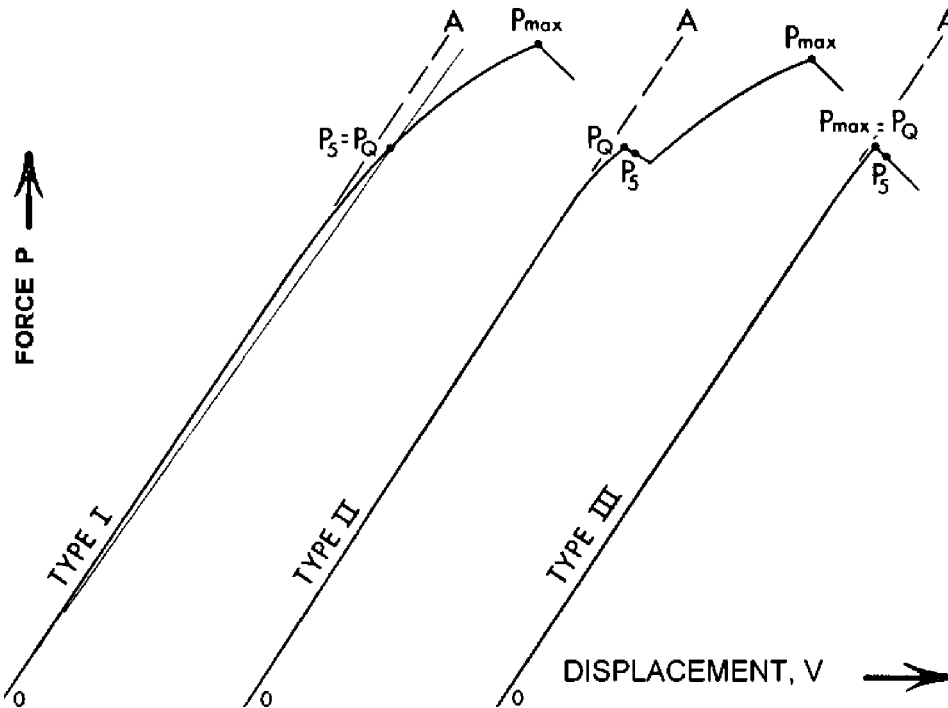
FIG. 6 Principal Types of Force-Displacement (CMOD) Records

9.1.5 If the test result fails to meet the requirements of 9.1.3 or 9.1.4, or both, it will be necessary to use a larger specimen to determine K_{Ic}.

10. Report

10.1 The specimen configuration code shown on the specimen drawing (in the appropriate Annex) shall be reported. This code shall be followed with the loading code (T for tension, B for bending) and the code for crack plane orientation (see 3.1.3). The latter two codes shall appear in separate parentheses. As an example, a test result obtained using the compact specimen (see Annex A4) might be designated as follows: C(T)(S-T). The first letter (C) indicates the specimen to be a compact configuration. The second letter (T) denotes the loading as tension. The first of the two letters in the last bracket (S) indicates the normal to the crack plane to be normal to the direction of principal deformation. The second of these letters (T) indicates the intended direction of crack extension to be parallel with the direction of least deformation.

10.2 The following information shall be additionally reported for each specimen tested:

10.2.1 Characterization of the material (alloy code or chemistry and metallurgical condition) and product form (sheet, plate, bar, forging, casting, and so forth) tested.

10.2.2 Specimen thickness, B.

10.2.3 Specimen width (depth), W.

10.2.3.1 Loading hole offset, X, for the arc-shaped tension specimen.

10.2.3.2 Outer and inner radii, r_2 and r_1, for arc-shaped specimens.

10.2.4 Fatigue precracking conditions, specifically the maximum stress-intensity factor, K_{max}, stress-intensity factor

TABLE 1 Estimates of Precision for K_{Ic} Measurements for Three Specimen Configurations

	2219-T851 σ_{YS} = 352 MPa (51 ksi)	4340 σ_{YS} = 1641 MPa (238 ksi)	18Ni Marage σ_{YS} = 1903 MPa (276 ksi)	4340 σ_{YS} = 1420 MPa (206 ksi)
	Bend SE(B) Specimens			
Grand Mean, $\bar{X}^{A,B}$	35.9 (32.7)	48.2 (43.9)	56.9 (51.8)	86.7 (78.9)
Standard Deviation, $S^{A,B}$	2.05 (1.87)	2.08 (1.89)	2.24 (2.04)	3.67 (3.34)
	Compact C(T) Specimens			
Grand Mean, $\bar{X}^{A,B}$	35.6 (32.4)	50.0 (45.5)	58.2 (53.0)	87.3 (79.4)
Standard Deviation, $S^{A,B}$	1.24 (1.13)	1.40 (1.27)	1.80 (1.64)	1.96 (1.78)
	Arc-Shaped Tension Specimens 4335V σ_{ys} = 1324 MPa (192 ksi)			
	X/W = 0		X/W = 0.5	
Grand Mean, $\bar{X}^{A,B}$	112.4 (102.3)		111.8 (101.7)	
Standard Deviation, $S^{A,B}$	3.85 (3.50)		2.59 (2.36)	

[A] Units of grand mean and standard deviation are MPa$\sqrt{m}$ (ksi$\sqrt{in}$.).
[B] The standard deviation has been pooled for all laboratories testing a given alloy. For data on which this table was based, see Refs (7, 8) for the Standard SE(B) Bend Specimen, Ref (8) for the Compact C(T) Specimen, and Ref (9) for the Arc-Shaped Tension A(T) Specimen.

range, ΔK_I, and number of cycles for the final 2.5 % of the overall crack size, a (size of notch plus fatigue crack extension).

10.2.5 Crack size measurements, after fracture, at midthickness and the two quarter-thickness positions on the crack front, as well as at the intersection of the crack front with the specimen surface.

10.2.6 Test temperature.

10.2.7 Relative humidity as determined by Test Method E 337.

10.2.8 Loading rate in terms of $\dot{K}_I$ (change in stress-intensity factor per unit time) (3).
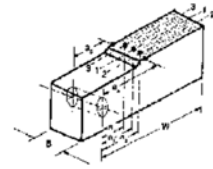
9

Figure 7. K_{Ic} Data Sheet (Example)

Material/Form _____ Heat Treat _____
Specimen I.D. _____ Specimen Type _____

Date ___/___/___

PARTICULARS	DATA	REF. PARAGRAPH	FRACTURE TEST	DATA	REF. PARAGRAPH
Crack Plane Orientation		3.1.3	Crack Size		
Material Yield Strength, MPa (ksi)		7.1.1, A10.2.1, A10.7.3	- At Center of Crack Front (a_1) mm (in.)		8.2.3
Specimen Thickness, mm (in.)		8.2.1	- At Right of Center (a_2) mm (in.)		8.2.3
Specimen Width, mm (in.)		8.2.2	- At Left of Center (a_3) mm (in.)		8.2.3
---for SE (B)		A3.4.1	- At Right Surface (a_4) mm (in.)		8.2.3
---for C (T)		A4.4.1	- At Left Surface (a_5) mm (in.)		8.2.3
---for DC (T)		A5.4.1.2	Crack Plane Symmetry		8.2.4
Arc-Shaped Tension A (T) Specimen:			Loading Rate MPa√m/s (ksi√in./min)		8.3
---Width, W, mm (in.)		A6.4.1	Test Temperature °C (°F)		10.2.6
---Loading Plate Offset, X, mm (in.)		A6.4.1	Relatively Humidity, %		10.2.7
---Outer and Inner Radii r_1 and r_2, mm (in.)		A6.4.1	Force- CMOD Record		8.4, 9.1
Arc-Shaped Bend A (B) Specimen:					
---Width, W, mm (in)		A7.4.1			
---Loading Plate Offset, X, mm (in.)		A7.4.1			
---Outer and Inner Radii r_1 and r_2, mm (in.)		A7.4.1			
FATIGUE PRECRACKING	DATA	REF. PARAGRAPH	K CALCULATION	DATA	REF. PARAGRAPH
---$K_{max}/E < 0.00032$ √m (0.002√in.)		A8.3.3	$P_{max}/P_Q < 1.1$		9.1.3
---$K_{max} < 0.6$ K_Q MPa √m (ksi√in.)		A8.3.3	--- $2.5(K_{Ic}/\sigma_{ys})^2$, MPa √m (ksi√in.)		7.1, 9.1.4
---$K_{max} < 0.8$ K_{Ic} MPa √m (ksi√in.)		A8.3.3	---K_Q SE(B) MPa √m (ksi√in.)		A3.5.3
-for Test at Temperature T_2:			---K_Q C(T) MPa √m (ksi√in.)		A4.5.3
-K_{MAX} $T_1 < 0.6(\sigma_{ysT1}/\sigma_{ysT2})K_Q$ (T_2) MPa √m (ksi√in)		A8.4.4	---K_Q DC(T) MPa √m (ksi√in.)		A5.5.3
Crack Size – Starter Slot Plus Fatigue Precrack:			---K_Q A(T) MPa √m (ksi√in.)		A6.5.3
---a = 0.50W mm (in.)		7.3.2.1, A8.3.2	---K_Q A(B) MPa √m (ksi√in.)		A7.5.3
---K_{MAX}, ΔK MPa √m (ksi√in.)		A8.1.3			
			Invalid according to E 399 Section(s):		10.2.11
			Valid KIc MPa √m (ksi√in.):		10.2.11

FIG. 7 Suggested Form of Table for Reporting Information Listed in 10.1 and 10.2

10.2.9 Force-versus-crack mouth opening displacement (CMOD) record and associated calculations.

10.2.10 Yield strength as determined by Test Methods E 8.

10.2.11 K_{Ic} (or, K_Q followed by the parenthetical statement "invalid according to Sections(s) _____ of Test Method E 399").

10.2.12 P_{max}/P_Q.

10.3 Fig. 7 is a convenient format for tabulating the information required in 10.1 and 10.2.

11. Precision and Bias

11.1 The precision of K_{Ic} measurements has been examined in several interlaboratory round-robin studies. Selected high-strength alloys were tested using standard bend SE(B) (8, 9), compact C(T) (9), and arc-shaped tension A(T) (10) specimen configurations. The results are summarized in 11.2 (Precision) and 11.3 (Bias) that follow. Not all of the results reported satisfied all of the validity requirements of this test method. Statistical analysis (10, 11) was used to exclude data that were likely influenced by deviations from the validity requirements. No round-robin program has been conducted for the disk-shaped compact DC(T) specimen configuration, but limited data for that specimen configuration are compared with data for other specimen configurations in Annex A5. Round-robin studies specific to the quasi-static testing of beryllium and the

dynamic testing of a strain-rate sensitive steel, and which involved special testing procedures, are presented in Annex A9 and Annex A10.

11.2 *Precision*—The precision of K_{Ic} determination is affected by errors in the measurement of test force and specimen dimensions, especially the crack size. This test method specifies a precision for each measured quantity and, based on these specifications and the round-robin results, a theoretical precision is rendered (12). Analysis of the method's specifications suggests that precision decreases with increasing relative crack size, more for the bend than for the compact configuration. In practice, the precision of K_{Ic} measurement may depend to an unknown extent on the characteristics of the test record and analysis skills of the laboratory personnel. It is possible to derive useful information concerning the precision of K_{Ic} measurement from the round-robin programs. The results for the bend, compact, and arc-shaped specimen configurations are given in Table 1 for tests on several high strength alloys. The alloys were chosen for their reproducible, uniform composition and microstructure. Thereby the contribution of material variability to the measurement of K_{Ic} was minimized. It should be emphasized that the measures of precision in Table 1 apply to alloys that essentially exhibit no transitional fracture behavior with temperature or strain rate.

11.3 *Bias*—There is no accepted standard value for the plane-strain fracture toughness of any material. In the absence of such a true value, any statement concerning bias is not meaningful.

ANNEXES

(Mandatory Information)

A1. DOUBLE-CANTILEVER DISPLACEMENT GAGE

A1.1 The displacement gage consists of two cantilever beams and a spacer block clamped together with a single bolt and nut (Fig. 2). Electrical-resistance strain gages are adhesively bonded to the tension and compression surfaces of each beam, and are connected as a Wheatstone bridge incorporating a suitable balancing resistor. The beams are made of material with a high ratio of yield strength-to-elastic modulus. One such material is solution treated Ti-13V-11Cr-3Al titanium alloy. For material of different modulus, the spring constant of the assembly is correspondingly different, but other characteristics are unaffected. Detailed dimensions for the beams and spacer block are given in Figs. A1.1 and A1.2. Those particular values provide a linear (working) range from 3.8 to 7.6 mm (0.15 to 0.30 in.) and a gage length of 5.1 to 6.4 mm (0.20 to 0.25 in.). The gage length can be adjusted by substituting a differently sized spacer block. The gage's required precision is stated as a maximum deviation of ±0.003 mm (0.0001 in.) from a least-squares-best-fit straight line through its displacement calibration data (see 6.4.2). Additional details concerning design, construction and use of the gage are given in (13).