
Textiles — Tests for colour fastness —
Part B02:
Colour fastness to artificial light:
Xenon arc fading lamp test

Textiles — Essais de solidité des coloris —

*Partie B02: Solidité des coloris à la lumière artificielle: Lampe à arc
au xénon*

Sample Document

get full document from standards.iteh.ai



Reference number
ISO 105-B02:2014(E)

© ISO 2014

Sample Document

get full document from standards.iteh.ai



COPYRIGHT PROTECTED DOCUMENT

© ISO 2014

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Case postale 56 • CH-1211 Geneva 20
Tel. + 41 22 749 01 11
Fax + 41 22 749 09 47
E-mail copyright@iso.org
Web www.iso.org

Published in Switzerland

Contents

Page

Foreword	iv
1 Scope	1
2 Normative references	1
3 Principle	1
4 Terms and definitions	2
5 Materials and apparatus	3
5.1 Reference materials.....	3
5.2 Laboratory exposure devices.....	4
6 Preparation of test specimens	5
7 Exposure conditions	6
8 Procedure	7
8.1 Apparatus set-up.....	7
8.2 Adjustment of the effective humidity (see Clause 7 and Annex E).....	7
8.3 Exposure methods.....	9
9 Assessment of colour fastness	16
10 Test report	17
Annex A (normative) Requirements for xenon arc exposure devices	20
Annex B (normative) Procedures for measuring the irradiance uniformity in the specimen exposure area (for apparatus manufacturers only)	23
Annex C (informative) Light exposure equivalents for blue wool lightfastness references L2 to L9	25
Annex D (informative) General information on colour fastness to light	26
Annex E (informative) Guidelines for conducting testing	28
Bibliography	36

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

The procedures used to develop this document and those intended for its further maintenance are described in the ISO/IEC Directives, Part 1. In particular the different approval criteria needed for the different types of ISO documents should be noted. This document was drafted in accordance with the editorial rules of the ISO/IEC Directives, Part 2 (see www.iso.org/directives).

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights. Details of any patent rights identified during the development of the document will be in the Introduction and/or on the ISO list of patent declarations received (see www.iso.org/patents).

Any trade name used in this document is information given for the convenience of users and does not constitute an endorsement.

For an explanation on the meaning of ISO specific terms and expressions related to conformity assessment, as well as information about ISO's adherence to the WTO principles in the Technical Barriers to Trade (TBT) see the following URL: Foreword - Supplementary information.

The committee responsible for this document is ISO/TC 38, *Textiles*, Subcommittee SC 1, *Tests for coloured textiles and colorants*.

This sixth edition cancels and replaces the fifth edition (ISO 105-B02:2013), of which it constitutes a minor revision.

ISO 105 consists of many parts designated by a part letter and a two-digit serial number (e.g. A01), under the general title *Textiles — Tests for colour fastness*. A complete list of these parts is given in ISO 105-A01.

Textiles — Tests for colour fastness —

Part B02:

Colour fastness to artificial light: Xenon arc fading lamp test

1 Scope

This part of ISO 105 specifies a method intended for determining the effect on the colour of textiles of all kinds and in all forms to the action of an artificial light source representative of natural daylight (D65). The method is also applicable to white (bleached or optically brightened) textiles.

This method allows the use of two different sets of blue wool references. The results from the two different sets of references may not be identical.

2 Normative references

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 105-A01, *Textiles — Tests for colour fastness — Part A01: General principles of testing*

ISO 105-A02, *Textiles — Tests for colour fastness — Part A02: Grey scale for assessing change in colour*

ISO 105-A05, *Textiles — Tests for colour fastness — Part A05: Instrumental assessment of change in colour for determination of grey scale rating*

ISO 105-B01:2014, *Textiles — Tests for colour fastness — Part B01: Colour fastness to light: Daylight*

ISO 105-B05, *Textiles — Tests for colour fastness — Part B05: Detection and assessment of photochromism*

ISO 105-B08, *Textiles — Tests for colour fastness — Part B08: Quality control of blue wool reference materials 1 to 7*

ISO 3696, *Water for analytical laboratory use — Specification and test methods*

ISO 9370, *Plastics — Instrumental determination of radiant exposure in weathering tests — General guidance and basic test method*

CIE¹⁾ Publication No. 51, *Method for assessing the quality of daylight simulators for colorimetry*

3 Principle

A specimen of the textile to be tested is exposed to artificial light under controlled conditions, together with a set of reference materials. The colour fastness is assessed by comparing the change in colour of the test specimen with that of the reference materials used.

NOTE General information on colour fastness to light is given in [Annex D](#).

1) Commission Internationale de l'Éclairage, CIE Central Bureau, Kegelgasse 27, A-1030, Vienna, Austria www.cie.co.at.

4 Terms and definitions

For the purposes of this document, the following terms and definitions apply.

- 4.1**
test specimen
portions of the textile to be tested and which are representative parts of the item to be tested
Note 1 to entry: This is used for comparison between the exposed and the original (untested) state.
- 4.2**
reference specimen
portion of a reference material that is to be exposed simultaneously with the test specimen
Note 1 to entry: Multiple reference specimens may be required to determine the test results.
- 4.3**
blue wool reference material
one of a series of blue dyed wool textile materials with a known reaction to light
- 4.4**
test chamber
area within the apparatus capable of meeting and maintaining the requirements for temperature, light and humidity
- 4.5**
chamber relative humidity
ratio of the actual water vapour pressure in the test chamber to the saturation water vapour pressure of water at the same temperature, expressed as a percentage
- 4.6**
effective humidity
combination of air and surface temperatures and air relative humidity which governs the moisture content at the surface of the test specimen during exposure
- 4.7**
humidity-test control fabric
a red azoic dyed cotton fabric of known sensitivity to humidity and light
Note 1 to entry: This red azoic dyed fabric is used as a reference material to ensure that the effective humidity requirements are met.
- 4.8**
photochromism
change in colour of a substrate after brief exposure to light, which is substantially returned to its original shade after storage in the dark
- 4.9**
flip-flop mode
mode of operation whereby the specimen holders revolve around the central light source and on alternate rotations the specimen holders are automatically rotated 180° about their vertical axis so that the test specimens face towards the light source only every alternate revolution

5 Materials and apparatus

5.1 Reference materials

5.1.1 General

Either of two sets of blue wool reference may be used. The colour fastness ratings mentioned in this part of ISO 105 are obtained by comparison with either blue wool references 1 to 8 (*preferred* in Europe) or blue wool references L2 to L9 (*preferred* in America). The results from the two sets of references are not interchangeable. Information on the relationship between the two sets of blue wool reference materials can be found in ISO 105-B01:2014, 4.1.

5.1.2 Blue wool reference materials 1 to 8

Blue wool references developed and produced in Europe are identified by the numerical designation 1 to 8. These references are blue wool materials dyed with the dyes listed in [Table 1](#). They range from 1 (very low colour fastness to light) to 8 (very high colour fastness to light) so that each higher-numbered reference is approximately twice as fast as the preceding one.

The blue wool references 1 to 8 used in this test shall meet the quality requirements specified in ISO 105-B08.

Table 1 — Dyes for blue wool references 1 to 8

Reference	Dye (Colour Index designation) ^a
1	CI Acid Blue 104
2	CI Acid Blue 109
3	CI Acid Blue 83
4	CI Acid Blue 121
5	CI Acid Blue 47
6	CI Acid Blue 23
7	CI Solubilised Vat Blue 5
8	CI Solubilised Vat Blue 8

^a The Colour Index (fourth edition) is published by the Society of Dyers and Colourists, P.O. Box 244, Perkin House, 82 Grattan Road, Bradford BD1 2JB, West Yorkshire, UK, and by the American Association of Textile Chemists and Colorists, P.O. Box 12215, Research Triangle Park, NC 27709-2215, USA.

5.1.3 Blue wool reference materials L2 to L9

Blue wool references developed and produced in America are identified by the letter L followed by the numerical designation 2 to 9. These eight references are prepared by blending varying proportions of wool dyed with CI Mordant Blue 1 (Colour Index, fourth edition, CI Constitution Number 43830) and wool dyed with CI Solubilised Vat Blue 8 (Colour Index, fourth edition, CI Constitution Number 73801), so that each higher-numbered reference is approximately twice as fast as the preceding reference.

Data in [Annex C](#) are presented to illustrate the relationship of each of the blue wool references on exposure to fixed amounts of radiant energy.

5.1.4 Humidity-test control

The effective humidity can **only** be measured by determining the colour fastness to light of a specific humidity-test control fabric (see [4.7](#)).

5.2 Laboratory exposure devices

5.2.1 Light source

5.2.1.1 The exposure device shall provide for placement of specimens and any designated sensing devices in positions that allow uniform irradiance from the light source

The spectral irradiance produced in an artificial accelerated light and weathering device is very important. Ideally, the relative spectral irradiance produced by the device should be a very close match to that of solar radiation, especially in the short wavelength UV region. [Annex A](#) provides information about important benchmark solar spectra that can be used for comparing the spectral irradiance produced in the artificial accelerated exposure to that for solar radiation.

5.2.1.2 Exposure devices shall be designed such that the variation in irradiance at any location in the area used for specimen exposure shall not exceed $\pm 10\%$ of the mean. Procedures for measuring irradiance uniformity are found in [Annex B](#).

NOTE The irradiance uniformity in exposure devices depends on several factors. The configuration of the lamp with respect to the specimens on exposure, including the differences in distance between the lamp(s) and the samples can affect uniformity of exposure. Deposits which can develop on the optical system and chamber walls, and the type and number of specimens being exposed, can also have an affect on uniformity of exposure.

5.2.1.3 Periodic repositioning of the test specimens in the test chamber is recommended to ensure the most consistent results.

5.2.1.4 Follow the apparatus manufacturer's instructions for lamp and filter replacement.

5.2.1.4.1 Direct radiation from xenon burners contains considerable amounts of short-wavelength ultraviolet radiation not present in daylight. Optical filters shall be fitted to minimize short-wavelength light (less than 310 nm) in accordance with the requirements in [Annex A](#). The xenon arc, when appropriately filtered, produces radiation with a spectral power distribution that is a good simulation of average daylight throughout the UV and visible region.

5.2.1.4.2 Infrared radiation levels can be attenuated by use of filters to allow some control of the sample temperature.

5.2.1.5 It is preferred that the apparatus should be fitted with an irradiance sensing system. The irradiance sensor (if fitted) shall be mounted so that it receives the same radiation as the specimen surface. If it is not positioned in the specimen plane, it shall be calibrated for irradiance at the specimen distance.

5.2.1.5.1 The irradiance sensor (if fitted) shall be capable of measuring irradiance preferably in a specific wavelength range (e.g. 300 nm to 400 nm), or in a narrow bandpass centred around a single wavelength (e.g. 420 nm) and shall be calibrated at the wavelength range or single wavelength, as appropriate. The measured wavelength or wavelength range shall be reported.

5.2.1.5.2 Where irradiance control is available, the irradiance shall be controlled at $(42 \pm 2) \text{ W/m}^2$ in the wavelength range 300 nm to 400 nm or $(1,10 \pm 0,02) \text{ W/(m}^2\cdot\text{nm)}$ at the wavelength 420 nm.

5.2.1.5.3 The irradiance sensor (if fitted) shall be calibrated in the emission region of the light source used. Calibration shall be checked in accordance with the radiation-measuring and instrument manufacturer's instructions with compliance to ISO 9370.

5.2.1.6 The light source shall consist of a xenon arc lamp of correlated colour temperature 5500 K to 6500 K, the size of which will depend on the type of apparatus used.

5.2.1.7 The apparatus shall be fitted with a light filter placed between the light source and the specimens so that the ultraviolet spectrum is steadily reduced. [Annex A](#) provides the transmission requirements for the filter system used.

5.2.1.8 The apparatus shall be fitted with a heat filter placed between the light source and the specimens so that the amount of infrared (IR) radiation contained in the xenon arc spectrum is steadily reduced.

5.2.2 Temperature (see [A.3](#))

One of two types of black-coated temperature sensor shall be used, either a *black-standard thermometer* or a *black-panel thermometer* (for more detail see [A.3](#).) and the thermometer shall be mounted in the same plane and orientation as the test specimen(s).

Note The preferred thermometer is the Black Standard Thermometer (BST).

5.2.3 Humidity

The presence of moisture can have a significant effect in accelerated laboratory exposure tests. The apparatus shall have the means for providing and controlling moisture to specimens by humidification of the chamber air. The quality of the water used to create the effective humidity shall be a minimum of Grade 3 in accordance with ISO 3696.

5.2.4 Covers

Covers shall be made from thin opaque material, for example high-grade steel, thin sheet aluminium or cardboard covered with aluminium foil, for partial covering of samples and references. The opaque material shall neither react with the test specimens nor the test conditions and shall not itself produce any change in colour of either the test specimen or the reference materials.

5.2.5 Colour matching lamps, in accordance with CIE Publication No. 51.

5.2.6 Assessment cabinet, complying with ISO 105-A01.

5.2.7 Sample mounting card, free of optical or fluorescent brightening agent.

5.2.8 Assessment mask, complying with ISO 105-A01. In order to obtain reliable test results using ISO 105-A02, the test specimen(s) shall be masked with a material that is identical in colour to the sleeve that is used to mask the grey scale ([5.2.9](#)).

5.2.9 Grey scale for assessing change in colour, complying with ISO 105-A02.

6 Preparation of test specimens

6.1 The size of the test specimen will depend on the number of specimens to be tested and on the shape and dimensions of the specimen holders supplied with the apparatus.

Attention is drawn to the guidelines given in [E.4](#).

6.2 The specimen may be a strip of cloth, yarn wound close together on a sample mounting card ([5.2.7](#)) or laid parallel and fastened on a card, or a mat of fibres combed and compressed to give a uniform surface and fastened on a card. Each exposed and unexposed area shall be not less than 10 mm × 8 mm.

6.3 To facilitate handling, the test specimen(s) to be tested and similar strips of the references may be mounted on one or more cards as indicated in [Figures 2, 3, 4](#) or [5](#).

6.4 The covers (5.2.4) shall make close contact with the surface of the unexposed areas of the specimens and the references, in order to give a sharp line of demarcation between exposed and unexposed areas, but shall not compress the specimen unnecessarily.

6.5 The specimens to be tested and the blue wool references shall be of equal size and shape in order to avoid errors in assessment due to overrating the visual contrast between exposed and unexposed parts on a larger pattern as against a narrower reference.

6.6 When testing specimens of appreciable thickness, the references shall be arranged so that they are the same distance from the light source as the upper surface of the test specimens. Covers for the unexposed portions shall avoid surface compression.

Textiles of appreciable thickness which have fibres that may shift position or texture which may make evaluation of small areas difficult, shall be tested with an exposed area not less than 50 mm × 40 mm and preferably larger.

7 Exposure conditions

To simulate different environments testing can be carried out under different conditions (see [Table 2](#)). The type of conditions should be agreed between parties. The chosen conditions shall be reported.

Sample Document

get full document from standards.iteh.ai

Table 2 — Exposure conditions

	Exposure Cycle A1	Exposure Cycle A2	Exposure Cycle A3	Exposure Cycle B
Condition:	Normal	Extreme low humid- ity	Extreme high humidity	—
Climatic condition replicated	Temperate zone	Dry	Semi-tropical	—
Blue wool references	Series 1 to 8			Series L2 to L9
Black Standard Tem- perature ^a	(47 ± 3) °C	(62 ± 3) °C	(42 ± 3) °C	(65 ± 3) °C
Black Panel Tempera- ture ^a	(45 ± 3) °C	(60 ± 3) °C	(40 ± 3) °C	(63 ± 3) °C
Effective humidity (see 8.2) ^b	Approximately 40 % effective humid- ity. (Note: This is typically achieved when blue wool reference 5 exhibits a contrast equal to grey scale grade 4)	Less than 15 % effective humid- ity. (Note: This is typically achieved when blue wool reference 6 exhibits a contrast equal to grey scale grade 3-4)	Approximately 85 % effective humid- ity. (Note: This is typically achieved when blue wool reference 3 exhibits a contrast equal to grey scale grade 4)	Low (Colour fastness of humidity-test con- trol: L6 to L7)
Relative humidity	As determined by effective humidity requirement			(30 ± 5) %
Irradiance ^c	Where irradiance control is available, the irradiance shall be controlled at (42 ± 2) W/m ² in the wavelength range 300 nm to 400 nm or (1,10 ± 0,02) W/(m ² ·nm) at the wave- length 420 nm			
^a Air chamber temperature control should not be used as air chamber temperature is a different value from Black Standard Temperature and Black panel temperature.				
^b Effective humidity is based on an assessment of the blue wool references after the humidity-test control fabric has been exposed to give a contrast equal to grey scale grade 4 (8.2.5).				
Once a contrast equal to grey scale grade 4 on the exposed humidity-test control fabric has been achieved, effective humidity is based on assessment.				
^c The broadband (300 to 400 nm) and narrowband (420 nm) irradiance control values are based on traditional settings and should not be implied as equivalent in all models of test equipment. Consult with the instrument manufacturer for the equivalent irradiance in other controlling wavelengths or bandpasses.				

8 Procedure

8.1 Apparatus set-up

8.1.1 Set up the apparatus in accordance with the manufacturer's guidelines.

8.1.2 Fill all unused specimen holders with a non-reflective material such as white card stock. For machines employing flip-flop mode, both faces in the unused specimen holders shall be used.

8.1.3 The black panel thermometer (which has an open back) or black standard thermometer (which has an insulated back) shall be positioned in the same plane and orientation as the test specimens.

8.2 Adjustment of the effective humidity (see Clause 7 and Annex E)

8.2.1 When using test conditions in which the use of effective humidity is specified, do not rely on machine readings of relative humidity in the test chamber. The correct adjustment of the effective humidity (for tests using blue wool references 1 to 8) is **critical** to obtaining valid results. Figure 1 shows the relationship between effective humidity and the light fastness of the humidity-test control fabric.

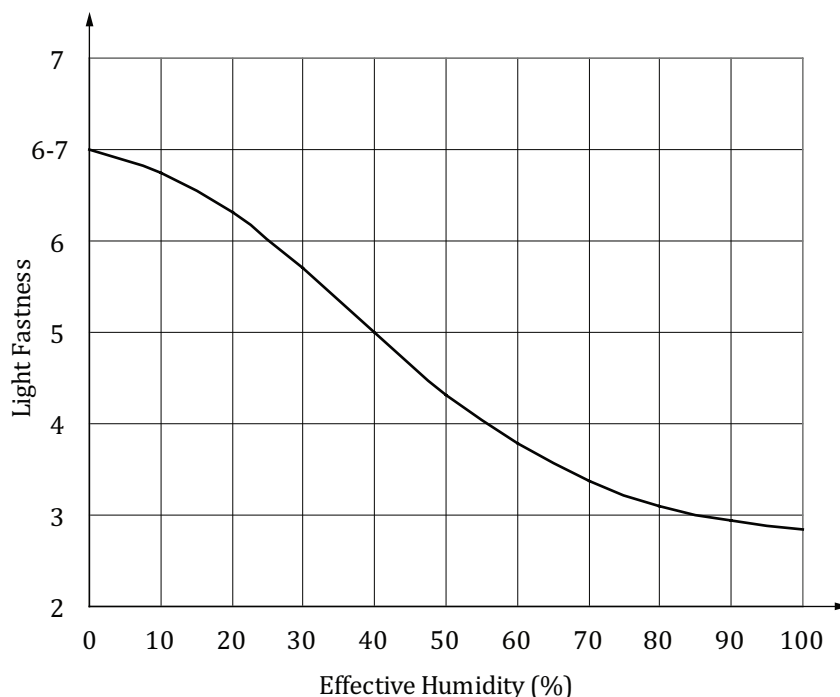


Figure 1 — Mean values obtained from humidity-test control exposures

8.2.2 For the required exposure conditions, determine from [Table 2](#) the required effective humidity then using [Figure 1](#), identify the equivalent light fastness (expressed using blue wool reference series 1 to 8) required to be exhibited by the humidity-test control fabric. (For example, for normal conditions the effective humidity required is 40 % which is equivalent to a light fastness of the humidity-test control fabric of blue wool reference 5).

8.2.3 Place a portion of the humidity-test control fabric ([5.1.4](#)) together with the relevant blue wool references ([5.1.2](#) or [5.1.3](#)) on a card. Each of the reference materials (blue wool references and humidity-test control) shall measure not less than 45 mm × 10 mm.

8.2.4 Mask the card prepared in [8.2.3](#) using an appropriate cover ([5.2.4](#)) such that each exposed and unexposed area is not less than 10 mm × 8 mm. Place the masked card in the test chamber.

8.2.5 Expose the masked card until the contrast between the exposed and unexposed portions of the humidity-test control fabric ([4.7](#)) is equal to grade 4 on the grey scale ([5.2.9](#)).

8.2.6 When the conditions in [8.2.5](#) have been achieved assess the contrast between the exposed and unexposed portions of the relevant blue wool reference as referenced in [Table 2](#). The contrast should be equal to that specified for the appropriate exposure conditions (see [Table 2](#)).

8.2.7 If the necessary contrast in [8.2.5](#) is not achieved, adjust the controls on the apparatus to give the required selected exposure conditions and repeat [8.2.3](#) to [8.2.6](#) using fresh reference materials.