
**Geotechnical investigation and
testing — Geotechnical monitoring by
field instrumentation —**

**Part 2:
Measurement of displacements along
a line: Extensometers**

*Reconnaissance et essais géotechniques — Mesures géotechniques —
Partie 2: Mesure de déplacement le long d'une ligne par extensomètre*

get full document from standards.iteh.ai



Sample Document

get full document from standards.iteh.ai



COPYRIGHT PROTECTED DOCUMENT

© ISO 2016, Published in Switzerland

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Ch. de Blandonnet 8 • CP 401
CH-1214 Vernier, Geneva, Switzerland
Tel. +41 22 749 01 11
Fax +41 22 749 09 47
copyright@iso.org
www.iso.org

Contents

Page

Foreword	iv
1 Scope	1
2 Normative references	1
3 Terms and definitions	1
4 Symbols	3
5 Instruments	4
5.1 General	4
5.2 In-place extensometer	8
5.2.1 Measuring points	8
5.2.2 Connecting elements	8
5.2.3 Measuring head and read-out device	9
5.3 Probe extensometer	10
5.3.1 Measuring points and guide tube	10
5.3.2 Probe	11
5.5 Tape extensometer (convergence tape)	12
5.6 Measuring range and accuracy	12
6 Installation and measuring procedures	13
6.1 Installation	13
6.1.1 Surface components	13
6.1.2 Installation in boreholes and in fill	13
6.1.3 In-place extensometer	14
6.1.4 Probe extensometer	14
6.1.5 Tape extensometer	15
6.2 Carrying out the measurement	15
6.2.1 Instrumentation check and calibration	15
6.2.2 Measurement	15
7 Data processing and evaluation	15
8 Reporting	16
8.1 Installation report	16
8.2 Monitoring report	16
Annex A (normative) Measuring and evaluation procedure	17
Annex B (informative) Backfill materials	26
Annex C (informative) Geo-engineering applications	27
Annex D (informative) Measuring examples	28
Bibliography	46

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

The procedures used to develop this document and those intended for its further maintenance are described in the ISO/IEC Directives, Part 1. In particular the different approval criteria needed for the different types of ISO documents should be noted. This document was drafted in accordance with the editorial rules of the ISO/IEC Directives, Part 2 (see www.iso.org/directives).

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights. Details of any patent rights identified during the development of the document will be in the Introduction and/or on the ISO list of patent declarations received (see www.iso.org/patents).

Any trade name used in this document is information given for the convenience of users and does not constitute an endorsement.

For an explanation on the meaning of ISO specific terms and expressions related to conformity assessment, as well as information about ISO's adherence to the World Trade Organization (WTO) principles in the Technical Barriers to Trade (TBT) see the following URL: www.iso.org/iso/foreword.html.

The committee responsible for this document is ISO/TC 182, *Geotechnics*.

A list of all part in the ISO 18674 series, published under the general title *Geotechnical investigation and testing – Geotechnical monitoring by field instrumentation*, can be found on the ISO website.

Geotechnical investigation and testing — Geotechnical monitoring by field instrumentation —

Part 2: Measurement of displacements along a line: Extensometers

1 Scope

This document specifies the measurement of displacements along a line by means of extensometers carried out for geotechnical monitoring. General rules of performance monitoring of the ground, of structures interacting with the ground, of geotechnical fills and of geotechnical works are presented in ISO 18674-1.

If applied in conjunction with ISO 18674-3, this document allows the determination of displacements acting in any direction.

This document is applicable to:

- monitoring the behaviour of soils, fills and rocks;
- checking geotechnical designs in connection with the Observational Design procedure;
- deriving geotechnical key parameters (e.g. from results of pile load tests or trial tunnelling);
- evaluating stability ahead of, during or after construction (e.g. stability of natural slopes, slope cuts, embankments, excavation walls, foundations, dams, refuse dumps, tunnels).

NOTE This document fulfils the requirements for the performance monitoring of the ground, of structures interacting with the ground and of geotechnical works by the means of extensometers as part of the geotechnical investigation and testing in accordance with References [5] and [6].

2 Normative references

The following documents, in whole or in part, are normatively referenced in this document and are indispensable for its application. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 18674-1:2015, *Geotechnical investigation and testing — Geotechnical monitoring by field instrumentation — Part 1: General rules*

3 Terms and definitions

For the purposes of this document, the terms and definitions given in ISO 18674-1 and the following apply.

3.1

extensometer <geotechnical>

field instrument for monitoring changes of distance between two or more measuring points located along a measuring line

Note 1 to entry: Monitoring of such changes allows the determination of displacements of measuring points acting in the direction of the measuring line.

Note 2 to entry: At a measuring point, the movements of the medium (e.g. soil, rock, concrete and steel structures) being investigated are transferred to the measuring point by devices such as anchors, rings or bolts (see [5.1.6](#)).

Note 3 to entry: In the ground, the measuring points are typically installed in boreholes. The measuring line then coincides with the axis of the borehole.

3.2

in-place extensometer

permanently installed extensometer, essentially consisting of anchor(s), connecting element(s) and at least one measuring head

Note 1 to entry: Each connecting element is affixed to an anchor and free to move along the measuring line.

Note 2 to entry: Measuring heads are commonly located at one end of the measuring line. When carrying out the measurements, they function as reference measuring points.

Note 3 to entry: For in-place extensometers in boreholes, see Reference [\[7\]](#).

Note 4 to entry: See [Figure 1](#).

3.3

rod extensometer

in-place extensometer where the connecting element is a rod

Note 1 to entry: Common rod materials are steel or fibreglass.

Note 2 to entry: See [Figure 1](#) a).

3.4

wire extensometer

in-place extensometer where the connecting element is a wire

Note 1 to entry: See [Figure 1](#) b).

3.5

single extensometer

in-place extensometer with one anchor only

Note 1 to entry: See [Figure 1](#) b).

3.6

multiple-point extensometer

in-place extensometer with more than one anchor

Note 1 to entry: Up to six anchor points are common in geo-engineering practice.

Note 2 to entry: See [Figure 1](#) a).

3.7

chain extensometer

in-place extensometer formed of a series of single extensometer elements

Note 1 to entry: See [Figure 1](#) c).

3.8

probe extensometer

extensometer where the connecting element is a moveable unit

Note 1 to entry: Probe extensometers can be developed as *single-point probe extensometer* ([3.9](#)) or *double-point probe extensometer* ([3.10](#)).

Note 2 to entry: See [Figure 2](#).

3.9**single-point probe extensometer**

extensometer, essentially consisting of a measuring probe and a guiding tube with measuring marks and in which, at the measuring position, only one measuring mark interacts with the probe

Note 1 to entry: The connecting element is the unit consisting of a measuring cable and a probe. The measured value is the distance between the measuring mark and the reference mark at the head of the guiding tube.

Note 2 to entry: Because of its design, function and usual geotechnical application, the single-point probe extensometer is commonly designated as a “magnetic extensometer,” a “magnet settlement probe” or an “inductance probe.”

Note 3 to entry: See [Figure 2 a\)](#).

3.10**double-point probe extensometer**

extensometer, essentially consisting of a measuring probe and a guiding tube with measuring marks and in which, at the measuring position, two measuring marks interact with the probe

Note 1 to entry: The connecting element is the measuring probe. The measured value is the distance between the two measuring marks which are in interaction with the probe.

Note 2 to entry: Because of its design and function, the double-point probe extensometer is commonly designated as an “incremental extensometer” or a “sliding micrometer.”

Note 3 to entry: See [Figure 2 b\)](#).

3.11**gauge length***L*

nominal distance between the contact points of the double-point extensometer probe

Note 1 to entry: *L* is commonly 1,0 m.

Note 2 to entry: *L* is commonly verified in a calibration of the probe prior to the measurement.

3.12**tape extensometer**

extensometer for distance measurements between two accessible measuring points by means of a measuring tape, essentially consisting of a device for tensioning of the tape with a reproducible pulling force, two end pieces for connecting the device to *bolts* ([3.13](#)) and of a read-out unit

Note 1 to entry: Traditionally, tape extensometers were used in tunnelling. By means of follow-up measurements, the change of the distances of two tunnel wall measuring points (in tunnelling, termed “convergence”) is determined. For this reason, tape extensometers are commonly designated as “convergence tapes.”

Note 2 to entry: See [Figure 3](#).

3.13**convergence bolts**

measuring bolts fitting to the type of tape extensometer used

4 Symbols

Symbol	Name	Unit
<i>d</i>	depth of borehole	m
<i>d_i</i>	distance between measuring point <i>i</i> and measuring head	m
<i>F</i>	subscript for follow-up measurement	—
<i>h</i>	height of measuring head above sea level	m
<i>i</i>	number of a measuring point	—

Symbol	Name	Unit
K_T	temperature correction term	—
L	gauge length of a double-point probe extensometer	m
L_i	length of the connecting element between measuring head and measuring point i	m
l	distance between measuring points	m
l_M	length of a measuring ring for probe extensometer	m
n	total number of measuring points along a measuring line	—
P	pulling force of wire extensometer	kN
R	subscript for reference measurement	—
s	displacement reading	m
T	temperature	°C
t	elapsed time	s
u, v, w	displacement component in x-, y-, z-direction, respectively	m
$w_{i\text{rel}}$	displacement component of measuring point i in z-direction relative to the measuring head	m
w_0	absolute displacement component of the measuring head in z-direction	m
w_i	absolute displacement component of measuring point i in z-direction	m
Δw_i	relative displacement between adjacent measuring points i and $i-1$ in z-direction	m
x, y, z	local coordinates of measuring points on a guide tube or in a borehole	m
α_T	coefficient of linear thermal expansion	K ⁻¹
ε_z	strain in direction of the z coordinate	—

5 Instruments

5.1 General

5.1.1 The following types of extensometer in-place, probe and tape should be distinguished from each other (see [Table 1](#) and [Figures 1](#) to [3](#)).

Table 1 — Extensometer types

Extensometer			Feature	Automatic data acquisition
No.	Type	Subtype		
1	in-place (see 5.2)	Single-point/multiple-point in-place extensometer rod/wire extensometer	all instrument components are permanently installed in the ground or at accessible surfaces	possible
2	probe (see 5.3)	single-point/double-point probe extensometer	measuring unit sequentially moved into measuring positions	not common
3	tape (see 5.4)	steel/wire tape extensometer		

5.1.2 Changes of the distances between measuring points shall be monitored by comparison of the measured values with those of the reference measurement. Displacements of the measuring points along the measuring line shall be deduced in accordance with [Annex A](#).

5.1.3 An increase of the distance between two measuring points (=extension) shall be assigned a positive value.

5.1.4 The point onto which the extensometer measurements are related shall be denoted the “reference point.”

5.1.5 For absolute measurements, the coordinates of the reference point shall be independently determined or assumed and verified as fixed.

NOTE If the reference point is assumed to be at the deepest anchor, surveying of the measuring head can serve as a check.

5.1.6 Extensometer measuring points shall be marked by devices such as anchors, rings or bolts. The measuring points of these devices shall be specified as follows:


- for anchors, the centre of an anchor;
- for rings, the centre of a ring;
- for bolts, the centre of a contact butt (for screwed couplings) or the centre of an eye (for eye/hook couplings).

5.1.7 It shall be secured that the device, marking a measuring point, is set in such a way that it is solidly connected to the medium so that any movement of the medium at the measuring point is fully transferred to the device.

5.1.8 Instruments shall not significantly affect the conditions of the medium under investigation and, in turn, shall not be significantly affected in their functionality by the medium (in accordance with ISO 18674-1:2015, 5.1 and 5.2).

Sample Document

get full document from standards.iteh.ai

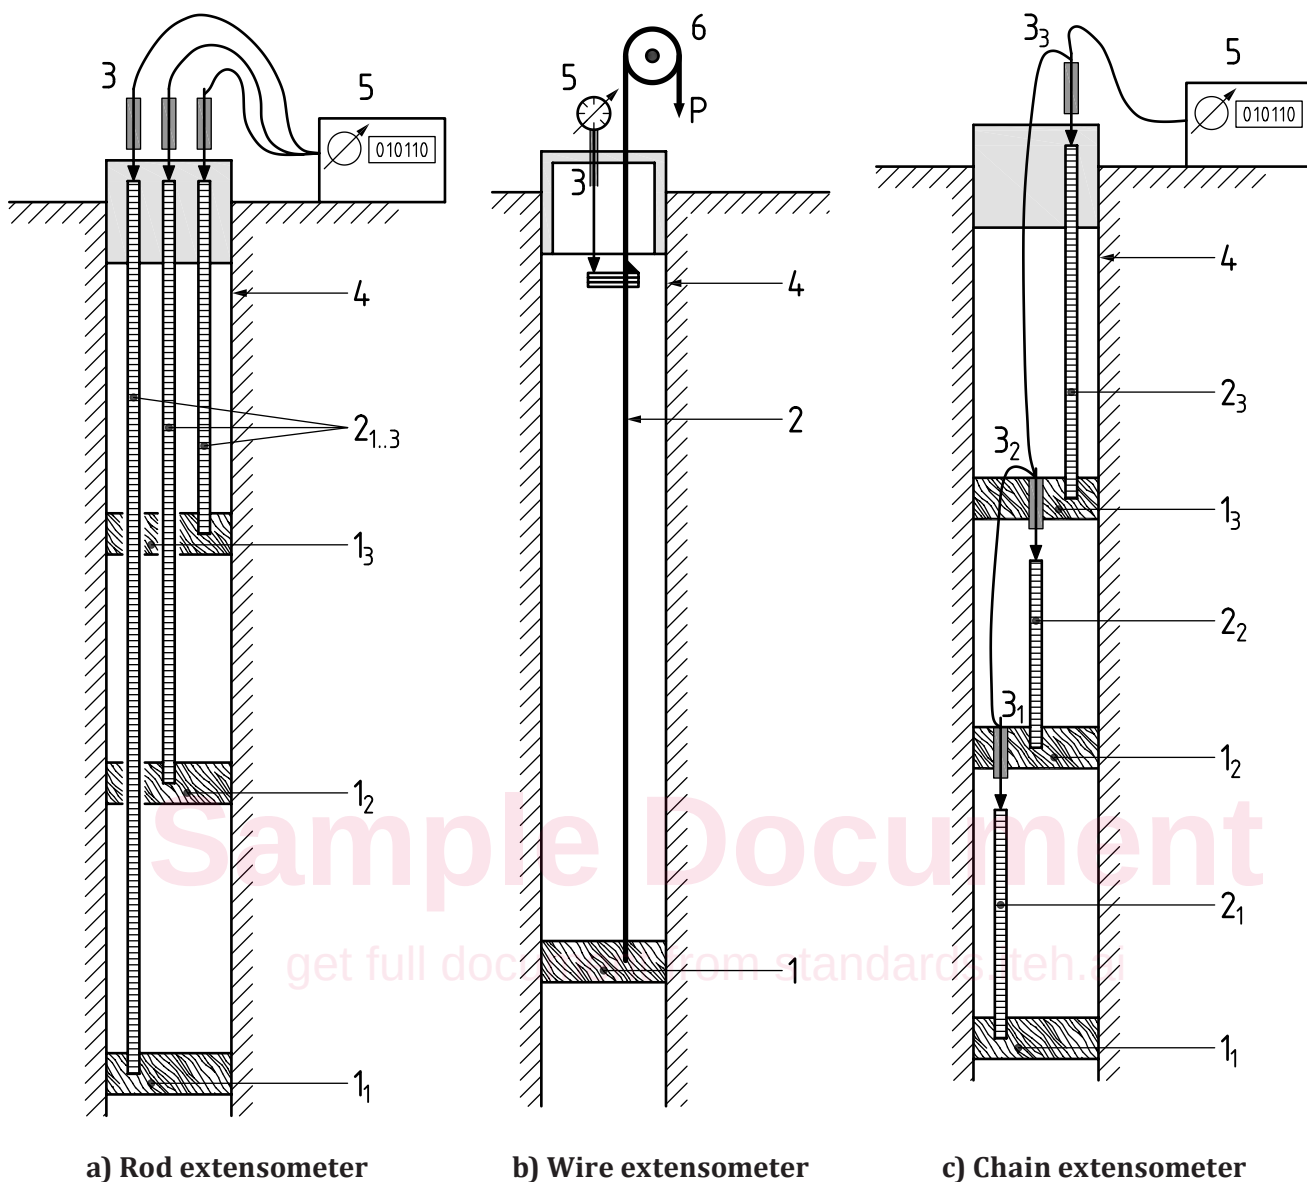

Key


- 1 anchor
- 1_{1..3} anchors 1 to 3
- 2 connecting element (wire)
- 2_{1..3} connecting elements 1 to 3
- 3 measuring head
- 3_{1..3} local measuring heads 1 to 3
- 4 borehole wall
- 5 read-out device
- 6 pulling device
- P tension force

EXAMPLE 1 For subfigure a), triple-point rod extensometer with electrical displacement transducers.

EXAMPLE 2 For subfigure b), single-point wire extensometer with dial gauge read-out.

EXAMPLE 3 For subfigure c), triple-point chain extensometer with electrical displacement transducers.

Figure 1 — Examples of in-place extensometer types

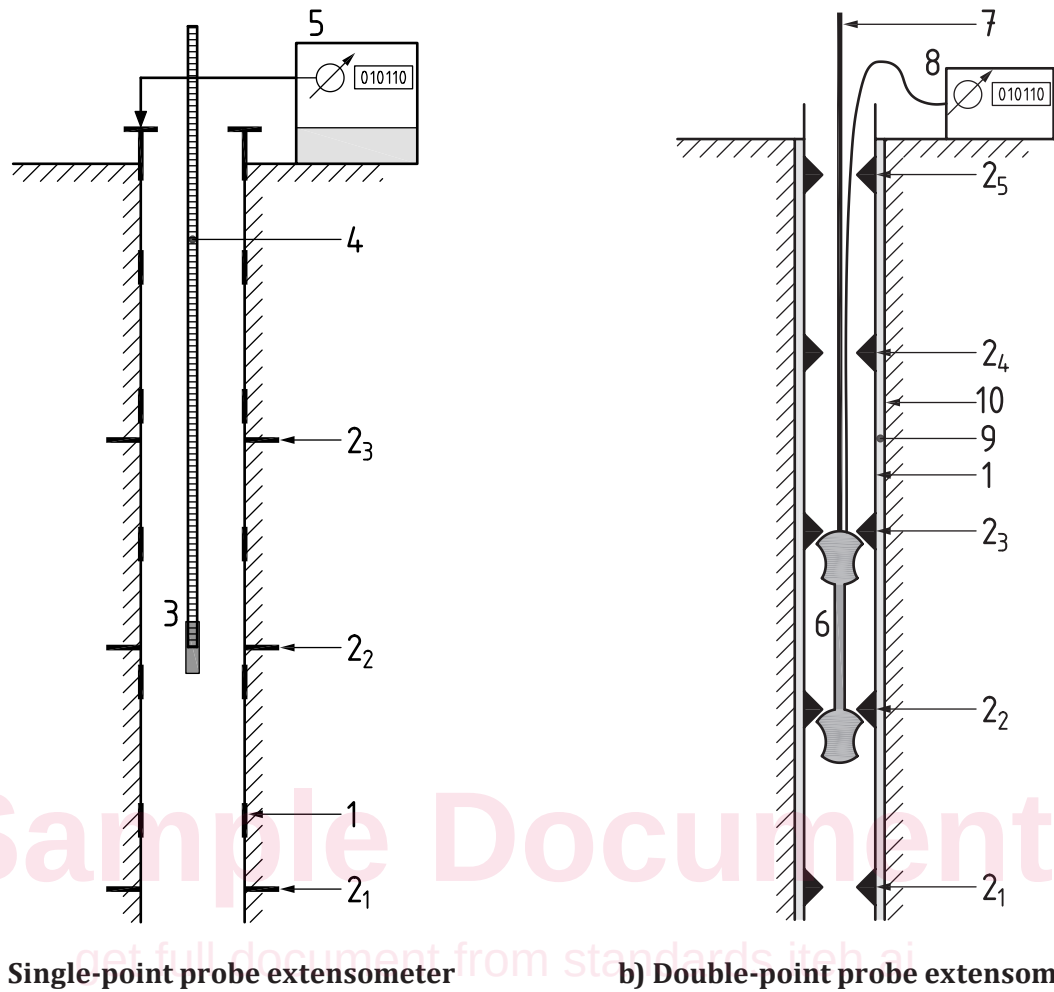
**Key**

- | | |
|--|--|
| 1 measuring tube | 6 probe (in measuring position with rings No. 2 and 3) |
| 2 _{1..3} anchor plates 1 to 3 (with external measuring rings) | 7 setting rods (or pulling rope) |
| 2 _{1..5} measuring rings 1 to 5 | 8 read-out unit |
| 3 probe (in measuring position with anchor Plate No.2) | 9 backfill |
| 4 measuring tape | 10 borehole wall |
| 5 measuring head with reference mark | |

EXAMPLE 1 For subfigure a), magnetic probe extensometer in telescopic tubing.

EXAMPLE 2 For subfigure b), sliding micrometer.

Figure 2 — Examples of probe extensometer types

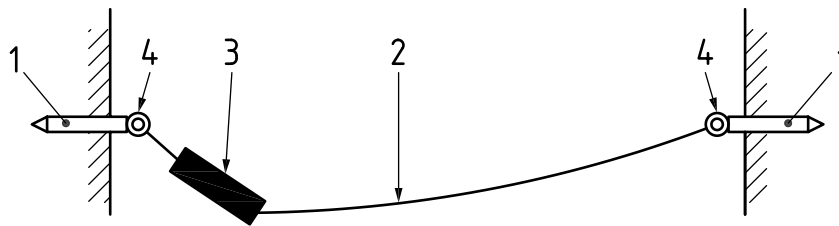**Key**

- 1 convergence bolt
- 2 measuring tape (or measuring wire)
- 3 device for tensioning of tape (or wire) and read-out
- 4 coupling element

Figure 3 — Principal sketch of a tape extensometer

5.2 In-place extensometer

5.2.1 Measuring points

The measuring points should be similar in their function to those common in rock nailing and anchoring works.

EXAMPLES Wedge, straddle packer, spring-activated clamp, cement- or resin-grouted borehole packer, anchor grouting with non-shrinking cement.

NOTE The movement of a measuring point is also transferred to the attached connecting element.

5.2.2 Connecting elements

5.2.2.1 For rod extensometers, a string of interconnected steel rods or a continuous glass fibre-reinforced resin rod should be used, and for wire extensometers, steel wires should be used.

5.2.2.2 The selection of the material and that of the cross sectional area of the connecting elements should be guided by the measuring task, environmental conditions, measuring accuracy and the length of the measuring section (see [Table 2](#)).

5.2.2.3 If a connecting element can be disconnected temporarily from its fixing device at the measuring point, it shall be established that the coupling tolerance does not exceed the intended measuring accuracy of the system.

EXAMPLE Screw couplings or bayonet locks of the connecting element at the anchors.

NOTE Movements across the borehole axis or closure of the borehole can block the connecting element and can affect the functionality of the extensometer. The functionality of an extensometer can be checked by intermittently uncoupling a connecting element.

5.2.2.4 The coefficient of thermal expansion of the connecting elements shall be specified. Temperature variations within the system should be taken into account.

NOTE Temperature-induced changes of the length of the connecting elements can have a substantial influence on the accuracy of an extensometer system. The measurement of thermal gradients by a series of temperature sensors along the extensometer can be useful in developing a suitable correction for temperature changes (see measuring example in [D.2](#)).

5.2.2.5 The free movement of the connecting elements against each other and the backfill shall be ensured by placing the connecting elements inside protective tubes.

EXAMPLE See [Figure 4](#).

5.2.2.6 Friction between connecting elements and protection shall not affect the measurement.

5.2.2.7 For wire extensometers, the connecting elements shall be tensioned prior to the measurement. A constant tensioning force shall be applied. The calibration of the read-out device shall have been made with regard to the specified tensioning force. In the case that the tensioning force is changed, the measured values shall be corrected accordingly.

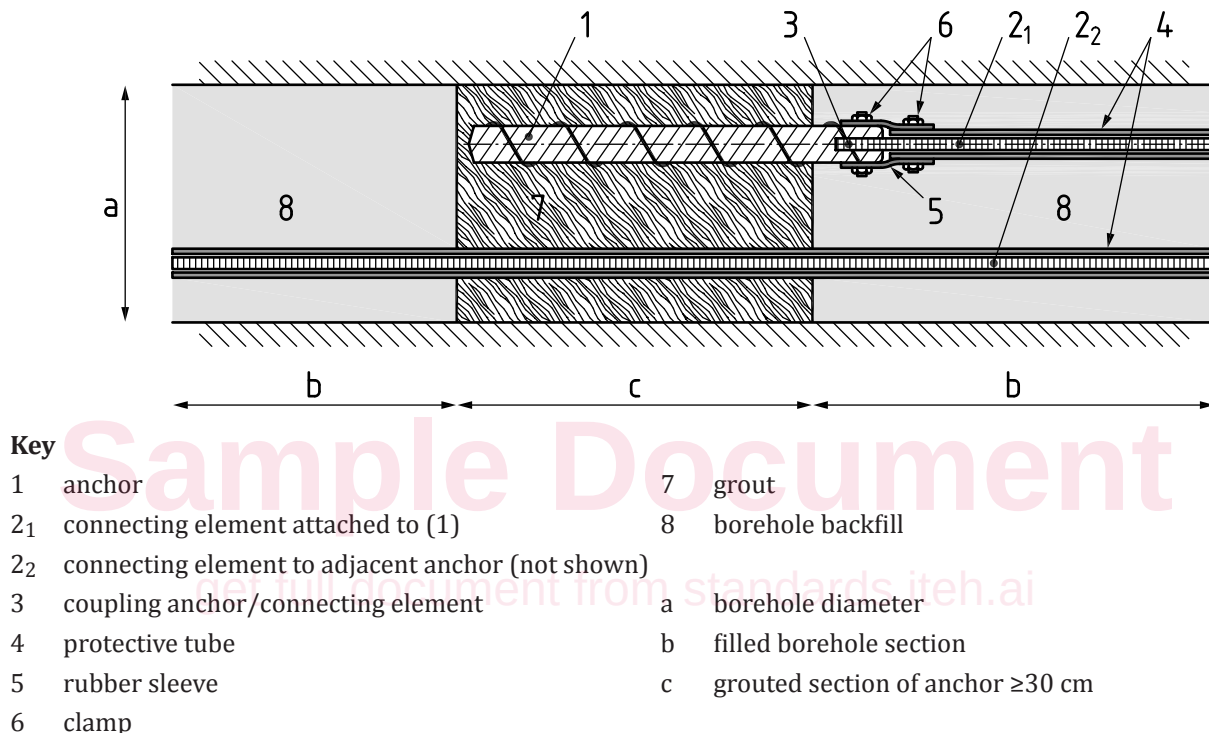


Figure 4 — Example of a cement-grouted anchor of a multiple-point borehole rod extensometer with the connecting element attached to the anchor and a passing connecting element

5.2.3 Measuring head and read-out device


5.2.3.1 The connecting elements terminate at the measuring head. The axial distance between the measuring butt of the measuring head and the measuring butt of the connecting element shall be measured.

EXAMPLE See [Figures 1](#) and [5](#).

NOTE Common distance meters are mechanical dial gauges, electric displacement transducers, vibrating wire displacement transducers and topographic levels.

5.2.3.2 In certain applications, it may be necessary to shorten, or to extend, the connecting elements (including the protection tubes) in the course of the monitoring project. If such a situation is likely to occur, provisions should be made in the monitoring plan and the extensometer system designed accordingly.

EXAMPLE Shortening, respectively extension, of the connection element is required when the measuring range of the distance meter is exceeded.

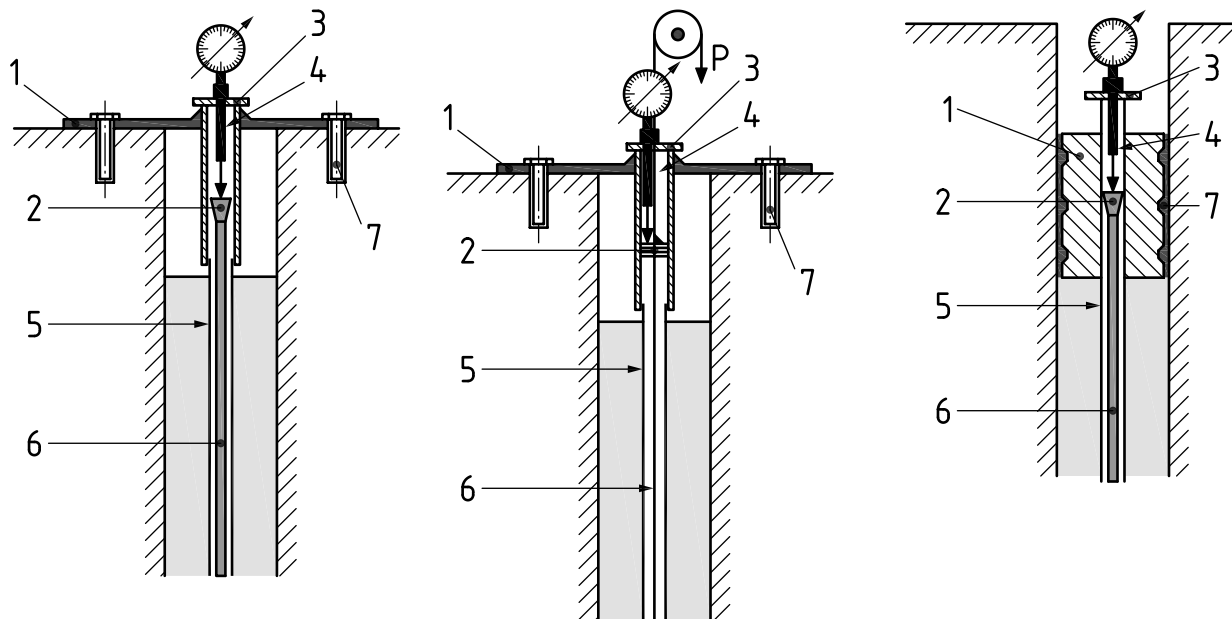

Key

- | | |
|---|--|
| 1 head unit (head plate or recessed head) | 5 protection tube |
| 2 measuring butt at connecting element | 6 connecting element (rod; wire) |
| 3 measuring butt of head plate | 7 fixation of head unit (dowelling; cementation) |
| 4 displacement sensor | |

get full document from standards.iteh.ai

Figure 5 — Types of in-place extensometer measuring head layouts (schematic)

5.3 Probe extensometer

5.3.1 Measuring points and guide tube

5.3.1.1 Each measuring point should be marked by a ring which is embedded in, or attached to, the medium. The ring may be a part of the guide tube [see [Figure 6 b](#)].


5.3.1.2 The guide tube shall not affect the movement of the measuring rings.

5.3.1.3 For single-point probe extensometers [see [Figure 2 a](#)] and PrEx1 in [Table 2](#)], the measuring points can be set at any location along the measuring line.

5.3.1.4 For double-point probe extensometers [see [Figure 2 b](#)] and PrEx 2-1 and PrEx 2-2 in [Table 2](#)], measuring rings shall be used which are compatible with the type of probe used. The measuring points shall be equally spaced according to the gauge length (see [3.11](#)), with a tolerance depending on the measuring range of the probe (see [Table 2](#)).

5.3.1.5 Hydraulic pressures or ground pressures which may develop during the installation and throughout the measuring period shall be considered in the selection of the guide tube.

5.3.1.6 Ground excavation procedures may require temporary or permanent cutting or interruption of guide tubes. It is permissible to continue the probe extensometer survey in the remaining parts of the guide tubes.

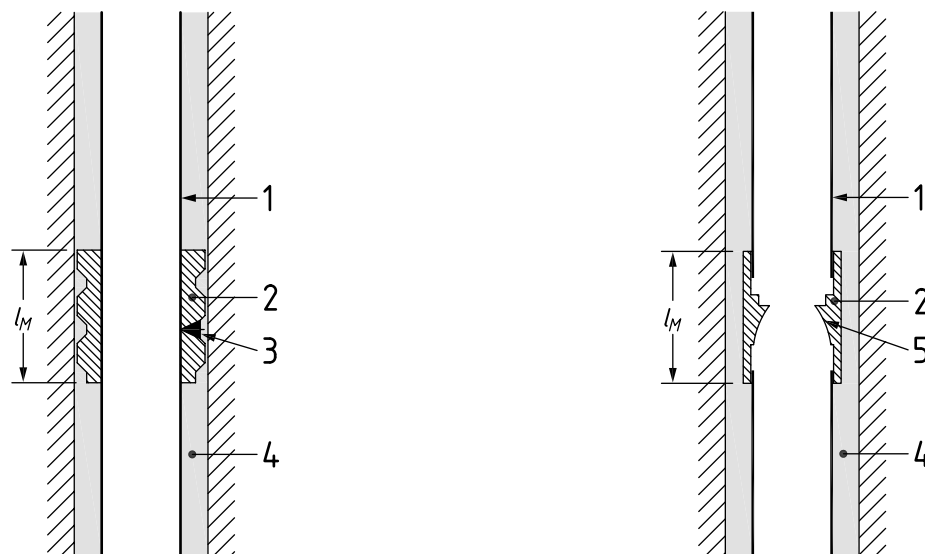

a) Continuous guide tube, inductive measurement

b) Discontinuous guide tube, mechanical measurement

Key

- 1 guide tube
- 2 precision measuring ring of length l_M
- 3 setting screw
- 4 backfill (mortar)
- 5 mechanical high-precision coupling

Figure 6 — Possible measuring ring fixations for probe extensometers

5.3.2 Probe

5.3.2.1 The extensometer device shall allow a controlled positioning of the probe in the measuring points. Reading of the measured value shall be made with the probe at rest.

5.3.2.2 At a measuring location of a single-point probe extensometer, the probe shall uniquely interact with one measuring point. The measured value shall be the distance between the measuring point and the reference mark of the measuring head.

NOTE A tension-resistant graduated measuring cable is commonly used for the measurement of that distance.

5.3.2.3 At a measuring location of a double-point probe extensometer, the probe shall uniquely interact with two adjacent measuring points. The measured value should be the difference between the base length L of the probe and the distance between the two measuring points.

NOTE For a measuring line, the number of double-point probe extensometer measuring points is $n-1$, where n is the total number of measuring rings installed.