

Designation: B771 – 11 (Reapproved 2021)

Standard Test Method for Short Rod Fracture Toughness of Cemented Carbides¹

This standard is issued under the fixed designation B771; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ε) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1 This test method covers the determination of the fracture toughness of cemented carbides (K_{IcSR}) by testing slotted short rod or short bar specimens.

1.2 The values stated in SI units are to be regarded as standard. The values given in parentheses are for information only.

1.3 This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety, health, and environmental practices and determine the applicability of regulatory limitations prior to use.

1.4 This international standard was developed in accordance with internationally recognized principles on standardization established in the Decision on Principles for the Development of International Standards, Guides and Recommendations issued by the World Trade Organization Technical Barriers to Trade (TBT) Committee.

2. Referenced Documents

2.1 ASTM Standards:²

E399 Test Method for Linear-Elastic Plane-Strain Fracture

3. Terminology Definitions

3.1 stress intensity factor, K_l , (dimensional units $FL^{-3/2}$) the magnitude of the ideal-crack-tip stress field for mode l in a linear-elastic body.

NOTE 1—Values of K for mode l are given by:

$$K_{l} = \text{limit} \left[\sigma_{y} \sqrt{2\pi r}\right] \tag{1}$$
$$r \to 0$$

where:

- = distance directly forward from the crack tip to a location where the significant stress σ_y is calculated, and
- σ_v = principal stress normal to the crack plane.

3.2 *Abbreviations:* fracture toughness of cemented carbide, K_{IcSR} , (*dimensional units* $FL^{-3/2}$)—the material-toughness property measured in terms of the stress-intensity factor K_l by the operational procedure specified in this test method.

4. Summary of Test Method

4.1 This test method involves the application of an opening load to the mouth of the short rod or short bar specimen which contains a chevron-shaped slot. Load versus displacement across the slot at the specimen mouth is recorded autographically. As the load is increased, a crack initiates at the point of the chevron slot and slowly advances longitudinally, tending to split the specimen in half. The load goes through a smooth maximum when the width of the crack front is about one third of the specimen diameter (short rod) or breadth (short bar). Thereafter, the load decreases with further crack growth. Two unloading-reloading cycles are performed during the test to measure the effects of any macroscopic residual stresses in the specimen. The fracture toughness is calculated from the maximum load in the test and a residual stress parameter which is evaluated from the unloading-reloading cycles on the test record.


5. Significance and Use

5.1 The property K_{IcSR} determined by this test method is believed to characterize the resistance of a cemented carbide to fracture in a neutral environment in the presence of a sharp crack under severe tensile constraint, such that the state of stress near the crack front approaches tri-tensile plane strain, and the crack-tip plastic region is small compared with the crack size and specimen dimensions in the constraint direction. A K_{IcSR} value is believed to represent a lower limiting value of fracture toughness. This value may be used to estimate the relation between failure stress and defect size when the conditions of high constraint described above would be expected. Background information concerning the basis for

¹ This test method is under the jurisdiction of ASTM Committee B09 on Metal Powders and Metal Powder Products and is the direct responsibility of Subcommittee B09.06 on Cemented Carbides.

Current edition approved Sept. 1, 2021. Published October 2021. Originally approved in 1987. Last previous edition approved in 2017 as B771 – 11(2017). DOI: 10.1520/B0771-11R21.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

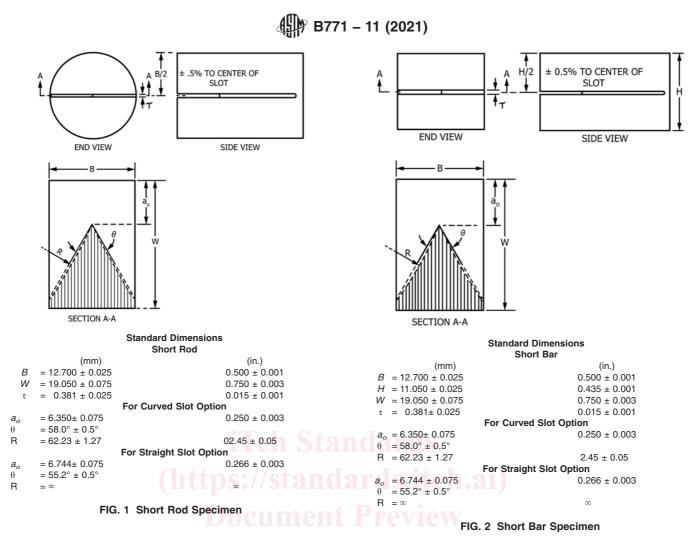

development of this test method in terms of linear elastic fracture mechanics may be found in Refs $(1-7)^3$ STM D771 110

5.2 This test method can serve the following purposes: 6-6f16-4206-a7c0-clb8814398d8/astm-b771-112021 5.2.1 To establish, in quantitative terms significant to service performance, the effects of fabrication variables on the


fracture toughness of new or existing materials, and 5.2.2 To establish the suitability of a material for a specific

application for which the stress conditions are prescribed and for which maximum flaw sizes can be established with confidence.

6. Specimen Configuration, Dimensions, and Preparation

6.1 Both the round short rod specimen and the rectangular shaped short bar specimen are equally acceptable and have been found to have the same calibration (5). The short rod dimensions are given in Fig. 1; the short bar in Fig. 2.

6.2 *Grip Slot*—Depending on the apparatus used to test the specimen, a grip slot may be required in the specimen front face, as shown in Fig. 3. The surfaces in the grip slot shall have a smooth ground finish so that the contact with each grip will be along an essentially continuous line along the entire grip slot, rather than at a few isolated points or along a short segment within the grip slot.

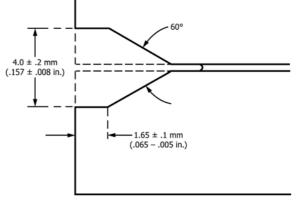


Note 1—The dashed lines show the front face profile of Figs. 1 and 2 without grip slot.

FIG. 3 Short Rod and Short Bar Grip Slot in Specimen Front Face

6.3 *Crack-Guiding Slots*—These may be ground using a diamond abrasive wheel of approximately $124 \pm 3 \text{ mm} (4.9 \pm 0.1 \text{ in.})$ diameter, with a thickness of $0.36 \pm 0.01 \text{ mm} (0.0140 \pm 0.0005 \text{ in.})$. The resulting slots in the specimen are slightly

³ The boldface numbers in parentheses refer to the list of references at the end of this standard.

🖽 B771 – 11 (2021)

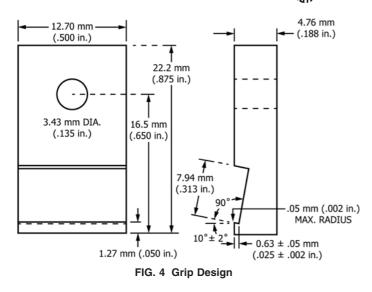

thicker than the diamond wheel $(0.38 \pm 0.02 \text{ mm}, \text{ or } 0.015 \pm 0.001 \text{ in.})$. A diamond concentration number of 50, and a grit size of 150 are suggested. Dimensions are given in Fig. 1 and Fig. 2 for two slotting options: (1) Specimens with curved slot bottoms made by plunge feeding the specimen onto a diamond cutting wheel of a given radius, and (2) Specimens with straight slot bottoms made by moving the specimen by a cutting wheel. The values of a_o and θ for the two slot configurations are chosen to cause the specimen calibration to remain constant.

7. Apparatus

7.1 The procedure involves testing of chevron-slotted specimens and recording the load versus specimen mouth opening displacement during the test.

7.2 Grips and Fixtures for Tensile Test Machine Loading-Grip slots are required in the specimen face for this test method, as shown in Fig. 3. Fig. 4 shows the grip design. Grips shall have a hardness of 45 HRC or greater, and shall be capable of providing loads to at least 1560 N (350 lbf). The grips are attached to the arms of tensile test machine by the pin and clevis arrangement shown in Fig. 5. The grip lips are inserted into the grip slot in the specimen, and the specimen is loaded as the test machine arms apply a tensile load to the grips. A transducer for measuring the specimen mouth opening displacement during the test, and means for automatically recording the load-displacement test record, such as an X-Yrecorder, are also required when using the tensile test machine apparatus. A suggested design for the specimen mouth opening displacement gage appears in Fig. 6. The gage shall have a displacement resolution of 0.25 μ m (10 × 10⁻⁶ in.) or better. However, it is not necessary to calibrate the displacement axis of the test record since only displacement ratios are used in the data analysis.

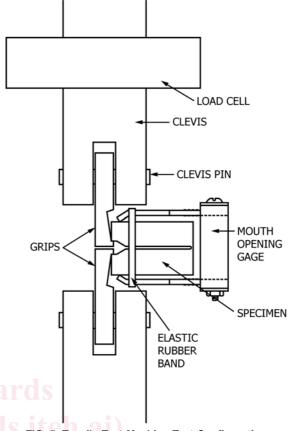
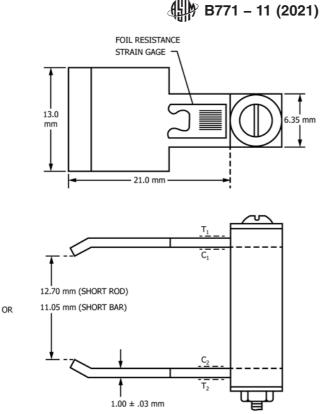


FIG. 5 Tensile Test Machine Test Configuration

7.3 Distributed Load Test Machine⁴—An alternative special purpose machine that has been found suitable for the test requires no grip slot in the front face of the specimen. A thin stainless steel inflatable bladder is inserted into the chevron slot in the mouth of the specimen. Subsequent inflation of the bladder causes it to press against the inner surfaces of the slot, thus producing the desired loading. The machine provides load and displacement outputs, which must be recorded externally on a device such as an X-Y recorder.

7.4 *Testing Machine Characteristics*—It has been observed that some grades of carbides show a "pop-in" type of behavior in which the load required to initiate the crack at the point of the chevron slot is larger than the load required to advance the crack just after initiation, such that the crack suddenly and audibly jumps ahead at the time of its initiation. Occasionally, the load at crack initiation can exceed the load maximum which occurs as the crack passes through the critical location in the specimen. When this occurs, a very stiff machine with

⁴ The sole instrument of this type known to the committee is the FraQ WC, available from Dijon Instrument Inc, 1948 Michigan Ave, Salt Lake City, UT 84108. If you are aware of alternative suppliers, please provide this information to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee1, which you may attend.






FIG. 6 Suggested Design for a Specimen Mouth Opening Gage

controlled displacement loading is necessary in order to allow the crack to arrest well before passing beyond the critical location. The large pop-in load is then ignored, and the subsequent load maximum as the crack passes through the critical location is used to determine K_{IcSR} . Stiff machine loading is also required in order to maintain crack growth stability to well beyond the peak load in the test, where the second unloading-reloading cycle is initiated.

8. Procedure

8.1 *Number of Tests*—A minimum of 3 replicate tests shall be made.

8.2 Specimen Measurement:

8.2.1 Measure and record all specimen dimensions. If the dimensions are within the tolerances shown in Fig. 1 and Fig. 2, no correction to the data need be made for out-of-tolerance dimensions. If one or more of the parameters a_o , W, θ or τ are out of tolerance by up to 3 times the tolerances shown in Fig. 1 and Fig. 2, valid tests may still be made by the application of the appropriate factors to account for the deviation from standard dimensions (see 9.3). If the slot centering is outside the indicated tolerance, the crack is less likely to follow the chevron slots. However, the test may still be considered successful if the crack follows the slots sufficiently well, as discussed in 9.2.

8.2.2 The slot thickness measurement is critical on specimens to be tested on a Fractometer. It should be measured to within 0.013 mm (0.0005 in.) at the outside corners of the slot using a feeler gage. If a feeler gage blade enters the slot to a depth of 1 mm or more, the slot is said to be at least as thick as the blade. Because the saw cuts forming the chevron slot


overlap somewhat in the mouth of the specimen, and because the cuts may not meet perfectly, the slot width near the center of the mouth may be larger than the width at the outside corners. If the slot width near the center exceeds the slot width at the corners by more than 0.10 mm (0.004 in.), a test of that specimen by a Fractometer is invalid.

8.3 Specimen Testing Procedure:

8.3.1 Load Transducer Calibration:

8.3.1.1 Calibrate the output of the load cell in the test machine to assure that the load cell output, as recorded on the load versus displacement recorder, is accurately translatable into the actual force applied to the specimen. In those cases in which a distributed load test machine is used (see 7.3), the calibration shall be performed according to the instructions in Annex A1.

8.3.1.2 Install the specimen on the test machine. If using the tensile test machine (see 7.2), operate the test machine in the "displacement control" mode. Bring the grips sufficiently close together such that they simultaneously fit into the grip slot in the specimen face. Then increase the spacing between the grips very carefully until an opening load of 10 to 30 N (2 to 7 lb) is applied to the specimen. Check the alignment of the specimen with respect to the grips, and the alignment of the grips with respect to each other. The grips shall be centered in the specimen grip slot to within 0.25 mm (0.010 in.). The vertical offset between the grips shall not exceed 0.13 mm (0.005 in.). Using a magnifying glass, observe the grips in the grip slot from each side of the specimen to assure that the specimen is properly installed. The grips should extend as far as possible into the grip slot, resulting in contact lines (load

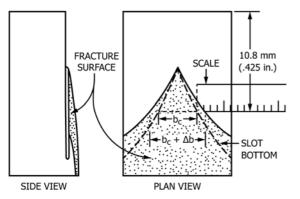

Note 1—For a valid test, the overhang sum Δb , measured at a distance of 10.8 mm from the specimen mouth, must not exceed 0.25 mm (0.010 in.).

FIG. 7 Short Rod or Short Bar Tested Specimen Half with Imperfect Crack Guidance by the Slots

lines) at 0.63 mm (0.025 in.) from the specimen front face. Correct any deviations from the desired specimen alignment.

8.3.1.3 Install the specimen mouth opening displacement gage on the specimen. The gage must sense the mouth opening no farther than 1 mm (0.040 in.) from the front face of the specimen. If the gage design of Fig. 6 is used, the contact force between the gage arms and the specimen can be adjusted with a rubber elastic band so the gage will support itself, as indicated in Fig. 5. However, the contact force must not be more than 2 N (0.5 lb), as it increases the measured load to fracture the specimen.

8.3.1.4 Adjust the displacement (*x*-axis) sensitivity of the load-displacement recorder to produce a convenient-size data trace. A70° angle between the *x*-axis and the initial elastic loading trace of the test is suggested. A quantitative calibration of the displacement axis is not necessary.

8.3.1.5 With the load-displacement recorder operating, test the specimen by causing the specimen mouth to open at a rate of 0.0025 to 0.0125 mm/s (0.0001 to 0.0005 in./s). The specimen is unloaded by reversing the motion of the grips twice during the test. The first unloading is begun when the slope of the unloading line on the load-displacement record will be approximately 70 % of the initial elastic loading slope. (For estimating the point at which the unloadings should be initiated, it can be assumed that the unloading paths will be linear and will point toward the origin of the load-displacement record.) The second unloading is begun when the unloading slope will be approximately 35 % of the initial elastic loading slope. Each unloading shall be continued until the load on the specimen has decreased to less than 10 % of the load at the initiation of the unloading. The specimen shall be immediately reloaded and the test continued after each unloading. The test record generated by the above procedure should be similar to that of Fig. 8.

8.3.2 *Crack-Pop-In*—If a sudden load drop occurs simultaneously with an audible "pop" or "tick" sound from the specimen during the initial part of the test when the load is rising most rapidly, a crack pop-in has occurred at the point of the chevron slot. If the pop-in is large, such that the first unloading slope that can be drawn is less than half of the initial elastic loading slope, the test is invalid.

9. Calculation and Interpretation of Results

9.1 Remove the specimen from the apparatus. If the two halves are still joined, break them apart with a wedge. Examine the fracture surfaces for any imperfections that may have influenced the measured peak load. Any imperfections (such as a void, a surface irregularity, or a piece of foreign matter) that is visible to the naked eye may influence the measurement if the imperfection is located between 7.6 mm (0.30 in.) and 14.2 mm (0.56 in.) from the mouth of the specimen. Imperfections outside this region do not affect the peak load unless they are very large. Discard the data whenever the peak load may have been affected by an imperfection in the fracture plane.

9.2 Examine the fracture surface to determine how well the crack followed the chevron slots in splitting the specimen apart. If the" crack follow" was imperfect, the crack will have cut substantially farther into one half of the specimen than the other, and the crack surface will not intersect the bottom of the chevron slots, as shown in Fig. 7. The size of the lip overhanging the slot bottom determines whether the crack follow was sufficiently good for a valid test. Measure the "overhang" of the fracture surface over the slot bottom on each side of the chevron at a distance of 10.8 mm (0.425 in.) from the mouth of the specimen (Fig. 7). If the sum, Δb , of the overhangs on each side of the chevron exceeds 0.25 mm (0.010 in.), the test is invalid.

Note 2—Imperfect crack follow often results from poor centering of the chevron slot in the specimen. However, it can also result from strong residual stresses in the test specimen.

9.3 Out-of-Tolerance Dimension Corrections—If the specimen dimensions are all within the tolerances specified in Fig. 1 and Fig. 2, assign $C_c = 1$, where C_c is the specimen configuration correction factor. If a_o , W, θ , or τ differ from their specified tolerance by more than 3 times the tolerance specified in Fig. 1 or Fig. 2, the sample is invalid. If a_o , W, θ , or τ differ from their specified tolerance by less than or equal to three times the tolerance specified in Fig. 1 or Fig. 2, compensation can be made using the correction factors defined in 9.3.1 through 9.3.5 (7). The subscript *nom* refers to the nominal dimension specified in Fig. 1 or Fig. 2.

9.3.1 If a_o is within tolerance, assign $C_a = 1$. However, if a_o is out of tolerance, calculate:

$$C_a = 1 + 1.8(a_o - a_{onom}) / B$$
 (2)

9.3.2 If *W* is within tolerance, assign $C_W = 1$. However, if *W* is out of tolerance, calculate:

$$C_W = 1 - 0.7(W - W_{nom})/B.$$
 (3)

9.3.3 If θ is within tolerance, assign $C_{\theta} = 1$. However, if θ is out of tolerance, calculate:

$$C_{\theta} = 1 - 0.015 (\theta - \theta_{nom}) \tag{4}$$

where θ is in degrees.

9.3.4 If τ is within tolerance, or if τ is out of tolerance and grip loading was used, assign $C_{\tau} = 1$. However, if τ is out of tolerance and distributed loading (Fractometer) was used, calculate:

$$C_{\tau} = 1 - 12.5(\tau - \tau_{nom})/B$$
(5)