



Designation: ~~D2291/D2291M—16~~ D2291/D2291M – 22

Standard Practice for Fabrication of Ring Test Specimens for Glass-Resin Composites¹

This standard is issued under the fixed designation D2291/D2291M; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

This standard has been approved for use by agencies of the U.S. Department of Defense.

1. Scope*

1.1 This practice is intended for use in the fabrication of ring-type test specimens to be used in the evaluation of the mechanical properties of reinforcement and resins in a composite structure. The practice outlines the steps in the preparation of the test specimens, including the final specimen machining where applicable. ~~Four~~Three final ring configurations are included.

1.2 The values stated in either SI units or inch-pound units are to be regarded separately as standard. The values stated in each system may not be exact equivalents; therefore, each system shall be used independently of the other. Combining values from the two systems may result in nonconformance with the standard.

1.3 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate ~~safety~~safety, health, and health~~environmental~~ practices and determine the applicability of regulatory limitations prior to use.*

NOTE 1—There is no known ISO equivalent to this practice.

1.4 *This international standard was developed in accordance with internationally recognized principles on standardization established in the Decision on Principles for the Development of International Standards, Guides and Recommendations issued by the World Trade Organization Technical Barriers to Trade (TBT) Committee.*

2. Referenced Documents

2.1 ASTM Standards:²

[D618 Practice for Conditioning Plastics for Testing](#)

[D883 Terminology Relating to Plastics](#)

[D2290 Test Method for Apparent Hoop Tensile Strength of Plastic or Reinforced Plastic Pipe](#)

[D2344/D2344M Test Method for Short-Beam Strength of Polymer Matrix Composite Materials and Their Laminates](#)

3. Terminology

3.1 For definitions of terms which apply to this practice, see Terminology [D883](#).

¹ This practice is under the jurisdiction of ASTM Committee [D20](#) on Plastics and is the direct responsibility of Subcommittee [D20.18](#) on Reinforced Thermosetting Plastics. Current edition approved ~~Sept. 1, 2016~~ Nov. 1, 2022. Published ~~September 2016~~ November 2022. Originally approved in 1964. Last previous edition approved in ~~2009~~ 2016 as ~~D2291 – 09~~ D2291 – 16. DOI: ~~10.1520/D2291–D2291M-16~~ 10.1520/D2291_D2291M-22.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For Annual Book of ASTM Standards volume information, refer to the standard's Document Summary page on the ASTM website.

*A Summary of Changes section appears at the end of this standard

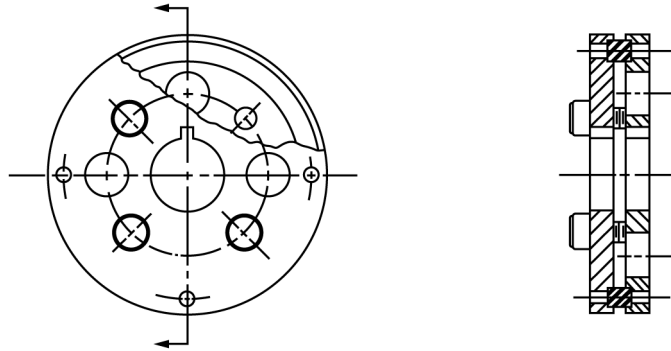


FIG. 1 Suggested Single-Ring Mold

4. Significance and Use

4.1 This practice provides a uniform procedure for fabricating glass fiber/thermoset resin ring samples for use as test specimens. Specimens so prepared can be used in Test Methods D2290 and D2344/D2344M.

5. Apparatus

5.1 *Winding Machine*—The winding machine may shall consist of any adequate superstructure for mounting impregnated reinforcement or components for application of resin to the reinforcement, tensioning the reinforcement, and collecting the wetted, tensioned material on a mold or mandrel of the desired size.

5.2 *Tension Measuring System*—Any device suitable for measurement of the tension applied to the wetted reinforcement. The device shall be capable of measuring the tension accurately to within $\pm 5\%$. use of a tension measuring system is optional for measurement of the tension applied to the wetted reinforcement.

5.3 The single-ring fabrication mold on which the wetted reinforcement is collected shall be constructed as shown in Fig. 1. For cylinder fabrication from which rings are to be cut, a mandrel with the proper diameter fitted to a suitable winding machine shall be used to collect the wetted reinforcement. The surfaces of the mold or mandrel that contact the ring specimens shall be coated or otherwise treated to prevent sticking of the ring or cylinder in the mold or on the mandrel.

5.4 *Curing Ovens*—Ovens having adequate range in temperature to produce a fully cured specimen shall be available for use. Control of the curing-postcuring temperatures to within $\pm 9^\circ\text{F}$ ($\pm 5^\circ\text{C}$) is required.

6. Storage and Conditioning of Components

6.1 Glass rovings and yarns for use in fabrication of ring test specimens shall be stored in a dry place, not subject to temperature extremes, or as specified by the glass producer. Prior to use, the rovings shall be conditioned in accordance with Procedure A of Practice D618, which requires 40 hours at $23^\circ\text{C} \pm 2^\circ\text{C}$ and a 50 % relative humidity $\pm 10\%$.

6.2 Resins to be used in the fabrication of ring test specimens shall be stored in closed containers at a temperature specified by the supplier. In addition, no resin shall be used that has been stored for a period in excess of the shelf life recommended by the supplier. Prior to fabrication of the test specimen, the resin shall be heated as necessary to provide sufficient lowering of the viscosity to produce good wetting of the reinforcement strand.

6.3 *Preimpregnated*—Pre-impregnated materials received for the preparation of ring test specimens shall be stored in a closed container at a temperature as recommended by the supplier. Before winding, they shall be removed from storage and conditioned as recommended by the supplier or in accordance with Procedure A of Methods D618.

7. Procedure for Dry Reinforcement

7.1 Fig. 2 is a schematic diagram of the an example of a system for wetting, tensioning, and collecting the reinforcement.

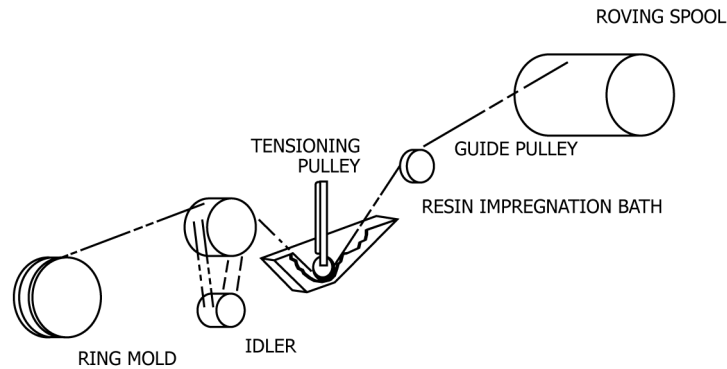


FIG. 2 Schematic Diagram Example of Wet Roving Ring Winding Apparatus

7.1.1 Mounting Reinforcement Packages:

7.1.1.1 *Outside Pull Packages*—Mount the reinforcement package in a convenient location within the superstructure of the winding machine. Provide sufficient braking of the axle of the package to prevent free-wheeling. This should be a minimum tension.

7.1.1.2 *Inside Pull Packages*—Mount the reinforcement package so that the roving is pulled from the inside of the package and passes through a guide eye such that the roving does not rub against the package edge or any sharp edges.

7.1.2 *Application of Resin*—The reinforcement leaving the package shall pass immediately into the resin bath. Heat the resin bath sufficiently to lower the resin viscosity to a workable range. As the reinforcement is pulled from the resin bath, remove excess resin by any convenient method that results in a minimum amount of fraying or breakage of the reinforcement.

7.1.3 *Tensioning*—After leaving the resin bath, pass the reinforcement over a pulley or a series of pulleys, adequately braked to impart the desired tension to the fibers. The tension may shall be monitored, by any convenient method, either periodically or continuously during the winding operation. Limit the deviation from the mean tension to $\pm 5\%$ from start to finish of the winding of a test specimen. The A tension pulley is optional. If a tension pulley is used, the diameter of the tension pulley(s) shall be a minimum of 3.0 in. (76.2 mm). Larger sizes should be used when available. Take care that no slippage of the strand occurs over the pulley(s).

7.1.4 *Level-Winding*—Pass the wetted reinforcement through a level-winding guide and onto the mold. The guide shall be geared to the mold or mandrel or shall follow a cam in such a manner that each revolution of the mold or mandrel will be accompanied by a precision of the guide by an amount equivalent to one strand width.

7.1.5 *Collecting Reinforcement*—Collect the wetted reinforcement strand on a mold or mandrel that is mounted on the axle of a variable-speed drive. The strand velocity through the resin bath shall be constant and shall be slow enough to give good wetting of the reinforcement with the resin. Apply an adequate mold release agent to the mold or mandrel before winding is begun to assure easy removal of the specimen after fabrication. Wind specimens to be tested without machining the surface to a thickness as indicated for the Type B specimen, Fig. 3. Build up Types A, B, C, and DC specimens in Fig. 3 to a thickness beyond that required for finished thickness. Upon completion of the winding process, secure the strand in such a manner as to retain the tension before cutting the strand and removing the mold or mandrel from the winding machine.

7.1.6 *Curing*—Transfer the molds or mandrel to an oven and polymerize the resin in the manner prescribed in the resin manufacturer's data sheet.

NOTE 2—Excess resin on the surface of the Type B specimen should be removed if possible during cure.

NOTE 2—Many fabricating factors influence the mechanical properties of the rings such as the equipment system, resin system and age, operator techniques, ambient conditions and conditioning, etc. For this reason it is best to run a control material with each set of samples and to randomize the fabrication order of the rings.

7.1.7 *Removing Rings from Mold or Mandrel*—Remove the ring specimens from the molds or mandrel in such a manner that