



Designation: D6265 – 23

Standard Practice for Separation of Contaminants in Polymers Using an Extruder Filter Test¹

This standard is issued under the fixed designation D6265; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

1. Scope*

1.1 This practice covers a means to separate the unmolten particles, gels, and impurities contaminating a polymer sample. The procedure may be used to remove gels and incompatible materials that may cause imperfections in the final extruded product. Under pressure, most gels will break up or deform and pass through a wire mesh filter, however high molecular weight gels may not break up or deform.

1.2 Materials isolated on a wire mesh filter can be identified by spectroscopic or other analytical means.

NOTE 1—Although not presented as a quantitative method, the procedure presented in this practice may be used to provide quantitative results at the discretion of the user. The user assumes the responsibility to verify the reproducibility of quantitative results. Detection limit depends on the mesh size of the filter screen, but the procedure is generally applicable to the separation of immiscible contaminants present at concentrations greater than 0.1 %.

1.3 The values stated in SI units are to be regarded as standard.

1.4 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety, health, and environmental practices and determine the applicability of regulatory limitations prior to use.* For specific hazards statements, see Section 8

NOTE 2—There is no known ISO equivalent to this standard.

1.5 *This international standard was developed in accordance with internationally recognized principles on standardization established in the Decision on Principles for the Development of International Standards, Guides and Recommendations issued by the World Trade Organization Technical Barriers to Trade (TBT) Committee.*

¹ This test method is under the jurisdiction of ASTM Committee D20 on Plastics and is the direct responsibility of Subcommittee D20.95 on Recycled Plastics.

Current edition approved Feb. 1, 2023. Published February 2023. Originally approved in 1998. Last previous edition approved in 2017 as D6265 - 17. DOI: 10.1520/D6265-23.

2. Referenced Documents

2.1 *ASTM Standards*:²

D883 Terminology Relating to Plastics

D1238 Test Method for Melt Flow Rates of Thermoplastics by Extrusion Plastometer

D1600 Terminology for Abbreviated Terms Relating to Plastics

3. Terminology

3.1 *Definitions*—For definitions of terms that appear in this specification relating to plastics, refer to Terminology D883. For abbreviations that appear in the specification, refer to Terminology D1600.

4. Summary of Practice

4.1 This practice determines the relative contamination level that can cause undesirable imperfections in the extruded product due to contaminants and gels. Although this practice is not designed to provide an absolute measurement of contamination level, using appropriate criteria, the rate of this pressure rise can be correlated to the relative contamination level.

5. Significance and Use

5.1 Problems with extrusion and subsequent processing of the material are caused, in part, by the presence of paper, metal, gels, incompatible polymers, or other extraneous contamination found in polymers.

6. Apparatus

6.1 *Extruder*, designed to deliver a continuous supply of molten resin to a filter at a uniform rate with good temperature control. Extruders with 18 to 64-mm diameters have been found to be satisfactory.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

*A Summary of Changes section appears at the end of this standard

6.1.1 *Internal Rod Die*, to fix the filter area. Fig. 1 shows a typical 6.4 mm diameter die that gives a filter area of 12.45 mm².

6.1.2 *Breaker Plate or Screen Holder*—A typical configuration is shown in Fig. 2.

6.1.3 *Pressure Transducer*, installed in-line before the screen pack and connected to digital readout.

6.1.4 *Melt Thermocouple*, installed before or after the screen pack.

6.1.5 *High Pressure Alarm and Rupture Disk*.

6.1.6 *Split Clamp*, to permit ready access to the screens, sizing die, and breaker plate.

6.1.7 *Swing Gate*, to support the split clamp (6.1.6) during screen changes.

NOTE 3—Although desirable, a swing gate is not always available on small extruders.

6.2 *Screens*, The screen diameter is equal to the barrel diameter. Screen sizes of 60 mesh (0.251-mm opening), 100 mesh (0.152-mm opening), 200 mesh (0.076-mm opening), 325 mesh (0.045-mm opening) or finer have been found to be satisfactory.

NOTE 4—If the rate of pressure increase is impractical due to extremes in the contaminant level or size, screens with alternative mesh sizes can be used.

6.3 *Balance*, capable of weighing with accuracy of ±0.1 gms.

6.4 *Torque Wrench*, with ratchet drive attachment.


6.5 *Thermally Insulated Gloves*.

6.6 *Spatulas and Scrapers*, brass, assorted sizes for removing molten polymer from equipment.

6.7 *Recording/monitoring device*, to monitor and record pressure build-up and other extruder properties.

7. Materials

7.1 *Virgin Polymer*, free of gels and contaminants, for purging the extruder equipment.

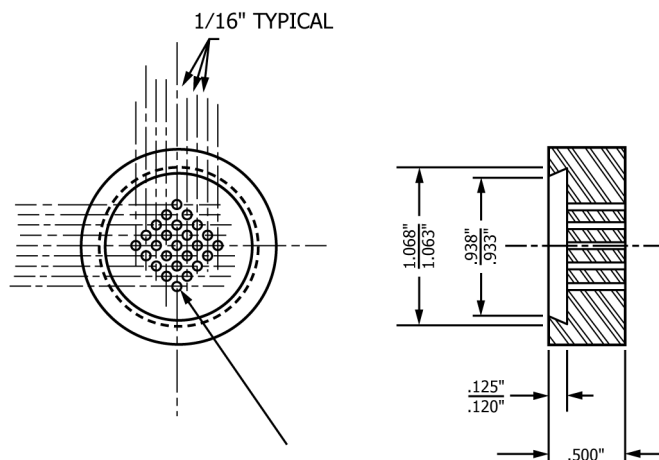

NOTE 1—Drill 25 holes; use #60 drill.

FIG. 2 Schematic of the Breaker Plate

8. Hazards

8.1 Hot polymer can cause serious burns. Do not stand in front of the extruder because air bubbles, excessive temperature or pressure causes hot polymer to be expelled from the extruder die.

8.2 Wear thermally insulated gloves when handling hot polymer or working directly with the heated areas of the extruder.

9. Procedure


9.1 Turn on the power to the extruder and turn on the feed throat cooling water.

9.2 Set extruder temperature controllers to maintain the barrel at the appropriate temperature for the polymer (see Table 1).

9.3 Wait a minimum of 30 min after achieving extruder temperature before starting the extruder.

9.4 Insert a new screen pack using 60 (0.251 mm opening)-100 (0.152 mm opening) -60 mesh screens plus the backing screens for the extruder purge.

NOTE 5—The screen pack must have sufficient depth to prevent the breaker plate from fully contacting the rod die. This helps keep the screens firmly in place, insures the correct surface area of filter screw is actually used during the test, and simplifies disassembly.

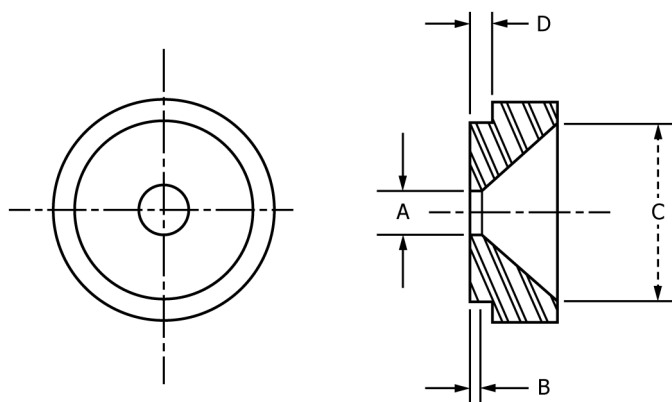

NOTE 1—A = 0.250 in.,
 B = 0.0625 in.,
 C = same diameter as extruder barrel, and
 D = dimension that when added to the total thickness of the screen pack shall exceed the depth of the screen-retaining recess of the breaker plate to permit compression of the screens.

FIG. 1 Schematic Showing the Internal Sizing of the (Rod) Die

TABLE 1 Suggested Extruder Temperatures

Polymer	Extruder Temperature, °C
Acetals	190
Acrylics	230
Nylon	275
Polycarbonate	300
Polyethylene	200
Poly(ethylene terephthalate)	280
Polypropylene	230
Polystyrene	200
Poly(vinyl acetal)	150
Styrene-acrylonitrile	225

9.5 Close the split clamp and tighten to 6.9 kg-m (50 ft-lb) using a torque wrench (this and other requirements may vary depending on the extruder model).

NOTE 6—Allow the breaker plate and rod die to heat up for an additional 5 min to melt any residual solidified polymer before starting the extruder.

9.6 Charge the hopper with 14 kg virgin polymer and start the extruder.

9.7 Adjust the screw speed to the desired setting and purge the system with virgin polymer.

9.7.1 For startup after more than 4 hours of non-use, purge 20 min at 10 to 20 rpm followed by 5 to 8 min at 100 rpm.

9.7.2 For systems with less than 4 h of non-use, purge 10 to 15 min at 10 to 20 rpm followed by 3 to 4 min at 80 rpm.

9.8 Empty and refill the hopper with the test sample and purge for a minimum of 5 min at 40 to 60 rpm.

9.9 Shut down the extruder and immediately change the screen pack assembly to the following sequence:

9.9.1 Extruder, rod die, 325 mesh screen (0.045 mm opening), 200 mesh screen (0.076 mm opening), 100 mesh screen (0.152 mm opening), 60 mesh screen (0.251 mm opening), backing screens (60 mesh or higher), and the breaker plate.

NOTE 7—Referring to Fig. 3, the screen pack must have sufficient depth to prevent the breaker plate from fully contacting the rod die. Screens of other mesh size may be substituted.

9.10 Start the extruder and bring it up to a screw speed of 100 rpm as quickly as possible while observing pressure and load readouts for any excessive increases.

9.11 Once the pressure has stabilized for a minimum of 5 min and the system is at the correct temperature, cut off the

extrudate at the strip die and begin collection. Record the initial filter pressure (P_i) to the nearest 0.2 Mpa. If the pressure continues to rise, but not stabilize, stop the extruder before attaining the maximum safe operating pressure for the equipment. Note and report the rate of pressure rise.

9.12 Continue extruding the polymer monitoring the filter pressure until 14 kg of polymer has been extruded. Record the filter pressure every 5 minutes ($P_{(minutes)}$) and at the end of the collection cycle (P_f) to the nearest 0.2 MPa.

NOTE 8—After the filters are installed, carefully watch the filter back pressure as the extrusion is restarted. If a rapid pressure rise occurs, stop the extrusion before exceeding the maximum safe operating pressure for the equipment.

NOTE 9—The extrudate can be collected as a total mass and weighed after all resin has been extruded or the extrusion rate may be determined and the filtration continued for the time required to filter 15 kg of resin.

9.13 Shut down the extruder.

NOTE 10—If running unstabilized polymer (for example, polyolefin flake), always purge the system with stabilized pellets before shutting down the extruder. Always return extruder drive to minimum rpm before shutting down the extruder. To prevent excessive degradation of polymer left in the extruder, turn down the temperatures or turn off all heaters depending on the duration of the shutdown.


9.14 Disassemble the screen pack and save the 325 mesh screen. Scrape any excess polymer off the screen while it is still hot to avoid disturbing any residues and to make the residue more visible.

10. Report

10.1 Report the following information:

10.1.1 The mesh size of screens used for the test,

10.1.2 The initial (P_i), extrusion ($P_{minutes}$) and final (P_f) filter pressures or the rate of pressure rise if unable to obtain a stabilized pressure (see 9.11),

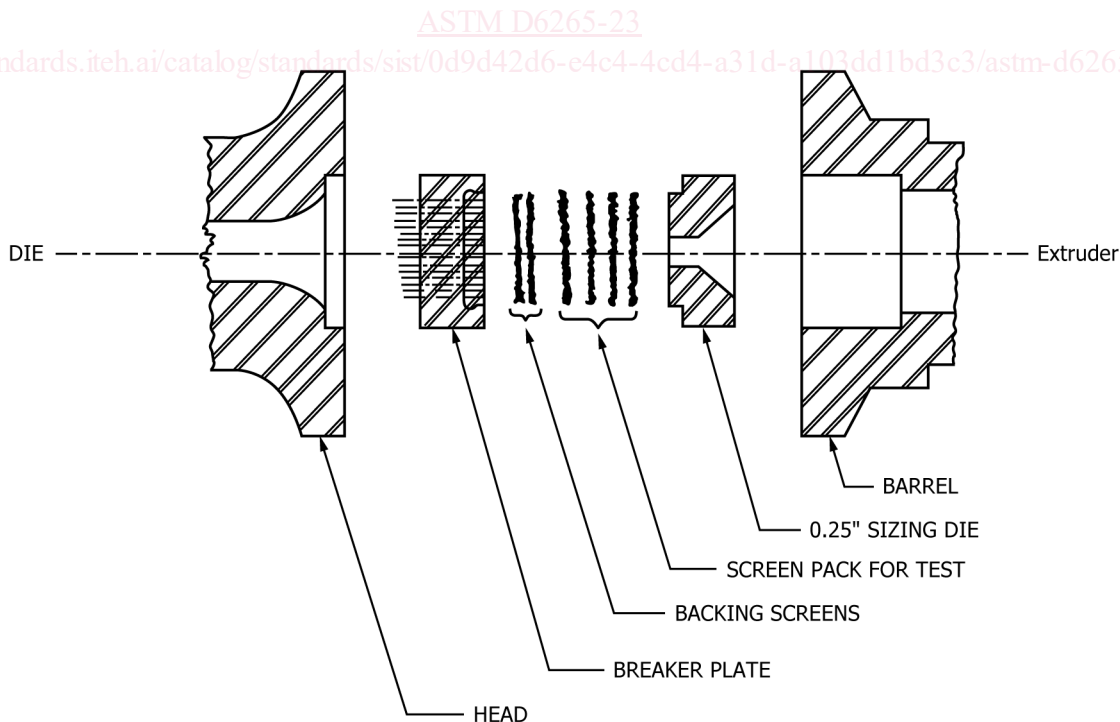

NOTE 1—Split clamp not to scale.

FIG. 3 Schematic of the Screen Pack Assembly