

Designation: D 4821 – 03

# Standard Guide for Carbon Black—Validation of Test Method Precision and Bias<sup>1</sup>

This standard is issued under the fixed designation D 4821; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon ( $\epsilon$ ) indicates an editorial change since the last revision or reapproval.

# 1. Scope

1.1 This guide covers a procedure for using ASTM Standard Reference Blacks<sup>2</sup> (SRBs) to continuously monitor the precision of those carbon black test methods for which standard values have been established. It also offers guidelines for troubleshooting various test methods.

1.2 This guide establishes the x-chart control limits to be used when continuously monitoring those tests listed in Section 2. Alternatively, these control limits may be used as a basis for comparison to testing precision computed within a laboratory.

1.3 This guide uses statistical control chart methodology as discussed in STP-15- $D^3$  to determine if a laboratory's test results differ significantly from the accepted values of the SRBs.

1.4 This guide provides a statistical procedure for improving test reproducibility when a laboratory cannot physically calibrate its apparatus to obtain the standard values of the ASTM SRBs, within the ranges given in the precision statement of the test method.

1.5 The values stated in SI units are to be regarded as the standard. The values given in parentheses are for information only. https://standards.iteh.ai/catalog/standards/sist/c912

1.6 This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.

#### 2. Referenced Documents

2.1 ASTM Standards:

D 1510 Test Method for Carbon Black—Iodine Adsorption Number<sup>4</sup>

- D 1765 Classification System for Carbon Blacks Used in Rubber Products<sup>4</sup>
- D 2414 Test Method for Carbon Black—Oil Absorption Number<sup>4</sup>
- D 3265 Test Method for Carbon Black—Tint Strength<sup>4</sup>
- D 3493 Test Method for Carbon Black—Oil Absorption Number of Compressed Sample<sup>4</sup>
- D 6556 Test Methods for Carbon Black—Total and External Surface Area by Nitrogen Adsorption<sup>4</sup>

#### 3. Significance and Use

3.1 One of the major causes of poor test precision is the lack of calibration or standardization of instruments, apparatus, reagents, and technique among laboratories. The sum of all sources of testing error is unique for an individual laboratory. A least-squares regression of a laboratory's actual test values for reference materials to the established mean values will result in a unique least-squares regression line (and equation) for that laboratory. Generally, there are two reasons for using the SRBs in testing: (1) to monitor testing performance (see Section 4) to ensure that no systematic error or bias is affecting the test results, or (2) to establish a statistical calibration (see Section 5) when the correction of assignable causes (see Section 6) does not yield in-control test results.

3.2 In addition to the calibration of a test method by physicochemical means, a statistical method for achieving calibration of a test method is presented.

3.3 This guide outlines the use of control charts to graphically present calibration test data determined for the ASTM SRBs for those test methods given in Section 2. All laboratories are encouraged to utilize statistical control charts and the SRBs because this allows a comparison of testing precision within a laboratory to the "industry average" values found in Table 1.

3.4 The techniques of this guide can be used to continuously monitor testing execution and precision for other tests that are not listed in Section 2 or for materials that fall outside the range of the SRBs for those tests listed in Section 2. In these cases, each laboratory will have to establish the applicable mean and control limit values for the "local reference." The monitoring will then consist of a comparison of present test results for the

Copyright © ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States.

<sup>&</sup>lt;sup>1</sup> This guide is under the jurisdiction of ASTM Committee D24 on Carbon Black and is the direct responsibility of Subcommittee D24.61 on Carbon Black Sampling and Statistical Analysis.

Current edition approved Jan. 10, 2003. Published February 2003. Originally approved in 1988. Last previous edition approved in 2001 D 4821 - 01a.

<sup>&</sup>lt;sup>2</sup> Standard Reference Blacks are available from Laboratory Standards & Technologies, Inc., 227 Somerset St., Borger, TX 79007. Phone/fax: (806) 273-3006. E-mail: jwbal@infinitytx.net.

<sup>&</sup>lt;sup>3</sup> Symposium on Manual on Presentation of Data and Control Chart Analysis, ASTM STP 15D, ASTM, 1976.

<sup>&</sup>lt;sup>4</sup> Annual Book of ASTM Standards, Vol 09.01.

# NOTICE: This standard has either been superceded and replaced by a new version or discontinued. Contact ASTM International (www.astm.org) for the latest information.

∰ D 4821 – 03

TABLE 1 SRB 6 Control Chart Limits						
Test Property	ASTM Standard	SRB	Target Value	3 s Value	Lower Control Limit	Upper Control Limit
lodine	D 1510	A 6 (N134)	137.2	3.00	134.20	140.20
adsorption		B 6 (N220)	117.9	2.28	115.62	120.18
number, <sup>A</sup>		C 6 (N326)	82.4	1.08	81.32	83.48
g/kg		D 6 (N762)	26.5	1.26	25.24	27.76
		E 6 (N660)	35.3	1.62	33.68	36.92
		F 6 (N683)	33.1	1.44	31.66	34.54
Oil absorption	D 2414 <sup>B</sup>	A 6 (N134)	123.7	1.83	121.87	125.53
number,		B 6 (N220)	114.3	1.11	113.19	115.41
10 <sup>-5</sup> m <sup>3</sup> /kg		C 6 (N326)	70.3	1.05	69.25	71.35
(cm <sup>3</sup> /100 g		D 6 (N762)	67.4	1.50	65.90	68.90
Ϋ́Ο, Ϋ́O,		E 6 (N660)	88.2	1.80	86.40	90.00
		F 6 (N683)	133.6	3.33	130.27	136.93
		G 5 (N990)	36.2	0.75	35.45	36.95
Oil absorption	D 3493 <sup><i>B</i></sup>	A 6 (N134)	101.0	2.46	98.54	103.46
number of		B 6 (N220)	98.5	1.80	96.70	100.30
compressed		C 6 (N326)	68.1	1.59	66.51	69.69
sample (24M4),		D 6 (N762)	60.2	1.59	58.61	61.79
10 <sup>-5</sup> m <sup>3</sup> /kg		E 6 (N660)	76.0	2.49	73.51	78.49
(cm <sup>3</sup> /100 g)		F 6 (N683)	88.6	2.58	86.02	91.18
Surface area	D 4820 <sup>C</sup>	A 6 (N134)	143.9	2.10	141.80	146.00
by multipoint		B 6 (N220)	110.0	1.59	108.41	111.59
B.E.T. nitrogen		C 6 (N326)	78.3	1.20	77.10	79.50
adsorption		D 6 (N762)	30.6	0.75	29.85	31.35
(NSA),		E 6 (N660)	36.0	1.20	34.80	37.20
$10^3 \text{ m}^2/\text{kg}$		F 6 (N683)	35.3	1.41	33.89	36.71
(m²/g)		G 5 (N990)	9.1	0.36	8.74	9.46
Tint Strength	D 3265	A 6 (N134)	129.8	4.11	125.69	133.91
	2 0200	B 6 (N220)	117.8	3.36	114.44	121.16
		C 6 (N326)	113.1	1.68	111.42	114.78
		D 6 (N762)	56.8	2.01	54.79	58.81
		E 6 (N660)	60.0	1.92	58.08	61.92
		F 6 (N683)	51.7	1.47	50.23	53.17
External surface	D 5816 <sup>C</sup>	A 6 (N134)	135.7	Pre <sub>4.11</sub> lev	131.59	139.81
area by	0.0010	B 6 (N220)	105.4	2.88	102.52	108.28
multipoint		C 6 (N326)	79.2	2.00	77.13	81.27
nitrogen		D 6 (N762)	29.6	1.35	28.25	30.95
adsorption		E 6 (N660)	AS 35.1 D482	1-03 2.31	32.79	37.41
(STSA),		F 6 (N683)	35.1	1.837	32.79	35.93
10 <sup>3</sup> m <sup>2</sup> /kg (m <sup>2</sup> /g)	andards.1teh.a1/ca	G 5 (N990)	s/sist/c918.4acc2-d	973-4 <sup>1.05</sup> /-bac	c0-67c7	/astm-9.0021-03

<sup>A</sup> The iodine adsorption number of carbon black has been shown to decrease in value as the black ages. Generally, the higher the surface area the faster the rate of change. Therefore, the target values given in this table may not be obtained due to this aging effect. The most current standard value may be obtained by contacting the chairman of Subcommittee D24.61.

<sup>B</sup> Values determined using *n*-Dibutyl Phthalate (DBP) oil.

<sup>C</sup> NSA values determined using Test Methods D 4820. STSA values determined using Test Methods D 5816. Both test methods have been replaced by Test Methods D 6556, which is technically equivalent to the test methods used to determine the values.

"local reference" to past performance within that laboratory instead of to "industry average" values.

### 4. Procedure for Continuously Monitoring Testing


4.1 For each test of interest, test each SRB listed for that test in Table 1 in duplicate. Use the mean value for each SRB to establish the baseline values. A new baseline should be determined whenever the test equipment or conditions change. If a "local reference" is going to be used for test monitoring, it should be tested at the same time and included in the baseline data.

4.2 Select one (or more) SRBs from the SRB 4, SRB 5, or SRB 6 series (see Note 1) or a "local reference" to cover the range of interest. Because of the differing grades in each SRB set and material ages, do not mix materials from different SRB sets. For example, do not use A, B, and C from set 4 with D, E, and F from set 5. This is especially critical for Oil absorptometer calibration. An absorptometer calibrated with F5 (or F5A) must be checked with other members of the 5 set. Likewise, an absorptometer calibrated with F6 must be checked with other members of the 6 set.

NOTE 1—The SRB 4 set is depleted and not commercially available. Some members of the SRB 5 set are depleted and not commercially available. SRB F5A and G5 are commercially available. SRB G5 is used as a member of the SRB 6 set. The SRB 4 and SRB 5 sets may still be in use in some laboratories. Because of the known effects of material aging, it is recommended that the most current set of SRBs be used for test monitoring.

4.3 Prepare a control chart for each of the selected SRBs or "local reference" material(s) for each test method as presented by Part 3 of ASTM STP 15D. It is an accepted practice to control chart one reference material on each day of testing and rotate through each selected reference material on successive days of testing.

### NOTICE: This standard has either been superceded and replaced by a new version or discontinued. Contact ASTM International (www.astm.org) for the latest information.

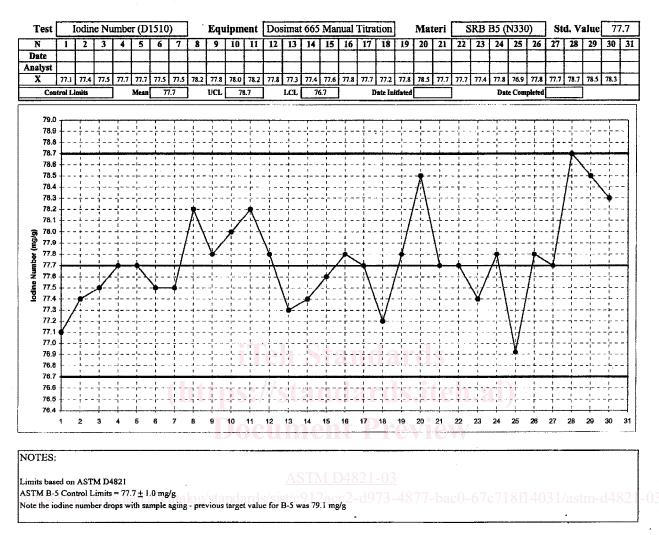

# CARBON BLACK-IODINE ADSORPTION NUMBER X-CHART

FIG. 1 X-Chart Using Guide D 4821 Control Limits

4.4 The target values given in Table 1 for SRB6s were determined during the validation of the SRB 6 materials. Values are used as control chart limits (x-chart) plus or minus three single test repeatability standard deviations. Comparable data for the SRB4 or SRB5 sets may be obtained from ASTM Headquarters by requesting research report RR: D24-1043 for SRB4 or RR: D24-1042 for SRB5. The mean and control chart limits (three standard deviations) for use on the x-charts must be determined by each laboratory for any "local reference" material(s).

4.5 Plot the uncorrected values for the selected reference materials (see Note 2). If a control limit is exceeded, perform a retest immediately. If the retest falls outside the control limits, stop testing and begin a search for an assignable cause (see Section 6 for a list of possible assignable causes). Once the cause is corrected and the reference material's values are within the established control limits, testing can resume.

4.6 Examples of typical x-charts are found in Figs. 1 and 2. 4.7 If only one reference material is used to regularly monitor testing performance, additional reference materials must be tested periodically to ensure that no systematic error or bias is affecting the test results. Test one or more of the reference materials not routinely used and compare the test results to the original baseline values to ensure that the testing system is still stable. Deviation from the original baseline values indicates the possibility of systematic testing error. If instability is suspected, all the reference materials should be tested and the results compared to the original baseline values. On a longer time frame basis, all the reference materials should be tested and compared to the original baseline values to determine the long-term testing stability. Initiate corrective action as indicated (see Section 6). If stability cannot be demonstrated, it may be necessary to apply a statistical correction (see Section 5).