

---

---

**Metallic materials — Sheet and strip —  
Determination of forming-limit curves —**

Part 1:

**Measurement and application of forming-  
limit diagrams in the press shop**

**iTeh STANDARD PREVIEW**  
**(standards.iteh.ai)**

*Matériaux métalliques — Tôles et bandes — Détermination des courbes  
limites de formage —*

*Partie 1. Mesurage et application des diagrammes limites de formage  
dans les ateliers d'emboutissage*

ISO 12004-1:2008

<https://standards.iteh.ai/catalog/standards/sist/cb1f7fa4-c75e-42b2-aa1e-816cfff07064/iso-12004-1-2008>



**PDF disclaimer**

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

**iTeh STANDARD PREVIEW**  
**(standards.iteh.ai)**

ISO 12004-1:2008

<https://standards.iteh.ai/catalog/standards/sist/cb1f7fa4-c75e-42b2-aa1e-816cfff07064/iso-12004-1-2008>



**COPYRIGHT PROTECTED DOCUMENT**

© ISO 2008

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office  
Case postale 56 • CH-1211 Geneva 20  
Tel. + 41 22 749 01 11  
Fax + 41 22 749 09 47  
E-mail [copyright@iso.org](mailto:copyright@iso.org)  
Web [www.iso.org](http://www.iso.org)

Published in Switzerland

**Contents**

Page

<b>Foreword</b> .....	<b>iv</b>
<b>Introduction</b> .....	<b>v</b>
<b>1 Scope</b> .....	<b>1</b>
<b>2 Symbols and abbreviated terms</b> .....	<b>1</b>
<b>3 Principle</b> .....	<b>1</b>
<b>4 Test conditions</b> .....	<b>2</b>
<b>5 Procedure</b> .....	<b>2</b>
<b>6 Interpretation of results</b> .....	<b>3</b>
<b>7 Test report</b> .....	<b>3</b>
<b>Annex A (informative) Modification to forming-limit curves</b> .....	<b>5</b>
<b>Annex B (informative) Examples of grid patterns currently in use</b> .....	<b>6</b>
<b>Bibliography</b> .....	<b>8</b>

**iTeh STANDARD PREVIEW**  
**(standards.iteh.ai)**

[ISO 12004-1:2008](https://standards.iteh.ai/catalog/standards/sist/cb1f7fa4-c75e-42b2-aa1e-816cfff07064/iso-12004-1-2008)

<https://standards.iteh.ai/catalog/standards/sist/cb1f7fa4-c75e-42b2-aa1e-816cfff07064/iso-12004-1-2008>

## Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 12004-4 was prepared by Technical Committee ISO/TC 164, *Mechanical testing of metals*, Subcommittee SC 2, *Ductility testing*.

This first edition of ISO 12004-1, together with ISO 12004-2, cancels and replaces ISO 12004:1997 which has been technically revised.

ISO 12004 consists of the following parts, under the general title *Metallic materials — Sheet and strip — Determination of forming-limit curves*:

- Part 1: *Measurement and application of forming-limit diagrams in the press shop*
- Part 2: *Determination of forming-limit curves in the laboratory*

iTeh STANDARD PREVIEW  
(standards.iteh.ai)

<https://standards.iteh.ai/catalog/standards/sist/cb1f7fa4-c75e-42b2-aa1e-816c#07064/iso-12004-1-2008>

## Introduction

A forming-limit diagram (FLD) is a diagram containing measured major/minor strain points on a formed part.

An FLD can distinguish between safe and necked, or failed, points. The transition from safe to failed points is defined by the forming-limit curve (FLC).

To determine the forming limit of materials, two different methods are possible.

- 1) Strain analysis of failed press shop components to determine component and process dependent FLCs:

In the press shop, strain paths to reach these points are generally not known. Such an FLC depends on the material, the component and the chosen forming conditions. This method is described in this part of ISO 12004.

- 2) Determination of FLCs under well-defined laboratory conditions:

For evaluating formability, one unique FLC for the defined material is necessary. The determination of FLC has to be specific and it is necessary to use different linear strain paths. This method should be used for material characterization as described in ISO 12004-2.

ITIH STANDARD PREVIEW  
(standards.iteh.ai)

[ISO 12004-1:2008](https://standards.iteh.ai/catalog/standards/sist/cb1f7fa4-c75e-42b2-aa1e-816cfff07064/iso-12004-1-2008)

<https://standards.iteh.ai/catalog/standards/sist/cb1f7fa4-c75e-42b2-aa1e-816cfff07064/iso-12004-1-2008>

**iTeh STANDARD PREVIEW**  
**(standards.iteh.ai)**

ISO 12004-1:2008

<https://standards.iteh.ai/catalog/standards/sist/cb1f7fa4-c75e-42b2-aa1e-816cff07064/iso-12004-1-2008>

# Metallic materials — Sheet and strip — Determination of forming-limit curves —

## Part 1: Measurement and application of forming-limit diagrams in the press shop

### 1 Scope

This part of ISO 12004 provides guidelines for developing forming-limit diagrams and forming-limit curves for metal sheets and strips of thicknesses from 0,3 mm to 4 mm.

### 2 Symbols and abbreviated terms

The symbols used in forming-limit diagrams are specified in Table 1, and examples of grid patterns used are given in Annex B.

(standards.iteh.ai)

Table 1 — Symbols and definitions


Symbol	Definition	Unit
$t_0$	Thickness of test piece	mm
$l_0$	Original gauge length of grid pattern	mm
$l_1$	Final length in major strain direction	mm
$l_2$	Final length at 90° to major strain direction	mm
$e$	Engineering strain	%
$e_1$	Major engineering strain	%
$e_2$	Minor engineering strain (90° to major)	%
FLD	Forming-limit diagram	—
FLC	Forming-limit curve	—

### 3 Principle

A pattern of precise gauge lengths of appropriate size is applied to the flat surface of a metal sheet test piece, then the test piece is formed until fracture, and the percent change in the gauge length in the major direction and in the minor strain direction at 90° to this is measured in order to determine the forming-limit under the imposed strain conditions. A number of repeated tests under varying strain conditions are carried out to provide data for the forming-limit curve (FLC) for the material when these limiting strains are plotted on the forming-limit diagram (FLD) (see Figure 1).

#### 4 Test conditions

- 4.1 Gauge lengths in the range of 1,5 mm to 5,0 mm are recommended. The actual gauge lengths shall be known to within  $\pm 2\%$ .
- 4.2 During the forming of test pieces, the strain in the critical area shall be uniform before onset of necking.
- 4.3 In order to achieve this, any set of tooling employing a holding force and a deformation force may be used to develop the limiting strain condition.
- 4.4 The forming-limit curve shall be plotted on the forming-limit diagram. Figure 1 shows an example of a forming-limit curve.

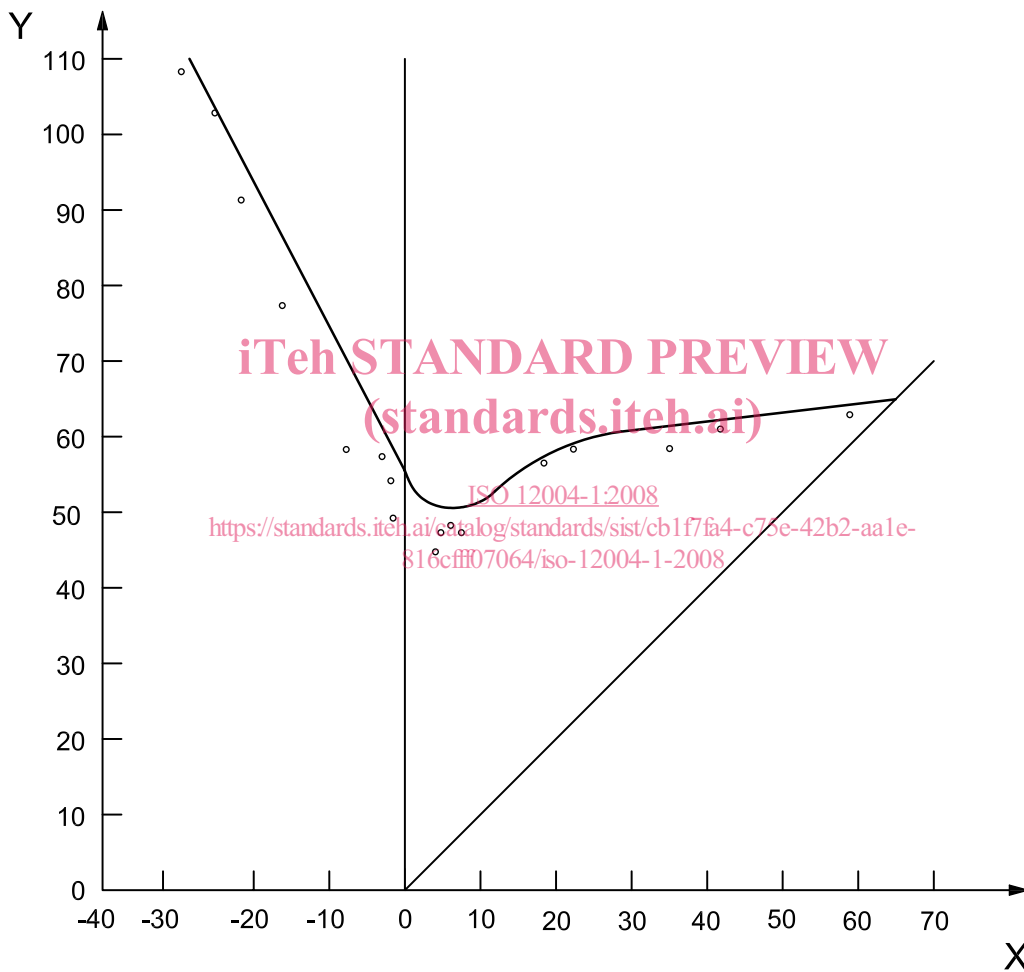

**Key**  
 X minor strain, in percent  
 Y major strain, in percent

Figure 1 — Typical forming-limit curve

#### 5 Procedure

- 5.1 The recommended procedure for the determination of the forming limit is as follows.
  - 5.1.1 Take a representative sample of the material to be evaluated.



**5.1.2** Apply a suitable grid pattern, that has been checked for accuracy of the initial gauge lengths, to the surface of a test piece in areas of the part to be formed which are known, or have been established by investigation, to be critical.

**5.1.3** Any test device that satisfies Clause 4 may be used to form the test piece, such as a universal tensile testing machine, a stamping press, a cupping press, a hydraulic bulge machine and their combinations or any other equipment capable of clamping the test piece and applying a plastic deformation force in an area remote from the edge. A universal testing machine may be employed and forming limits established using a tensile test.

**5.1.4** Test pieces shall be tested while clamped around the whole of their periphery, or shall be cut into strips of varying widths to give a range of strain conditions. The surface between the punch and the specimen shall be suitably lubricated using a standard product for the operation. A combination of polyethylene sheet and lubricant can be used.

**5.1.5** Stop the test at the first occurrence of fracture.

**5.1.6** Determine the strains  $e_1$  and  $e_2$  as follows.

**5.1.7** Measure three adjacent gauge lengths in the direction of  $e_1$  that were originally in a straight line. Repeat until the three values obtained are the same to within  $\pm 10\%$ . Record the average of these three values as  $l_1$ .

NOTE A more accurate method may be prescribed as mentioned in ISO 12004-2.

**5.1.8** If it is not possible to obtain three values within  $\pm 10\%$ , form a new test piece and repeat the measurements.

**5.1.9** Select one of the gauge lengths measured in 5.1.7 and measure the gauge length at  $90^\circ$  to the original  $e_1$  direction, and report this as  $l_2$ .

**5.2** Calculate the percent strains  $e_1$  and  $e_2$  as follows:

$$e_1 = \frac{l_1 - l_0}{l_0} \times 100 \quad (1)$$

$$e_2 = \frac{l_2 - l_0}{l_0} \times 100 \quad (2)$$

**5.3** Make measurements on a sufficient number of test pieces to plot a forming-limit curve.

## 6 Interpretation of results

**6.1** Plot  $e_1$  against  $e_2$  on a forming-limit diagram. As shown in Figure 1, the major strain  $e_1$  is plotted along the Y-axis and the minor strain  $e_2$  is plotted along the X-axis.

**6.2** Draw the forming-limit curve through the points of maximum  $e_1$  strain (see Figure 1).

**6.3** The effect of a forming operation on a particular part may be estimated from the diagram by measuring the strains in critical areas and comparing the results with the curve for the material used.

## 7 Test report

**7.1** The test report shall include the following information:

a) a reference to this part of ISO 12004;