



Designation: B962 – 08

# Standard Test Methods for Density of Compacted or Sintered Powder Metallurgy (PM) Products Using Archimedes' Principle<sup>1</sup>

This standard is issued under the fixed designation B962; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon ( $\epsilon$ ) indicates an editorial change since the last revision or reapproval.

## 1. Scope

1.1 This standard describes a method for measuring the density of powder metallurgy products that usually have surface-connected porosity.

1.2 The density of impermeable PM materials, those materials that do not gain mass when immersed in water, may be determined using Test Method B311.

1.3 The current method is applicable to green compacts, sintered parts, and green and sintered test specimens.

1.4 With the exception of density values, for which the  $\text{g}/\text{cm}^3$  unit is the industry standard, the values stated in SI units are to be regarded as the standard. The values given in parentheses are converted in accordance with IEEE/ASTM SI 10 and are for information only.

1.5 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

## 2. Referenced Documents

2.1 *ASTM Standards:*<sup>2</sup>

B243 Terminology of Powder Metallurgy

B311 Test Method for Density of Powder Metallurgy (PM) Materials Containing Less Than Two Percent Porosity

2.2 *IEEE/ASTM Standard:*

SI 10 American National Standard for Use of the International System of Units (SI): The Modern Metric System

## 3. Terminology

3.1 Definitions of powder metallurgy (PM) terms can be found in Terminology B243. Additional descriptive material is

<sup>1</sup> These test methods are under the jurisdiction of ASTM Committee B09 on Metal Powders and Metal Powder Products and are the direct responsibility of Subcommittee B09.04 on Bearings.

Current edition approved Nov. 1, 2008. Published January 2009. DOI: 10.1520/B0962-08.

<sup>2</sup> For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

available in the Related Material section of Vol. 02.05 of the *Annual Book of ASTM Standards*.

3.2 *Definitions of Terms Specific to This Standard:*

3.2.1 *green density ( $D_g$ )*—the mass per unit volume of an unsintered PM part or test specimen.

3.2.2 *impregnated density ( $D_i$ )*—the mass per unit volume of a sintered PM part or test specimen, impregnated with oil.

3.2.3 *sintered density ( $D_s$ )*—the mass per unit volume of a sintered, non oil-impregnated PM part or test specimen.

## 4. Summary of Test Method

4.1 The test specimen is first weighed in air. It is then oil impregnated or some other treatment is used to seal the surface-connected porosity and the specimen is reweighed. The test specimen is then weighed when immersed in water and its density calculated based on Archimedes' principle.

## 5. Significance and Use

5.1 The volume of a complex shaped PM part cannot be measured accurately using micrometers or calipers. Since density is mass per unit volume, a precise method for measuring the volume is needed. Archimedes' principle may be used to calculate the volume of water displaced by an immersed object. For this to be applicable to PM materials that contain surface connected porosity, the surface pores are sealed by oil impregnation or some other means.

5.2 The green density of compacted parts or test pieces is normally determined to assist during press set-up, or for quality control purposes. It is also used for determining the compressibility of base powders, mixed powders, and premixes.

5.3 The sintered density of sintered PM parts and sintered PM test specimens is used as a quality control measure.

5.4 The impregnated density of sintered bearings is normally measured for quality control purposes as bearings are generally supplied and used oil-impregnated.

## 6. Interferences

6.1 A gain in mass when a test specimen is immersed in water is an indication that the specimen contains surface-connected porosity. Unsealed surface porosity will absorb water and cause the calculated density values to be higher than the true value.

6.2 Test specimens that contain surface-connected porosity shall be oil impregnated or have the surface-connected porosity sealed by some other means prior to their immersion in water.

## 7. Apparatus

7.1 *Analytical Balance*—Precision single-pan balance that will permit readings within 0.01 % of the test specimen mass. See [Table 1](#).

7.2 *Water Container*—A glass beaker or other suitable transparent container should be used to contain the water.

NOTE 1—A transparent container makes it easier to see air bubbles adhering to the test specimen and specimen support when immersed in water.

NOTE 2—For the most precise density determination, the water container should be of a size that the level of the water does not rise more than 2.5 mm (0.10 in.) when the test specimen is lowered into the water.

7.3 *Water*—Distilled or deionized water to which 0.05 to 0.1 volume percent of a wetting agent has been added to reduce the effects of surface tension.

NOTE 3—Degassing the water by evacuation, boiling, or ultrasonic agitation helps to prevent air bubbles from collecting on the test specimen and support when immersed in water.

7.4 *Test Specimen Support for Weighing in Water*—Two typical arrangements are shown in [Fig. 1](#). The suspension wire may be twisted around the test specimen or the test specimen may be supported in a wire basket that is attached to the suspension wire. For either arrangement, a single corrosion-resistant wire—for example, austenitic stainless steel, copper, or nichrome—shall be used for the basket and suspension wire. The maximum recommended diameter of suspension wire to be used for various mass ranges is summarized in [Table 2](#).

NOTE 4—For the most precise density determinations, it is important that the mass and volume of all supporting wires immersed in water be minimized.

7.5 *Oil for Oil-Impregnation*—Oil with a viscosity of  $20 \times 10^{-6}$  to  $65 \times 10^{-6}$  m<sup>2</sup>/s (20 to 65 cSt or 100 to 300 SSU) at 38 °C (100 °F) has been found to be suitable.

7.5.1 In the case of oil-impregnated bearings, make an effort to match the oil that was originally used to impregnate them.

7.6 *Vacuum Impregnation Apparatus*—Equipment to impregnate the part or test specimen with oil.

7.7 *Thermometer*—A thermometer with an accuracy of 0.5 °C (1.0 °F) to measure the temperature of the water.

## 8. Preparation of Test Specimens

8.1 The mass of the test specimen shall be a minimum of 1.0 g. For small parts, several parts may be combined to reach the minimum mass.

8.2 Thoroughly clean all surfaces of the test specimen to remove any adhering foreign materials such as dirt or oxide

scale. Take care with cut specimens to avoid rough surfaces to which an air bubble may adhere. A 100-grit sanding or abrasive grinding is recommended to remove all rough surfaces.

## 9. Procedure

9.1 The part or test specimen, the analytical balance and surrounding air shall be at a uniform temperature when weighing is performed.

9.2 For the most precise density determinations, duplicate weighings should be made for all mass measurements. Adjust the analytical balance to zero prior to each weighing. Average the mass determinations before calculating the density.

9.3 For improved repeatability and reproducibility, verify the analytical balance periodically with a standard mass that is approximately equal to the part or test specimen mass.

9.4 This standard contains three separate test methods; determination of green density, determination of sintered density, and determination of impregnated density. Each is detailed in the following sections.

### Determination of Green Density

9.5 This procedure is used to determine the green density of PM parts and test specimens.

9.5.1 Determine the mass of the green part or test specimen. This is mass A. This and all subsequent weighings shall be to the precision stated in [Table 1](#).

9.5.2 Oil impregnate the green part or test specimen as follows:

#### Preferred Procedure

9.5.3 Immerse the part or test specimen in oil at room temperature.

9.5.4 Reduce the pressure over the sample to 7 kPa (1 psi) or less for 30 minutes, then increase the pressure back to atmospheric pressure and keep the sample immersed for at least 30 minutes.

9.5.5 Remove excess oil by wiping gently with an absorbent, lint-free material. Take care not to extract oil absorbed within the part or test specimen.

9.5.6 Do not place or store parts on porous surfaces such as paper, cloth, or cardboard as these will absorb oil.

9.5.7 Proceed to [9.5.13](#).

#### Alternative Procedure

9.5.8 Immerse the part or test specimen in oil at a temperature of  $82 \pm 5$  °C ( $180 \pm 10$  °F) for at least 4 hours.

9.5.9 Cool by immersing in a bath of the same oil held at room temperature and keep in this oil for at least 30 minutes.

9.5.10 Remove excess oil by wiping gently with an absorbent, lint-free material. Take care not to extract oil absorbed within the part or test specimen.

9.5.11 Do not place or store parts on porous surfaces such as paper, cloth, or cardboard as these will absorb oil.

9.5.12 Proceed to [9.5.13](#).

NOTE 5—It may not be necessary to oil impregnate the green part with oil. There may be enough admixed lubricant present in the surface-connected pores to prevent the absorption of water. If the test specimen gains mass when immersed in water it is an indication that the specimen

**TABLE 1 Balance Sensitivity**

Mass, g	Balance Sensitivity, g
less than 10	0.0001
10 to less than 100	0.001
100 to less than 1000	0.01
1000 to less than 10 000	0.1

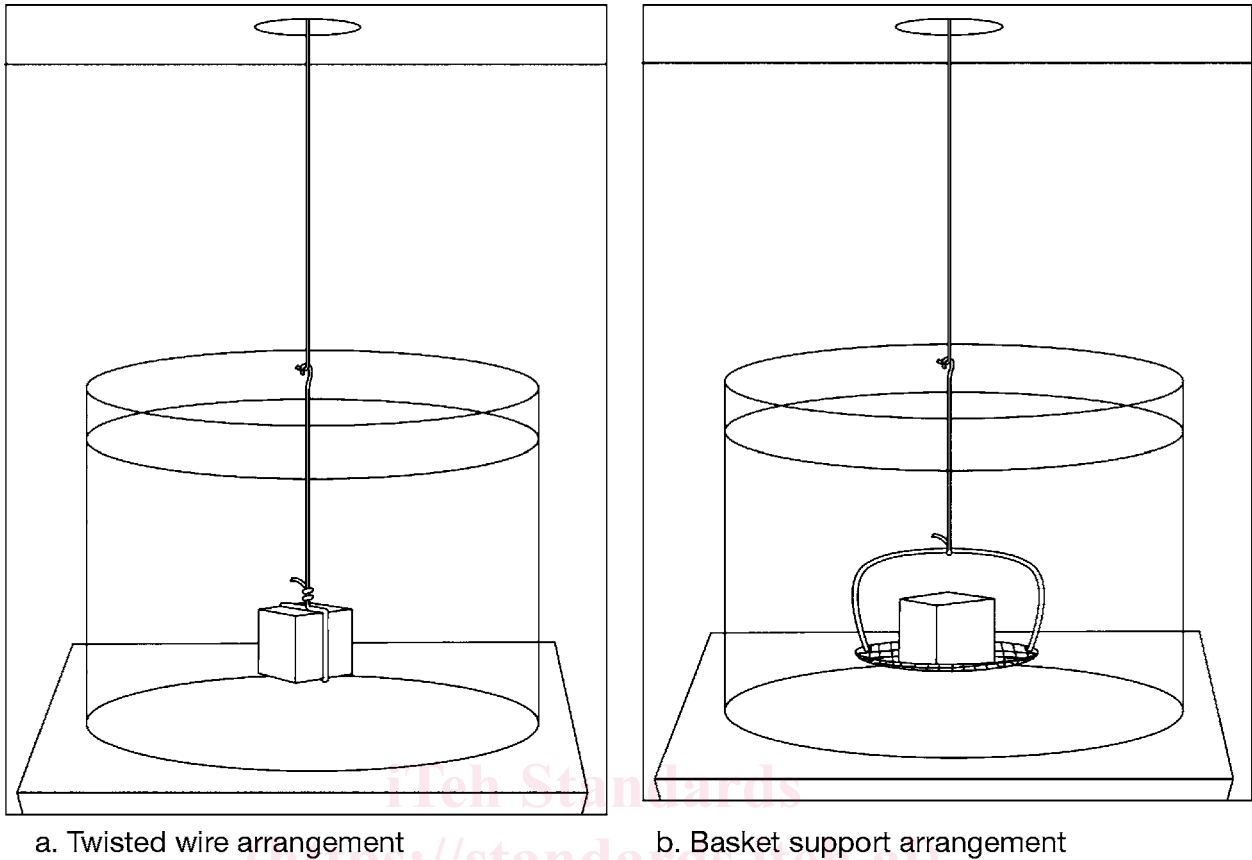


FIG. 1 Methods for Holding the Test Specimen When Weighing in Water

TABLE 2 Maximum Recommended Wire Diameters

Mass, g	Wire Diameter, mm (in.)
less than 50	0.12 (0.005)
50 to less than 200	0.25 (0.010)
200 to less than 600	0.40 (0.015)
600 and greater	0.50 (0.020)

contains surface-connected porosity and that it needs to be sealed by oil impregnation or some other means.

9.5.13 Determine the mass of the oil-impregnated green part or test specimen to the precision stated in Table 1. This is mass B.

9.5.14 Support the container of water over the pan of the balance using a suitable bridge as shown in Fig. 2a. Take care to ensure that the bridge does not restrict the free movement of the balance pan. The container of water may also be supported below the balance for weighing larger specimens if the balance has a lower beam hook for this purpose. See Fig. 2b. If this arrangement is used, it is important to shield the weighing system, including the wire, from the effect of air drafts.

9.5.15 Suspend the test specimen support along with the part or test specimen from the beam hook of the balance. The water should cover any wire twists and the specimen support basket by at least 6 mm (1/4 in.) to minimize the effect of surface tension forces on the weighing.

9.5.16 The test specimen support and test specimen shall hang freely from the balance beam hook, be free of air bubbles when immersed in the water, and be at the same temperature as the water and the balance.

9.5.17 The surface of the water shall be free of dust particles.

9.5.18 Weigh the part/test specimen and specimen support immersed in water. This is mass C.

9.5.19 Remove the part/test specimen from the support.

9.5.20 Weigh the test specimen support immersed in water at the same depth as before. This is mass E. The suspension support shall be free of air bubbles and the suspension wire shall not be immersed below its normal hanging depth, as a change in depth will change the measured mass.

NOTE 6—Some balances are capable of being tared. This automatically removes the necessity of reweighing the specimen support every time. In this case, tare the specimen support alone, immersed in water to the same depth as with the specimen, before weighing the specimen support and part/test specimen immersed in water. The mass of the specimen support and specimen immersed in water is mass F, which replaces mass C minus mass E.

9.5.21 Measure the temperature of the water to the nearest 1 °C (2 °F) and record its density  $\rho_w$ , at that temperature, from Table 3.

9.5.22 Calculate the green density of a part or test piece from the following formula: