

Designation: E 1750 - 09

Standard Guide for Use of Water Triple Point Cells¹

This standard is issued under the fixed designation E 1750; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ε) indicates an editorial change since the last revision or reapproval.

INTRODUCTION

The triple point of water is an important thermometric fixed point common to the definition of two temperature scales of science and technology, the Kelvin Thermodynamic Temperature Scale (KTTS) and the International Temperature Scale of 1990 (ITS-90). The ITS-90 was designed to be as close to the KTTS as the experimental data available at the time of the adoption of the ITS-90 would permit. The temperatures (T) on the KTTS are defined by assigning the value 273.16 K to the triple point of water, thus defining the thermodynamic unit of temperature, kelvin (K), as 1/273.16 of the thermodynamic temperature of the triple point of water (1, 2). The triple point of water, one of the fixed points used to define the ITS-90, is the temperature to which the resistance ratios W(T) = R(T)/R(273.16 K) of the standard platinum resistance thermometer (SPRT) calibrations are referred.

The triple points of various materials (where three distinct phases, for example, their solid, liquid, and vapor phases, coexist in a state of thermal equilibrium) have fixed pressures and temperatures and are highly reproducible. Of the ITS-90 fixed points, six are triple points. The water triple point is one of the most accurately realizable of the defining fixed points of the ITS-90; under the best of conditions, it can be realized with an expanded uncertainty (k=2) of less than ± 0.00005 K. In comparison, it is difficult to prepare and use an ice bath with an expanded uncertainty (k=2) of less than ± 0.002 K (3).

The triple points of various materials (where three distinct phases, for example, their solid, liquid, and vapor phases, coexist in a state of thermal equilibrium) have fixed pressures and temperatures and are highly reproducible. Of the ITS-90 fixed points, six are triple points. The water triple point is one of the most accurately realizable of the defining fixed points of the ITS-90; under the best of conditions, it can be realized with an expanded uncertainty (k=2) of less than ± 0.00005 K. In comparison, it is difficult to prepare and use an ice bath with an expanded uncertainty (k=2) of less than ± 0.002 K (3).

1. Scope


- 1.1 This guide covers the nature of two commercial water triple-point cells (types A and B, see Fig. 1) and provides a method for preparing the cell to realize the water triple-point and calibrate thermometers. Tests for assuring the integrity of a qualified cell and of cells yet to be qualified are given. Precautions for handling the cell to avoid breakage are also described.
 - 1.2 The effect of hydrostatic pressure on the temperature of a water triple-point cell is discussed.
- 1.3 Procedures for adjusting the observed SPRT resistance readings for the effects of self-heating and hydrostatic pressure are described in Appendix X1 and Appendix X2.
- 1.4 This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.

¹ This guide is under the jurisdiction of ASTM Committee E20 on Temperature Measurement and is the direct responsibility of Subcommittee E20.07 on Fundamentals in Thermometry.

Current edition approved May 10, 2002. Published June 2002. Originally published as E1750-95.

Current edition approved May 1, 2009. Published June 2009. Originally approved in 1995. Last previous edition approved in 2002 as E 1750 - 02.

² The boldface numbers in parentheses refer to the list of references at the end of this standard.




2. Referenced Documents

- 2.1 ASTM Standards:³
- E 344 Terminology Relating to Thermometry and Hydrometry
- E 1594 Guide for Expression of Temperature

3. Terminology

- 3.1 Definitions—The definitions given in Terminology E 344 apply to terms used in this guide.
- 3.2 Definitions of Terms Specific to This Standard:

³ For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For Annual Book of ASTM Standards - Vol 14.03; volume information, refer to the standard's Document Summary page on the ASTM website.

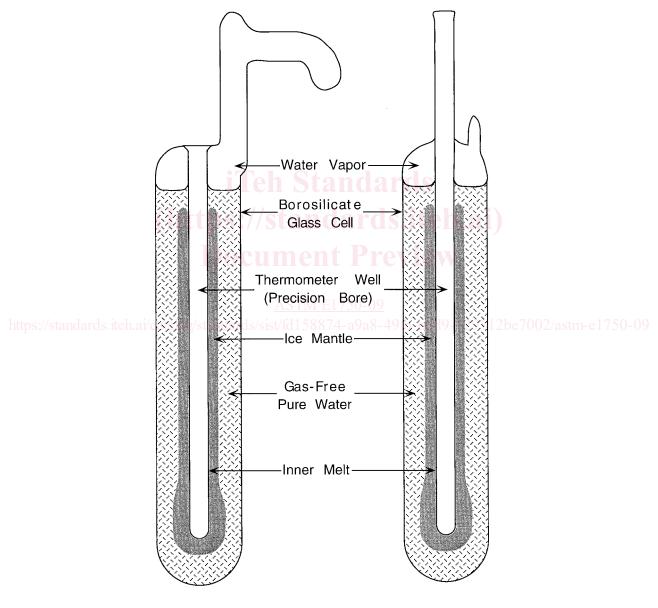

Type A Type B

FIG. 1 Configurations of two commonly used triple point of water cells, Type A and Type B, with ice mantle prepared for measurement at the ice/water equilibrium temperature. The cells are used immersed in an ice bath or water bath controlled close to 0.01°C (see 5.4)

- 3.2.1 *inner melt*, *n*—a thin continuous layer of water between the thermometer well and the ice mantle of a water triple-point cell.
- 3.2.2 *reference temperature*, *n*—the temperature of a phase equilibrium state of a pure substance at a specified pressure, for example, the assigned temperature of a fixed point.
- 3.2.2.1 *Discussion*—at—At an equilibrium state of three phases of a substance, that is, at the triple point, both the temperature and pressure are fixed.

4. Significance and Use

- 4.1 This guide describes a procedure for placing a water triple-point cell in service and for using it as a reference temperature in thermometer calibration.
- 4.2 The reference temperature attained is that of a fundamental state of pure water, the equilibrium between coexisting solid, liquid, and vapor phases.
- 4.3 The cell is subject to qualification but not to calibration. The cell may be qualified as capable of representing the fundamental state (see 4.2) by comparison with a bank of similar qualified cells of known history, and it may be so qualified and the qualification documented by its manufacturer.
 - 4.4The temperature to be attributed to a qualified water triple-point cell is exactly 273.16 K on the ITS-90.
- 4.4 The temperature to be attributed to a qualified water triple-point cell is exactly 273.16 K on the ITS-90, unless corrected for isotopic composition (refer to Appendix X3).
- 4.5 Continued accuracy of a qualified cell depends upon sustained physical integrity. This may be verified by techniques described in Section 6.
- 4.6 The commercially available triple point of water cells described in this standard are capable of achieving an expanded uncertainty (k=2) of between ± 0.1 mK and ± 0.05 mK, depending upon the method of preparation. Specified measurement procedures shall be followed to achieve these levels of uncertainty.

5. Apparatus

- 5.1 The essential features of type A and type B water triple-point cells are shown in Fig. 1. A transparent glass flask free of soluble material is filled with pure, air-free water and then is permanently sealed, air-free, at the vapor pressure of the water. A reentrant well on the axis of the flask receives thermometers that are to be exposed to the reference temperature.
- 5.2 The water used as the reference medium shall be very pure and of known isotopic composition. Often it is distilled directly into the cell. The isotopic composition of cells filled with "rain water" is expected not to vary enough to cause more than 0.05 mK difference in their triple points. Extreme variations in isotopic composition, such as between ocean water and water from old polar ice, can affect the realized temperature by as much as 0.25 mK (7).
- 5.4 The temperature of the triple point of water realized in a cell is independent of the environment outside the cell; however, to reduce heat transfer and keep the ice mantle from melting quickly, it is necessary to minimize heat flow between the cell and its immediate environment. This may be done by immersing the cell in an ice bath that maintains the full length of the outer cell wall at or near the melting point of ice. Alternatively, commercial automatic maintenance baths, built specifically for this purpose, are available. In such baths, the triple point of water equilibrium of the cell, once established, can be maintained for many months of continual use. To avoid radiation heat transfer to the cell and to the thermometer, the outer surface of the maintenance bath is made opaque to radiation.

6. Assurance of Integrity

- 6.1 The temperature attained within a water triple-point cell is an intrinsic property of the solid and liquid phases of water under its own vapor pressure. If the water triple-point conditions are satisfied, the temperature attained within the cell is more reproducible than any measurements that can be made of it.
- 6.2 The accuracy of realization of the water triple-point temperature with a qualified cell depends on the physical integrity of the seal and of the walls of the glass cell and on their ability to exclude environmental air and contaminants.
 - 6.3 Initial and continued physical integrity is confirmed by the following procedures:
 - 6.3.1 *Test for the Presence of Air* :
 - 6.3.1.1 Remove all objects from the thermometer well.
- 6.3.1.2 The solubility and the pressure of air at 101 325 Pa lower the ice/water equilibrium temperature 0.01°C below the triple-point temperature. Since air is more soluble in water at lower temperatures, the test for air shall be done at room temperature. The test is less definitive when performed on a chilled cell. At room temperature, with the cell initially upright and the well opening upward, slowly invert the cell. As the axis of the cell passes through horizontal and as the water within the cell strikes the end of the cell, a sharp "glassy clink" sound should be heard. The distinctive sound results from the sudden collapse of water vapor and the "water hammer" striking the glass cell. The smaller the amount of air, the sharper the clink sound; a large amount of air cushions the water-hammer action and the sound is duller.
 - 6.3.1.3 With a type A cell, continue to tilt the cell to make a McLeod-gage type test until the vapor (water saturated air) bubble

is entirely captured in the space provided in the handle. The vapor bubble should be compressed to a volume no larger than about 0.03 cm³ (4 mm diameter). It may even vanish as it is compressed by the weight of the water column. As in the tilt test, the bubble test is more definitive when the cell is at room temperature (see 6.3.1.2). Since type B cells do not have a space to capture the vapor, the amount of air in the cell is estimated by comparing the sharpness of the clink sound with that of a type A cell.

- 6.3.2 Test for the Presence of Water Soluble Impurities:
- 6.3.2.1 When ice is slowly formed around the thermometer well, impurities are rejected into the remaining unfrozen water. Therefore, the impurity concentration of the unfrozen water increases as the ice mantle thickens. The ice is purer than the unfrozen water. Consequently, the inner melt (see section 7.1.3) that is formed from the ice mantle is purer than the unfrozen water outside of the mantle.
- 6.3.2.2 Prepare a relatively thick ice mantle, according to Section 7, by maintaining the dry ice level full for about 20 minutes. Make certain that the ice does not bridge to the cell wall (see 7.1.9).
- 6.3.2.3 Prepare an inner melt according to 7.1.13. Using an SPRT, make measurements on the cell and determine the zero-power resistance according to Section 8 and Appendix X1.
- 6.3.2.4 After 6.3.2.3, remove the SPRT. Gently invert the water triple-point cell and then return it to the upright position several times to exchange the unfrozen water on the outside of the ice mantle with the inner melt water. (Warning—When Warning—When inverting the cell, do not allow the floating ice mantle to severely strike the bottom of the water triple-point cell.)
- 6.3.2.5 Reinsert the pre-chilled SPRT used in 6.3.2.3 into the well. Make measurements on the cell and determine the zero-power resistance, according to Section 8 and Appendix X1.
- 6.3.2.6 Typically, for high quality water triple-point cells, the results of 6.3.2.3 and 6.3.2.5 will not differ by more than ± 0.03 mK
- 6.4 Any cell that had previously been qualified by comparison with cells of known integrity (as in 4.3), that has not thereafter been modified, and which currently passes the tests of 6.3.1 and 6.3.2, is qualified as a water triple-point cell.
- 6.5 Any cell that fails to pass the tests of 6.3.1 and 6.3.2, even though previously qualified, is no longer qualified for use as a water triple-point cell.

7. Realization of the Water Triple-Point Temperature

- 7.1 The ice mantle that is required to realize the triple-point temperature of water can be prepared in a number of ways. They produce essentially the same result. A common procedure is as follows:
 - 7.1.1 Empty the well of any solids or liquids. Wipe the well clean and dry, and seal the well opening with a rubber stopper.
- 7.1.2 If the triple point of water cell has not already been tested for the presence of air, perform the tests indicated in 6.3.1 for presence of air.
- 7.1.3 To obtain an ice mantle of fairly uniform thickness that extends to the top, immerse the cell completely in an ice bath, and chill the cell to near 0°C.
- 7.1.4 Remove the cell from the bath and mount it upright on a plastic foam cushion. Wipe the cell dry around the rubber stopper before removing the rubber stopper.
- 7.1.5 Remove the rubber stopper and place about 1 cm³ of dry alcohol in the well to serve as a heat-transfer medium while forming an ice mantle around the well within the sealed cell.
- 7.1.6 Place a small amount of crushed dry ice at the bottom of the well, maintaining the height of the dry ice at about 1 cm for a period of 2 to 3 min. In repeated use of the cell, the ice mantle melts mostly at the bottom; hence, it is desirable that the ice mantle be thicker at the bottom. Crushed dry ice may be prepared from a block or by expansion from a siphon-tube tank of liquid CO₂.
- 7.1.7 At the interface of the well, the water is initially supercooled, and the well becomes abruptly coated with fine needles of ice frozen from the supercooled water.
 - 7.1.8 After a layer of ice forms around the bottom of the well, fill the well with crushed dry ice up to the vapor/liquid interface.
- 7.1.9 Replenish the dry ice as it sublimes, maintaining the well filled to the liquid surface, until a continuous ice mantle as thick as desired forms on the surface of the well within the water (usually 4 to 8 mm thick). The mantle will appear thicker than its actual thickness because of the lenticular shape of the cell and the refractive index of water. The actual thickness may be best estimated by viewing from the bottom of the cell while it is inverted or by immersing the cell in a large glass container of water. (Warning—During Warning—During preparation, the mantle should never be allowed to grow at any place to completely bridge the space between the well and the inner wall of the cell, as the expansion of the ice may break the cell. In particular, if bridging occurs at the surface of the water at the top of the cell under the vapor space, melt the ice bridge by warming the cell locally with heat from the hand, while gently shaking the cell.)
- 7.1.10 When the mantle attains nearly the desired thickness or after maintaining the dry ice level in the well at the water surface for about 20 min, return the cell to the ice bath with the entrance to the thermometer well slightly above the ice bath surface and allow the dry ice to sublime completely. By allowing the dry ice to sublime completely, the bottom of the well stays cold longer and the mantle grows thicker there.
- 7.1.11 After the thermometer well becomes free of dry ice, immerse the cell deeper into the ice bath and fill the well with ice bath water.
- 7.1.12 Allow the cell to remain packed in ice or in the ice bath for two days to stabilize its temperature. Because of the strains in the ice mantle prepared using dry ice, a freshly prepared mantle can give a temperature that is as much as 0.2 mK low.