



Designation: E1345 – 98 (Reapproved2008)<sup>ε1</sup>

## Standard Practice for Reducing the Effect of Variability of Color Measurement by Use of Multiple Measurements<sup>1</sup>

This standard is issued under the fixed designation E1345; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon ( $\epsilon$ ) indicates an editorial change since the last revision or reapproval.

<sup>ε1</sup> NOTE—Equation 6 was corrected editorially in March 2010.

### INTRODUCTION

Recent improvements in the precision and bias of color-measuring instruments have been accompanied by more widespread use of numerical color tolerances based on instrumental measurements. As tighter tolerances are specified, they begin to approach the limits of visual perception. In many cases, the instrument user has found it difficult to prepare and measure specimens with adequate repeatability. This practice provides procedures for reducing variability in the mean results of color measurement by the use of multiple measurements, and it indicates how many measurements are required for a specific reduction.

### 1. Scope

1.1 Reduction of the variability associated with average color or color-difference measurements of object-color specimens is achieved by statistical analysis of the results of multiple measurements on a single specimen, or by measurement of multiple specimens, whichever is appropriate.

1.2 This practice provides a means for the determination of the number of measurements required to reduce the variability to a predetermined fraction of the relevant color or color-difference tolerances.

1.3 This practice is general in scope rather than specific as to instrument or material.

### 2. Referenced Documents

2.1 *ASTM Standards*:<sup>2</sup>

[D2244 Practice for Calculation of Color Tolerances and Color Differences from Instrumentally Measured Color Coordinates](#)

[D3134 Practice for Establishing Color and Gloss Tolerances](#)

[E178 Practice for Dealing With Outlying Observations](#)

[E284 Terminology of Appearance](#)

[E308 Practice for Computing the Colors of Objects by Using the CIE System](#)

[E456 Terminology Relating to Quality and Statistics](#)

[E1164 Practice for Obtaining Spectrometric Data for Object-Color Evaluation](#)

2.2 *Other Standard*:

[SAE J 1545 Recommended Practice for Instrumental Color Difference Measurement for Exterior Finishes, Textiles and Colored Trim](#)<sup>3</sup>

### 3. Terminology

3.1 Definitions of appearance terms in Terminology [E284](#) or statistical terms in Terminology [E456](#) are applicable to this practice.

3.2 *Definitions of Terms Specific to This Standard*:

3.2.1 *box and whisker plot, n*—a nonparametric data analysis diagram that illustrates the 25, 50, and 75 % cumulative distribution of values in a data set (the box) and the expected range of values, defined by distance outside the box ends; see *whiskers*, see [Fig. 1](#).

3.2.2 *extreme value, n*—a single reading, selected from a series of readings, whose value is farther from the nearer box end than 3.0 times the hinge length.

3.2.2.1 *Discussion*—A box and whiskers plot is normally used to find outliers and extreme values. Such values should be eliminated from a series before calculating the series mean, standard deviation, and confidence intervals.

<sup>1</sup> This practice is under the jurisdiction of ASTM Committee E12 on Color and Appearance and is the direct responsibility of Subcommittee E12.04 on Color and Appearance Analysis.

Current edition approved June 1, 2008. Published June 2008. Originally approved in 1990. Last previous edition approved in 2003 as E1345 - 98 (2003). DOI: 10.1520/E1345-98R08E01.

<sup>2</sup> For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

<sup>3</sup> Available from Society of Automotive Engineers (SAE), 400 Commonwealth Dr., Warrendale, PA 15096-0001, http://www.sae.org.

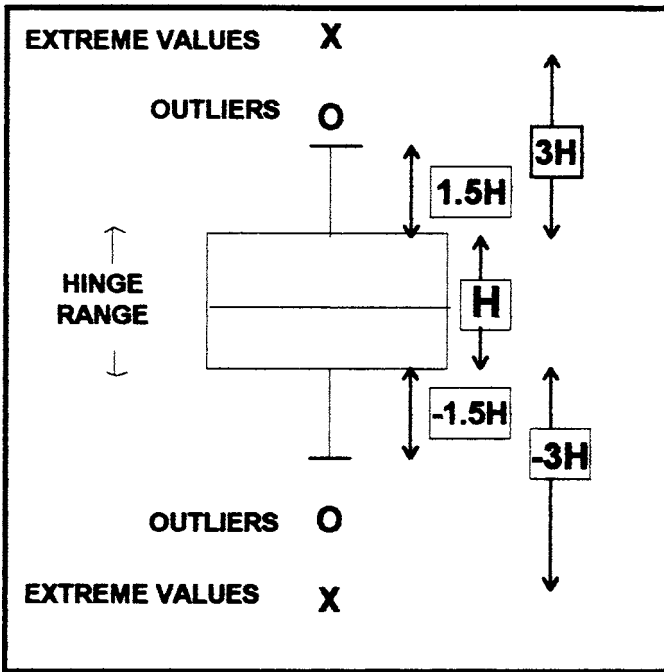


FIG. 1 Schematic Description of a Box and Whisker Plot

3.2.9 *standard error of the estimated mean,  $s_e$* ,  $n$ —standard deviation of color or color-difference measurement divided by the square root of the sampling number:

$$s_e = s/(N^{0.5}) \quad (3)$$

3.2.10 *standard error goal,  $s_{e,g}$* ,  $n$ —level to which the standard error of the estimated mean is to be reduced.

3.2.11 *tolerance,  $n$* —the upper tolerance limit minus the lower tolerance limit; the total allowable range of the color-scale or color-difference-scale value considered.

3.2.12 *whiskers,  $n$* —lines extending out from the box ends to the largest and smallest observations lying within 1.5 times the hinge length, measured from the box ends.

#### 4. Summary of Practice

4.1 This practice assumes that, for the material under consideration and a specified set of color scales, relevant color or color-difference tolerances have been established (see Practice D3134).

4.2 For convenience, the numerical example in the Appendix uses CIELAB  $LCH$  (lightness, chroma, hue) color difference scales  $\Delta L^*$ ,  $\Delta C^*_{ab}$ , and  $\Delta H^*_{ab}$  (see Practice D2244 and Practice E308), but this is not meant to be restrictive.

NOTE 1—Some coordinates, such as CIE  $x$ ,  $y$ ,  $Y$ , do not follow the theories of this standard due to excessive colinearity. While it has not been tested, this same colinearity problem may also be observed in 1960  $u$ ,  $v$  and 1976  $u'$ ,  $v'$  coordinates. Table 1 provides a listing of the appropriate and inappropriate color coordinates for use with this practice.

4.3 The successive steps in the procedure are as follows:

- 4.3.1 Determine the standard deviation of instrument.
  - 4.3.1.1 Screen the measurement data for outliers and extreme values.
  - 4.3.2 Determine the standard deviation of color or color-difference measurement.
    - 4.3.2.1 Screen the measurement data for outliers and extreme values.
    - 4.3.3 Determine the standard error of the estimated mean for a sampling number of one.
    - 4.3.4 Determine the final sampling number that reduces the standard error of the estimated mean to less than the standard error goal for each scale value.
    - 4.3.5 Determine the final standard error goal values.

NOTE 2—When the standard error of the estimated mean for a sampling number of one is larger than a specified fraction of the tolerance or a specified multiple of the standard deviation of instrument for any of the three color-difference-scale values, a sampling number greater than one is required.

#### 4.4 Screening for and Elimination of Outliers and Extreme Values in Measured Data:

TABLE 1 Appropriate and Inappropriate Color Coordinates for Use in This Practice

Color Coordinates	Appropriate	Inappropriate
CIE $Yxy$		✓
CIE $LCH$	✓	
CIE $LAB$	✓	
CIE $LUV$	✓	
CIE $Luv$		✓

3.2.3 *hinges,  $n$* —the 25 and 75 % cumulative distribution points in a set of readings taken during a measurement.

3.2.3.1 *Discussion*—Hinges represent the values in which 25 % of the readings are less than the lower hinge and 75 % of the readings are less than the upper hinge. See also *hinge length*.

3.2.3.2 *Discussion*—Hinges are sometimes called the lower ( $Q_l$ ) and upper ( $Q_u$ ) quartile values.

3.2.4 *hinge length,  $H$* ,  $n$ —the range of values between the lower and upper hinges.

3.2.4.1 *Discussion*—The hinge length is sometimes called the box width or the interquartile range  $Q_3$  to  $Q_1$ .

3.2.5 *outlier,  $n$* —a single reading, selected from a series of readings, whose value is further from the nearer box end than 1.5 times the hinge length; see 3.2.2.1.

3.2.6 *sampling number,  $N$* ,  $n$ —number of multiple measurements, or number of multiple specimens, required to reduce the variability of color or color-difference measurement to a desired level.

3.2.7 *standard deviation of color or color-difference measurement,  $s$* —standard deviation of the color scale or color-difference-scale value,  $x_i$ , being considered:

$$s = [\{\sum (x_i - x_{avg})^2\}/(n - 1)]^{0.5} \quad (1)$$

where:

$x_{avg}$  =  $(\sum x_i)/n$ , and  
 $n$  = the number of replicate measurements made.

3.2.8 *standard deviation of instrument,  $s_i$* ,  $n$ —standard deviation of a color-scale or color-difference-scale value due to instrument variability alone:

$$s_i = [\{\sum (x_i - x_{avg})^2\}/(n - 1)]^{0.5} \quad (2)$$