FINAL **DRAFT**

INTERNATIONAL **STANDARD**

ISO/FDIS 105-B06

ISO/TC 38/SC 1

Secretariat: SAC

Voting begins on: 2020-03-11

Voting terminates on: 2020-05-06

Textiles — Tests for colour fastness —

Part B06:

Colour fastness and ageing to artificial light at high temperatures: Xenon arc fading lamp test

Textiles Essais de solidité des coloris —

Partie B06. Solidité des coloris et vieillissement à la lumière artificielle à hautes températures: Essai avec lampe à arc au xénon

RECIPIENTS OF THIS DRAFT ARE INVITED TO SUBMIT, WITH THEIR COMMENTS, NOTIFICATION OF ANY RELEVANT PATENT RIGHTS OF WHICH THEY ARE AWARE AND TO PROVIDE SUPPORTING DOCUMENTATION.

IN ADDITION TO THEIR EVALUATION AS BEING ACCEPTABLE FOR INDUSTRIAL, TECHNOLOGICAL, COMMERCIAL AND USER PURPOSES, DRAFT INTERNATIONAL STANDARDS MAY ON OCCASION HAVE TO BE CONSIDERED IN THE LIGHT OF THEIR POTENTIAL TO BECOME STAN-DARDS TO WHICH REFERENCE MAY BE MADE IN NATIONAL REGULATIONS.

ISO/CEN PARALLEL PROCESSING



Reference number ISO/FDIS 105-B06:2020(E) Tells And Arain Blands it all standards of sort of the color of the co



COPYRIGHT PROTECTED DOCUMENT

© ISO 2020

All rights reserved. Unless otherwise specified, or required in the context of its implementation, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office CP 401 • Ch. de Blandonnet 8 CH-1214 Vernier, Geneva Phone: +41 22 749 01 11 Fax: +41 22 749 09 47 Email: copyright@iso.org Website: www.iso.org

Published in Switzerland

Con	tents	Page ordiv Scope1				
Forew	ord			iv		
1						
2	-		ferences			
3						
	Terms and definitions					
4	Principle					
	4.1 4.2		astness test; test			
5			aterials and apparatus			
3	5.1 Reference materials					
	5.1	5.1.1	General			
		5.1.2	References 1 to 8			
		5.1.3	References L2 and L4			
	5.2		atus			
		5.2.1	Exposure apparatus	3		
		5.2.2 5.2.3	Optical light source and filter system Radiometer for monitoring the exposure conditions	2		
		5.2.4	Temperature sensors Opaque cardboard Grey scale for assessing change in colour	3		
		5.2.5	Opaque cardboard	4		
		5.2.6	Grey scale for assessing change in colour	4		
		5.2.7				
		5.2.8	Polyester (PES) nonwoven fabric	4		
6	Prepa	ration o	Polyester (PES) nonwoven fabric of specimens and exposure card are conditions	4		
7	Proce	dure	ST rail ill straight of	5		
-	7.1 Exposure conditions					
	7.2	Setting	the exposure conditions for set No. 3	/		
	7.3	Exposu	re methods General	7		
		7.3.1	General	7		
		7.3.2	Exposure Method 1 (end point determined by change in colour in the specimen)	7		
		7.3.3	Exposure Method 2 (end point determined by change in colour of reference)			
		7.3.4	Exposure Method 3 (end point determined on the ageing test of 4.2)			
		7.3.5	Exposure Method 4 (end point determined on radiant energy)			
8	Asses	sment o	of colour fastness to light	8		
9	Test r	eport		9		
Annex	A (nor	mative)	Exposure methods and optical filter types	10		
Annex			Apparatus for determining colour fastness and ageing with air-cooled	11		
Annex	C (nor	mative)	Apparatus for determining colour fastness and ageing with water- arc lamps			
Annex	D (noi	mative)	Guidance on performing the test according to set of conditions No. 5 requirements specified in Annex C			
Diblic	oranhı		requirements specified in Affiles C.J.	13		
	viaiiil	,		/		

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

The procedures used to develop this document and those intended for its further maintenance are described in the ISO/IEC Directives, Part 1. In particular, the different approval criteria needed for the different types of ISO documents should be noted. This document was drafted in accordance with the editorial rules of the ISO/IEC Directives, Part 2 (see www.iso.org/directives).

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights. Details of any patent rights identified during the development of the document will be in the Introduction and/or on the ISO list of patent declarations received (see www.iso.org/patents).

Any trade name used in this document is information given for the convenience of users and does not constitute an endorsement.

For an explanation of the voluntary nature of standards, the meaning of ISO specific terms and expressions related to conformity assessment, as well as information about ISO's adherence to the World Trade Organization (WTO) principles in the Technical Barriers to Trade (TBT), see www.iso.org/iso/foreword.html.

This document was prepared by Technical Committee ISO/TC 38, *Textiles*, Subcommittee SC 1, *Tests for coloured textiles and colorants*, in collaboration with the European Committee for Standardization (CEN) Technical Committee CEN/TC 248, *Textiles*, in accordance with the Agreement on technical cooperation between ISO and CEN (Vienna Agreement).

This third edition cancels and replaces the second edition (ISO 105-B06:1998), which has been technically revised. It also incorporates the Amendment ISO 105-B06:1998/Amd.1:2002.

The main changes compared to the previous edition are as follows:

- dates in normative references have been removed;
- flat array apparatus for testing has been introduced.

A list of all parts in the ISO 105 series can be found on the ISO website.

Any feedback or questions on this document should be directed to the user's national standards body. A complete listing of these bodies can be found at www.iso.org/members.html.

Textiles — Tests for colour fastness —

Part B06:

Colour fastness and ageing to artificial light at high temperatures: Xenon arc fading lamp test

1 Scope

This document specifies a method for determining the colour fastness and ageing properties of all kinds and forms of dyed and printed textiles and/or other organic substrates under the action of an artificial light source representative of natural daylight (D65), and under the simultaneous action of heat. Of the five different sets of exposure conditions specified (see 7.1.1), four use D65, and the other one uses a somewhat lower cut-off wavelength. The test method gives special consideration to the light and heat conditions that occur in the interior of a motor vehicle.

The five different sets of conditions using the different optical filter systems specified can produce different test results. Results from tests performed using different apparatus (instrument types) for the same set of conditions and optical filter system are not comparable because comparable performance has not been validated.

2 Normative references

The following documents are referred to in the text in such a way that some or all of their content constitutes requirements of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 105-A01, Textiles — Tests for colour fastness — Part A01: General principles of testing

ISO 105-A02, Textiles — Tests for colour fastness — Part A02: Grey scale for assessing change in colour

ISO 105-A05, Textiles — Tests for colour fastness — Part A05: Instrumental assessment of change in colour for determination of grey scale rating

ISO 105-B02, Textiles — Tests for colour fastness — Part B02: Colour fastness to artificial light: Xenon arc fading lamp test

ISO 105-B05, Textiles — Tests for colour fastness — Part B05: Detection and assessment of photochromism

3 Terms and definitions

No terms and definitions are listed in this document.

ISO and IEC maintain terminological databases for use in standardization at the following addresses:

- ISO Online browsing platform: available at https://www.iso.org/obp
- IEC Electropedia: available at http://www.electropedia.org/

Principle

4.1 Light fastness test

A specimen to be tested is exposed to artificial light under prescribed conditions, along with a set of blue wool references. The colour fastness shall be assessed by comparing the change in colour of the test specimen with that of the references used, or with the grey scale in accordance with ISO 105-A02, or by means of a colour measuring instrument in accordance with ISO 105-A05 after the specimen has been exposed to a specified amount of radiant energy.

4.2 Ageing test

A specimen to be tested, together with blue wool reference 6 (see ISO 105-B02), is exposed to artificial light under prescribed conditions. The change in colour of the specimen shall be evaluated on the grey scale in accordance with ISO 105-A02, or by means of a colour-measuring instrument in accordance with ISO 105-A05. Additional ageing criteria, such as mechanical properties, may also be evaluated.

Attention shall be paid to the principles for specifying and carrying out the tests, and for evaluating the test results according to ISO 105-A01.

Reference materials and apparatus 5

5.1.1 General

Two different sets of blue wool references may be used. The two sets of references are not interchangeable.

5.1.2 Performs 1

5.1.2 References 1 to 8

Blue wool references developed and produced in Europe are identified by the numerical designations 1 to 8. These references are blue wool cloths dyed with the dyes listed in <u>Table 1</u>. They range from 1 (very low colour fastness) to 8 (very high colour fastness) so that each higher-numbered reference is approximately twice as fast as the preceding one (see Table 1).

Reference Dye (colour index designation)[3] CI acid blue 47 CI acid blue 23 6 7 CI solubilized vat blue 5 CI solubilized vat blue 8 NOTE References 1 to 4 are not applicable to this test.

Table 1 — Dves for blue wool references 5 to 8

5.1.3 References L2 and L4

Two blue wool references developed and produced in the United States are part of a series of eight references identified by the letter L followed by the numerical designation. These references are for the purpose of determining whether the xenon arc apparatus is operating within the desired range concerning set of conditions No. 5 (see D.4).

5.2 Apparatus

5.2.1 Exposure apparatus

The exposure apparatus consists essentially of a climatic test chamber made of a corrosion-resistant material and containing the optical light source, a filter system and holders for the test specimens.

5.2.2 Optical light source and filter system

One or more xenon arc lamps serve as the optical light source. The light for determining the hot light fastness shall be filtered. Optical light filter systems are used for this purpose. Both absorption filters and combinations of absorption and reflection filters shall be used according to $\underbrace{Annex\ B}$ and \underbrace{C} , depending on the test instrument being used. Irrespective of the type of filtration, the conditions listed in $\underbrace{Table\ 2}$ on the spectral energy distribution at the surface of the specimen shall be met.

Relative irradiancea Wavelength Set of exposure conditions nm 1, 2, 3 and 6 5 0. 290 0,07 300 0,05 0,25 280 to 320 0,1 $1,1 \pm 0,5$ 320 to 360 3.0 ± 0.85 $4,1 \pm 1,17$ $5.7_{-1.3}^{+2.0}$ 360 to 400 $6,4^{+2,3}_{-1,5}$ $32,2^{+3,0}_{-5,0}$ 400 to 520 27.3 ± 2.6 520 to 640 27.2 ± 2.7 30 ± 3.0 640 to 800 $29,1 \pm 6,0$ $33,8^{+3,4}_{-8.8}$ 100 < 800 100 As a percentage of the total irradiance in the wavelength range up to 800 nm.

Table 2 — Spectral irradiance

The radiant power shall be chosen to ensure that the conditions given in 7.1.1 are fulfilled.

The irradiance shall not deviate by more than 10 % from the average over the entire area occupied by the specimens and references.

Ageing causes the spectral energy distribution and irradiance to change during the service life of the xenon arc lamps and optical filters. Replacement of the lamps and filters in accordance with the manufacturers' instructions, allows the energy distribution and irradiance to be maintained. The irradiance can also be adjusted to keep it constant. Manufacturers who supply an exposure apparatus for use with this document should ensure that the conditions specified in 5.2 and 7.1.1 are met.

5.2.3 Radiometer for monitoring the exposure conditions

Since the irradiance at the surface of the specimen is affected by lamp intensity, lamp geometry and the specimen rack (lamp to specimen distance), repeatability and reproducibility of exposure shall be ensured by a monitoring radiometer which permits exposure to specified levels of irradiance (radiant flux per unit area) at a point in the plane of the specimen rack (see <u>B.3</u> and <u>C.3</u>).

5.2.4 Temperature sensors

5.2.4.1 Black-standard thermometer (BST) (for sets of conditions 1 to 3)

The black-standard thermometer shall consist of a plain stainless-steel plate, measuring about $70 \text{ mm} \times 40 \text{ mm}$ and with a thickness of about 0.5 mm, whose temperature is measured by a thermal resistor, with good heat-conducting properties fitted to the reverse side. The metal plate is fixed to a plastic plate so that it is thermally insulated. It is coated with a black layer which has an absorption of at least 95 %, even in the infrared region.

5.2.4.2 Black-panel thermometer (BPT) (for sets of conditions 5 and 6)

The black-panel thermometer shall consist of a metal plate approximately 70 mm wide, 150 mm long, and 1 mm thick to which is fastened a thermal resistor whose sensitive portion is centred both horizontally and vertically on the panel, the entire system being covered with a non-selective, infrared absorbing black finish. The black finish shall have at least 95 % absorbance. The side of the panel not facing the light source shall not be thermally insulated.

5.2.5 Opaque cardboard

This shall be of low sulfur content and free from fluorescent brightening agents, or other thin opaque material, partially covering the specimens and references.

5.2.6 Grey scale for assessing change in colour

This shall be in accordance with ISO 105-A02.

5.2.7 Computerized spectral colour-measuring instrument

This is for evaluating the change in colour according to ISO 105-A05.

5.2.8 Polyester (PES) nonwoven fabric

This shall be at least 5 mm thick, with a mass per unit area of $100 \text{ g/m}^2 \pm 5 \text{ g/m}^2$, for placing under the specimens.

6 Preparation of specimens and exposure card


- **6.1** Test the specimens either with their own backing material or on a layer of polyester nonwoven fabric (see 5.2.8). Unless agreed otherwise, the thickness of the underlying material shall be at least 5 mm. The limit specified in 6.4 shall be observed. The blue wool references shall be placed on white card that does not contain fluorescent brightening agents.
- **6.2** Cut sections of at least 40 mm \times 20 mm from flat materials and if necessary, attach them by their narrow edges to white card that does not contain fluorescent brightening agents. For pile goods, carpets and prints, cut the section to an appropriate size to include all colour components.

Wind yarns closely on to a card or mount on it in parallel lengths.

Form loose fibres into a nonwoven fabric or a fibrous web, of uniform thickness and surface and then mount on the white card.

To facilitate handling, the specimens to be tested and the references may be mounted on one or more cards as indicated in Figure 1.

- The specimens and references shall be of equal size and shape in order to avoid errors in assessment due to overrating the visual contrast between exposed and unexposed parts on the larger pattern as against the narrower references (see 8.1).
- For thick specimens or those with an underlay, the distances from the light source to the surface of the specimens, the references and the black-standard thermometer or black-panel thermometer shall not differ by more than about 5 mm.

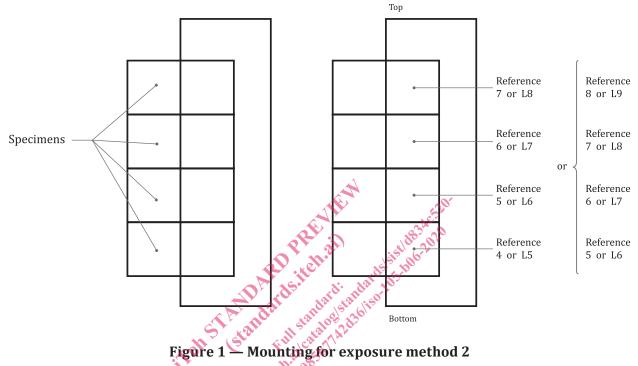

Procedure

7.1 Exposure conditions

7.1.1 General

Five different sets of exposure conditions are permitted in terms of irradiance, black-standard temperature and test-chamber temperature. The specimens and references shall be exposed under one of the sets of temperature and humidity conditions given in Tables 3, 4 and 5 and according to Annex A.

Condition	Set of conditions			
	3	1	2	
IR component	normal	high	high	
Black-standard temperature (°C)	100 ± 3	115 ± 3	90+0	
Test chamber temperature (°C)	65 ± 3	48 ± 3	45+0	
Test chamber relative humidity (%)	30 ± 5 ^a	20 ± 10 no humidification	45 ± 10 a	
Irradiance (W/m²)	45 to 162 ^b 1,1 to 3,6 ^c	70 to 90 ^b	_	

Table 3 — Exposure conditions set Nos. 1 to 3

The test method set of conditions No. 1 may occasionally give rise to temperatures at the surface of the specimen that are considerably higher than those encountered in practice. In such cases, the method is unsuitable.

Table 4 — Exposure cycle under set of conditions No. 5

Condition	"Light on" perioda	"Light off" period		
Irradiance at 340 nm (W/m²)	0.55 ±0.01	_		
Test-chamber temperature (°C)	63,±2	38 ± 2		
Black-panel temperature (°C)	89 ± 2	38 ± 2		
Test chamber relative humidity (%)	50 ± 10	95 ± 5		
Temperature of conditioning water (°C)	63 ± 4	40 ± 4		
^a Exposure begins at the start of a 3,8 h "light on" period.				

Table 5 — Exposure conditions set No. 6

Condition	Value	
Irradiance (W/m²)	162 (1 ± 10 %) ^a	
Test-chamber temperature (°C)	50 ± 3	
Black-panel temperature (°C)	89 ± 2	
Test chamber relative humidity (%)	50 ± 5	
a Broad-band measurement at 300 nm to 400 nm.		

- **7.1.2** Fit the exposure cards or specimens into specimen holders and then into the testing apparatus, with all other specimen holders containing either white cards that are half-covered by an opaque cover with cutout, or exposure cards.
- **7.1.3** Carry out exposure under sets of conditions 1, 3, 5 and 6 in the non-turning mode, and that under set no. 2 in the turning mode. Interrupt exposure only for inspection purposes, in which case remove the specimen holder concerned from the apparatus.

^a If agreed between the interested parties the test may be run without using humidification unit.

b Broad-band measurement at 300 nm to 400 nm.

Narrow-band measurement at 420 nm.