



Designation: B647 – 10

Standard Test Method for Indentation Hardness of Aluminum Alloys by Means of a Webster Hardness Gage¹

This standard is issued under the fixed designation B647; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1 This test method covers the determination of indentation hardness of aluminum alloys with a Webster hardness gage, Model B.

1.2 The values stated in SI units are to be regarded as standard. No other units of measurement are included in this standard.

1.2.1 *Exception*—The values given in parentheses are for information only.

NOTE 1—Two other models, A and B-75, are in use, but are not covered in this test method. Model A does not provide numerical values of hardness and Model B-75 covers only a part of the range of interest for aluminum alloys.

1.3 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

2. Referenced Documents

2.1 *ASTM Standards:*²

[E6 Terminology Relating to Methods of Mechanical Testing](#)

[E10 Test Method for Brinell Hardness of Metallic Materials](#)

[E18 Test Methods for Rockwell Hardness of Metallic Materials](#)

[E177 Practice for Use of the Terms Precision and Bias in ASTM Test Methods](#)

[E691 Practice for Conducting an Interlaboratory Study to Determine the Precision of a Test Method](#)

3. Terminology

3.1 *Definitions*—The definitions of terms relating to hardness testing appearing in Terminology [E6](#) shall be considered

¹ This test method is under the jurisdiction of ASTM Committee B07 on Light Metals and Alloys and is the direct responsibility of Subcommittee B07.05 on Testing.

Current edition approved Dec. 1, 2010. Published January 2011. Originally approved in 1984. Last previous edition approved in 2006 as B647 – 84 (2006). DOI: 10.1520/B0647-10.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

as applying to the terms used in this test method.

4. Significance and Use

4.1 The Webster hardness gage is portable and therefore useful for in situ determination of the hardness of fabricated parts and individual test specimens for production control purposes. It is not as sensitive as Rockwell or Brinell hardness machines; see [10.2](#).

4.2 This test method should be used only as cited in applicable material specifications.

5. Apparatus (Fig. 1)

5.1 The Webster hardness gage, Model B, consists of three main parts: the frame, operating handle, and penetrator housing assembly. The penetrator housing assembly includes the principal working parts, including the penetrator, loading spring, adjusting nut, penetrator housing, housing key, return spring, and dial indicator.

5.2 The indenter is a hardened steel truncated cone.

5.3 The dial indicator is graduated from 1 to 20, and is actuated by the penetrator so that the higher the reading, the higher is the hardness of the test material.

5.4 The configuration of the Webster hardness gage is such that it is operated like a pair of pliers.

5.5 The clearance between the penetrator and the anvil is about 6 mm ($\frac{1}{4}$ in.), limiting the thickness of sample that can be tested.

6. Test Parts or Specimens

6.1 Any part or piece of material greater than 1 mm (0.04 in.) in thickness and equal to or less than 6 mm ($\frac{1}{4}$ in.) in thickness and with a clear flat area at an edge approximately 25 by 25 mm (1 by 1 in.) in size is suitable for test.

6.2 The surfaces shall be essentially parallel, smooth, clean, and free of mechanical damage. The test surface may be lightly polished to eliminate scratches or die lines.

6.3 The clear, flat area shall be such that there will be a clear distance of at least 3 mm ($\frac{1}{8}$ in.) from the edge of the part or specimen.

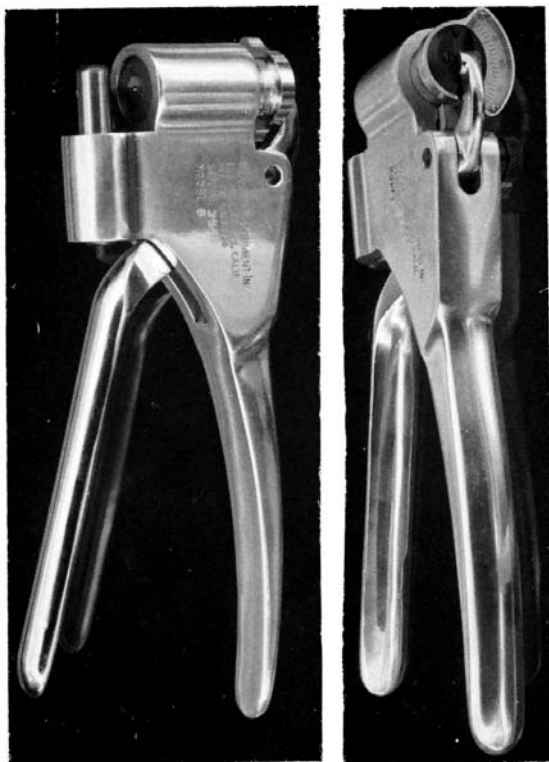


FIG. 1 Webster Hardness Gage, Model B

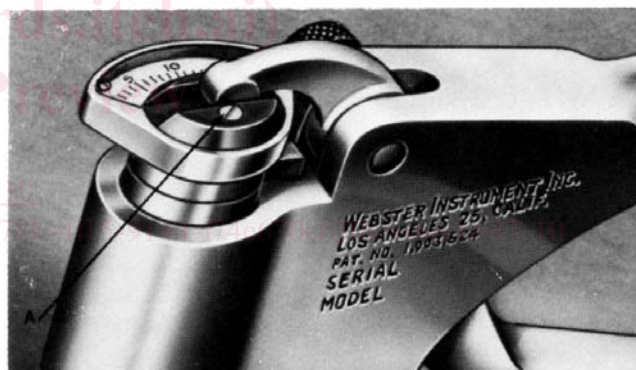
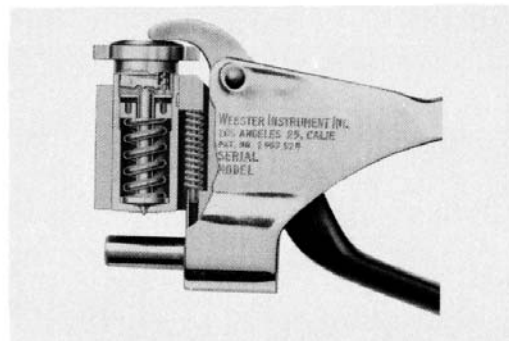


FIG. 3 Zero Adjustment Screw, A (indicated by arrow)

6.4 Parts or specimens with a slight taper or curvature may also be tested if a round anvil is used, as described in 8.1.1 and Fig. 2.

7. Calibration

7.1 Zero Adjustment:

7.1.1 Operate the instrument against the bare anvil and note whether or not the indicator gives the zero (full-scale) reading.

7.1.2 A correction in zero reading is normally not needed except for one of the reasons listed below:

7.1.2.1 A new penetrator has been installed,

7.1.2.2 The dial indicator is changed from one instrument to another, or

7.1.2.3 Excessive wear has taken place.

7.1.3 If an adjustment in zero is needed, turn the zero adjustment screw below the indicator dial slowly (Fig. 3), while operating the tester against the bare anvil and maintaining handle pressure, until the hand of the dial indicator rests on the zero line (which is located at the full-scale reading of 20).

7.1.4 The zero adjustment should never be used to make the indicator read correctly on a standard sample.

7.2 Load Spring Adjustment:

7.2.1 Measure the hardness of a standard sample of medium to low hardness, either one furnished with the tester or one developed from reference stock; the dial should show the reading indicated for the standard within ± 0.5 .

7.2.2 If the readings on the standard or the bare anvil, or both, do not indicate the proper values, adjust the load spring with the special wrench provided until agreement is reached (Fig. 4).

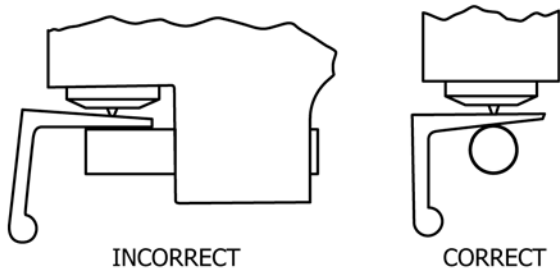


FIG. 2 Making the Test

8. Procedure

8.1 Place the test part or specimen between the penetrator and the anvil, and apply pressure to the handle.