

Designation: <u>E1473 - 09</u> <u>E1473 - 16</u>

Standard Test Methods for Chemical Analysis of Nickel, Cobalt, Cobalt and High-Temperature Alloys¹

This standard is issued under the fixed designation E1473; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ε) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1 These test methods describe the chemical analysis of nickel, <u>cobalt</u>, and high-temperature alloys having chemical compositions within the following limits:

Element	Ce	ncentration Range, %
Aluminum		0.005 to 7.00
Beryllium		0.001 to 0.05
Boron		0.001 to 1.00
Calcium		0.002 to 0.05
Carbon		0.001 to 1.10
Chromium		0.10 to 33.00
Cobalt		0.10 to 75.00
Copper		0.01 to 35.00
Iron		0.01 to 50.00
Lead		0.001 to 0.01
Magnesium		0.001 to 0.05
Manganese		0.01 to 3.0
Molybdenum		0.01 to 30.0-
Niobium (Columbium)		0.01 to 6.0
Nickel		0.10 to 98.0
Nitrogen		0.001 to 0.20
Phosphorus		0.002 to 0.08
Sulfur		0.002 to 0.10
Silicon		0.01 to 5.00
Tantalum		0.005 to 1.00
Tin		0.002 to 0.10
Titanium		0.01 to 5.00
Tungsten		0.01 to 18.00
Vanadium		0.01 to 3.25
Zine https://standards.iteh.ai		- 0.001 to - 0.01 - 1a127f08c8cd/astm-e1473-16
Zirconium		0.01 to 2.50
	Flores	One of the Deeper Of

<u>Element</u>	Composit	tion F	Range, %
Aluminum	0.005	to	7.00
Beryllium	0.001	to	0.05
Boron	0.001	to	1.00
Calcium	0.002	to	0.05
Carbon	0.001	to	1.10
Chromium	0.10	to	33.00
Cobalt	0.10	to	75.00
Copper	0.01	to	35.00
Iron	0.01	to	50.00
Lead	0.001	to	0.01
Magnesium	0.001	to	0.05
Manganese	0.01	to	3.0
Molybdenum	0.01	to	30.0
Niobium (Columbium)	0.01	to	6.0
Nickel	0.10	to	98.0
Nitrogen	0.001	to	0.20
Phosphorus	0.002	to	0.08
Sulfur	0.002	to	0.10

¹ These test methods are under the jurisdiction of ASTM Committee E01 on Analytical Chemistry for Metals, Ores, and Related Materials and are the direct responsibility of Subcommittee E01.08 on Ni and Co and High Temperature Alloys.

Current edition approved June 1, 2009April 1, 2016. Published July 2009May 2016. Originally approved in 1992. Last previous edition approved in 20032009 as E1473 – 09. DOI: 10.1520/E1473-09.10.1520/E1473-16.



0.01	to	5.00
0.005	to	1.00
0.002	to	0.10
0.01	to	5.00
0.01	to	18.00
0.01	to	3.25
0.001	to	0.01
0.01	to	2.50
	0.005 0.002 0.01 0.01 0.01 0.001	0.005 to 0.002 to 0.01 to 0.01 to 0.01 to 0.01 to

1.2 The test methods in this standard are contained in the sections indicated as follows:

Aluminum, Total by the 8-Quinolinol Gravimetric Method	Sections 62 to 69
— (0.20 % to 7.00 %) Chromium by the Atomic Absorption Method	100 to 109
— (0.018 % to 1.00 %) Chromium by the Peroxydisulfate Oxidation—Titration Method	110 to 118
— (0.10 % to 33.00 %) Cobalt by the Ion-Exchange-Potentiometric Titration Method	34 to 41
— (2 % to 75 %) Cobalt by the Nitrose R-Salt Photometric Method	42 to 51
(0.10 % to 5.0 %) Copper by Neocuproine Photometric Method	52 to 61
(0.010 % to 10.00 %) Iron by the Silver Reduction Titrimetric Method	127 to 134
- (1.0 % to 50.0 %)	8 to 17
Manganese by the Metaperiodate Photometric Method (0.05 % to	6 10 17
— 2.00 %) Molybdenum by the Ion Exchange—8-Hydroxyquinoline	119 to 126
— Gravimetric Method (1.5 % to 30 %) Molybdenum by the Photometric Method	88 to 99
— (0.01 % to 1.50 %) Nickel by the Dimethylglyoxime Gravimetric Method	70 to 77
(0.1% to 84.0%) Niobium by the Ion Exchange Cupferron Gravimetric Method	135 to 142
— (0.5 % to 6.0 %) Silicon by the Gravimetric Method (0.05 % to 5.00 %) Sulfur by the Combustion lodate Titration Method	27 to 33
Sulfur by the Combustion lodate Titration Method (D S) / S U A III U A U S I U C II o A I) (0.006 % to 0.1 %) ²	18 to 26
Tantalum by the Ion Exchange — Pyrogallol Spectrophotometric — Method (0.03 % to 1.0 %)	143 to 151
Tin by the Solvent Extraction Atomic Absorption Method (0.002 % to 0.10 %)	78 to 87
Aluminum, Total by the 8-Quinolinol Gravimetric Method ASTM E1473-16	53 to 60
(0.20 % to 7.00 %) Chromium by the Atomic Absorption Method log/standards/sist/04a2618b-8592-43b8-9a42-1a127f08c8cd/astm	
(0.018 % to 1.00 %)	<u> </u>
Chromium by the Peroxydisulfate Oxidation—Titration Method (0.10 % to 33.00 %)	101 to 109
Cobalt by the Ion-Exchange-Potentiometric Titration Method (2 % to 75 %)	25 to 32
Cobalt by the Nitroso-R-Salt Spectrophotometric Method (0.10 % to 5.0 %)	33 to 42
Copper by Neocuproine Spectrophotometric Method (0.010 % to 10.00 %)	43 to 52
Iron by the Silver Reduction Titrimetric Method (1.0 % to 50.0 %)	118 to 125
Manganese by the Metaperiodate Spectrophotometric Method (0.05 % to 2.00 %)	8 to 17
Molybdenum by the Ion Exchange—8-Hydroxyquinoline	110 to 117
Gravimetric Method (1.5 % to 30 %) Molybdenum by the Spectrophotometric Method	79 to 90
(0.01 % to 1.50 %) Nickel by the Dimethylglyoxime Gravimetric Method	
(0.1 % to 84.0 %)	61 to 68
Niobium by the Ion Exchange—Cupferron Gravimetric Method (0.5 % to 6.0 %)	126 to 133
Silicon by the Gravimetric Method (0.05 % to 5.00 %) Tantalum by the Ion Exchange—Pyrogallol Spectrophotometric	18 to 24 134 to 142
Method (0.03 % to 1.0 %) Tin by the Solvent Extraction-Atomic Absorption Method	69 to 78
(0.002 % to 0.10 %)	

These test methods were extracted from Test Methods E354 and the references to Test Methods E350, E351, E352, and E353 contained therein.

- 1.3 Methods for the determination of several elements not included in these test methods can be found in Other test methods applicable to the analysis of nickel alloys that may be used in lieu of or in addition to this method are Test Methods E30E1019, E76E1834, E1835and, E1019E1917, E1938, E2465, E2594, E2823.
- 1.4 Some of the <u>eoneentration_composition</u> ranges given in 1.1 are too broad to be covered by a single method, and therefore, these test methods contain multiple methods for some elements. The user must select the proper test method by matching the information given in the scope and interference sections of each test method with the composition of the alloy to be analyzed.
- 1.5 The values stated in SI units are to be regarded as standard. In some cases, exceptions allowed in Practice E380 are also used:
- 1.6 This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use. Specific hazard statements are given in Section 7 and in 13.4, 29.115.1.1, 15.1.2, 21.2, 22.5, 66.357.3, 123.5114.5, 124.14115.4, 139.4130.4, 139.5130.5, 147.5138.5, and 147.6138.6.

2. Referenced Documents

2.1 ASTM Standards:²

D1193 Specification for Reagent Water

E29 Practice for Using Significant Digits in Test Data to Determine Conformance with Specifications

E30 Test Methods for Chemical Analysis of Steel, Cast Iron, Open-Hearth Iron, and Wrought Iron (Withdrawn 1995)⁴

E50 Practices for Apparatus, Reagents, and Safety Considerations for Chemical Analysis of Metals, Ores, and Related Materials

E60 Practice for Analysis of Metals, Ores, and Related Materials by Spectrophotometry

E76 Test Methods for Chemical Analysis of Nickel-Copper Alloys (Withdrawn 2003)⁴

E135 Terminology Relating to Analytical Chemistry for Metals, Ores, and Related Materials

E173 Practice for Conducting Interlaboratory Studies of Methods for Chemical Analysis of Metals (Withdrawn 1998)³

E350 Test Methods for Chemical Analysis of Carbon Steel, Low-Alloy Steel, Silicon Electrical Steel, Ingot Iron, and Wrought Iron

E351 Test Methods for Chemical Analysis of Cast Iron—All Types

E352 Test Methods for Chemical Analysis of Tool Steels and Other Similar Medium- and High-Alloy Steels

E353 Test Methods for Chemical Analysis of Stainless, Heat-Resisting, Maraging, and Other Similar Chromium-Nickel-Iron Alloys

E354 Test Methods for Chemical Analysis of High-Temperature, Electrical, Magnetic, and Other Similar Iron, Nickel, and Cobalt Alloys

E380 Practice for Use of the International System of Units (SI) (the Modernized Metric System) (Withdrawn 1997)⁴

E882 Guide for Accountability and Quality Control in the Chemical Analysis Laboratory

E1019 Test Methods for Determination of Carbon, Sulfur, Nitrogen, and Oxygen in Steel, Iron, Nickel, and Cobalt Alloys by Various Combustion and Fusion Techniques

E1601 Practice for Conducting an Interlaboratory Study to Evaluate the Performance of an Analytical Method

E1834 Test Method for Analysis of Nickel Alloys by Graphite Furnace Atomic Absorption Spectrometry

E1835 Test Method for Analysis of Nickel Alloys by Flame Atomic Absorption Spectrometry

E1917 Test Method for Determination of Phosphorus in Nickel, Ferronickel, and Nickel Alloys by Phosphovanadomolybdate Spectrophotometry

E1938 Test Method for Determination of Titanium in Nickel Alloys by Diantipyrylmethane Spectrophotometry

E2465 Test Method for Analysis of Ni-Base Alloys by Wavelength Dispersive X-Ray Fluorescence Spectrometry

E2594 Test Method for Analysis of Nickel Alloys by Inductively Coupled Plasma Atomic Emission Spectrometry (Performance-Based Method)

E2823 Test Method for Analysis of Nickel Alloys by Inductively Coupled Plasma Mass Spectrometry (Performance-Based Method)

2.2 Other Document:

ISO 5725 Precision of Test Methods—Determination of Repeatability and Reproducibility for Inter-Laboratory Tests⁴

3. Terminology

- 3.1 Definitions—For definitions of terms used in these test methods, refer to Terminology E135.
- 3.1 For definitions of terms used in these test methods, refer to Terminology E135.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

The last approved version of this historical standard is referenced on www.astm.org.

⁴ Available from American National Standards Institute (ANSI), 25 W. 43rd St., 4th Floor, New York, NY 10036, http://www.ansi.org.

4. Significance and Use

4.1 These test methods for the chemical analysis of metals and alloys are primarily intended as referee methods to test such materials for compliance with compositional specifications, particularly those under the jurisdiction of ASTM Committee B02B02 on Nonferrous Metals and Alloys. It is assumed that all who use these test methods will be trained analysts capable of performing common laboratory procedures skillfully and safely. It is expected that work will be performed in a properly equipped laboratory under appropriate quality control practices such as those described in Guide E882.

5. Apparatus, Reagents, and Instrumental Practice

- 5.1 *Apparatus*—Specialized apparatus requirements are listed in the Apparatus section in each test method. In some cases, reference may be made to Practices E50.
 - 5.2 Reagents:
- 5.2.1 *Purity of Reagents*—Unless otherwise indicated, all reagents used in these test methods shall conform to the specifications of the Committee on Analytical Reagents of the American Chemical Society where such specifications are available.⁵ Other chemicals may be used, provided it is first ascertained that they are of sufficiently high purity to permit their use without adversely affecting the expected performance of the determination, as indicated in the Precision and Bias sections.
- 5.2.2 *Purity of Water*—Unless otherwise indicated, references to water shall be understood to mean reagent water as defined by Type conforming to Type I or II of Specification D1193. Type III or IV may be used if they effect no measurable change in the blank or sample.
- 5.3 <u>Photometric Spectrophotometric</u> <u>Practice—Photometric Spectrophotometric</u> practice prescribed in these test methods shall conform to Practice <u>E60</u>.

6. Interlaboratory Studies and Rounding Calculated Values

- 6.1 These test methods have been evaluated <u>using in accordance with Practice E173 (withdrawn 1997) or ISO 5725. The Reproducibility R2 of Practice E173 corresponds to the Reproducibility Index R of Practice E1601. The Repeatability R1 of Practice E173 corresponds to the Repeatability Index r of Practice E1601.</u>
- 6.2 Round calculated values to the desired number of places as directed in 3.4 to 3.6 of Rounding of test results obtained using this Test Method shall be performed in accordance with Practice E29., Rounding Method, unless an alternative rounding method is specified by the customer or applicable material specification.

7. Hazards

7.1 For precautions to be observed in the use of certain reagents and equipment in these test methods, refer to Practices E50.

MANGANESE BY THE METAPERIODATE PHOTOMETRIC SPECTROPHOTOMETRIC METHOD

8. Scope

8.1 This test method covers the determination of manganese in concentrations from 0.05 % to 2.00 %.

9. Summary of Test Method

9.1 Manganous ions are oxidized to permanganate ions by treatment with periodate. Tungsten when present at concentrations $\underline{\underline{\underline{n}}}$ $\underline{\underline{\underline{n}}}$ greater than 0.5 % is kept in solution with $\underline{\underline{\underline{phosphoric}}}$ acid $\underline{\underline{\underline{(H\underline{H}_3PO_4)}}}$. Solutions of the samples are fumed with $\underline{\underline{\underline{perchloric}}}$ $\underline{\underline{\underline{HClO_4}}}$ acid so that the effect of periodate is limited to the oxidation of manganese. $\underline{\underline{\underline{Photometric}}}$ $\underline{\underline{\underline{perchloric}}}$ $\underline{\underline{\underline{HClO_4}}}$ acid so that the effect of periodate is limited to the oxidation of manganese. $\underline{\underline{\underline{Photometric}}}$ $\underline{\underline{\underline{perchloric}}}$ $\underline{\underline{\underline{HClO_4}}}$ acid so that the effect of periodate is limited to the oxidation of manganese.

10. Concentration Range

10.1 The recommended concentration range is from 0.15 mg to 0.8 mg of manganese per 50 mL of solution, using a 1-cm cell (Note 1) and a spectrophotometer with a band width of 10 nm or less.

Note 1—This test method has been written for cells having a 1-cm light path and a "narrow-band" instrument. The concentration range depends upon band width and spectral region used as well as cell optical path length. Cells having other dimensions may be used, provided suitable adjustments can be made in the amounts of sample and reagents used.

11. Stability of Color

11.1 The color is stable for at least 24 h.

⁵ Reagent Chemicals, American Chemical Society Specifications, American Chemical Society, Washington, DC, www.chemistry.org. For suggestions on the testing of reagents not listed by the American Chemical Society, see the *United States Pharmacopeia and National Formulary*, U.S. Pharmacopeial Convention, Inc. (USPC), Rockville, MD, http://www.usp.org.



12. Interferences

- 12.1 Perehlorie HClO₄ acid-treatment, which is used in the procedure, yields solutions which can be highly colored due to the presence of hexavalent chromium (Cr(VI))Cr(VI) ions. Although these ions and other colored ions in the sample solution undergo no further change in color quality upon treatment with metaperiodate ion, the following precautions must be observed when filter photometers are used: Select a filter with maximum transmittance between 545 nm and 565 nm. The filter must transmit not more than 5 % of its maximum at a wavelength shorter than 530 nm. The band width of the filter should be less than 30 nm when measured at 50 % of its maximum transmittance. Similar restrictions apply with respect to the wavelength region employed when other "wide-band" instruments are used.
- 12.2 The spectral transmittance curve of permanganate ions exhibits two useful minima, one at approximately 526 nm, and the other at 545 nm. The latter is recommended when a "narrow-band" spectrophotometer is used.
- 12.3 Tungsten, when present in amounts of more than 0.5 % interferes by producing a turbidity in the final solution. A special procedure is provided for use with samples containing more than 0.5 % tungsten which eliminates the problem by preventing the precipitation of the tungsten.

13. Reagents

- 13.1 Manganese, Standard Solution (1 mL = 0.032 mg Mn)—Transfer the equivalent of 0.4000 g of assayed, high-purity manganese (purity 99.99 % minimum), to a 500-mL volumetric flask and dissolve in 20 mL of HNO₃ by heating. Cool, dilute to volume, and mix. Using a pipet, transfer 20 mL to a 500-mL volumetric flask, dilute to volume, and mix.
- 13.2 Nitric-Phosphoric HNO₃-H₃PO₄ Acid-Mixture—Cautiously, while stirring, add 100 mL of HNO₃ and 400 mL of H₃PO₄ to 400 mL of water. Cool, dilute to 1 L, and mix. Prepare fresh as needed.
- 13.3 Potassium Metaperiodate Solution (7.5 g/L)—Dissolve 7.5 g of potassium metaperiodate (KIO₄) in 200 mL of hot HNO₃ (1 + 1), add 400 mL of H₃PO₄, cool, dilute to 1 L, and mix.
- 13.4 Water, Pretreated with Metaperiodate—Add 20 mL of KIO₄ solution to 1 L of water, mix, heat at not less than 90 °C for 20 to 30 min, and cool. Use this water to dilute solutions to volume that have been treated with KIO₄ solution to oxidize manganese, and thus avoid reduction of permanganate ions by any reducing agents in the untreated water. (Warning—Avoid the use of this water for other purposes.)

14. Preparation of Calibration Curve

- 14.1 *Calibration Solutions*—Using pipets, transfer (5, 10, 15, 20, and 25) mL of manganese standard solution (1 mL = 0.032 mg Mn) to 50-mL borosilicate glass volumetric flasks, and, if necessary, dilute to approximately 25 mL. Proceed as directed in 14.3.
- 14.2 Reference Solution—Transfer approximately 25 mL of water to a 50-mL borosilicate glass volumetric flask. Proceed as directed in 14.3.
- 14.3 *Color Development*—Add 10 mL of KIO₄ solution, and heat the solutions at not less than 90 °C for 2020 min to 30 min (Note 2). Cool, dilute to volume with pretreated water, and mix.
- Note 2—Immersing the flasks in a boiling water bath is a preferred means of heating them for the specified period to ensure complete color development.
 - 14.4 *Photometry:* Spectrophotometry:
- 14.4.1 *Multiple-Cell Photometer*—Spectrophotometer—Measure the cell correction using the Reference Solution (14.2) in absorption cells with a 1-cm light path and using a light band centered at approximately 545 nm. Using the test cell, take the photometric readings of the calibration solutions versus the reference solution (14.2).
- 14.4.2 Single-Cell <u>Photometer—Spectrophotometer—</u> Transfer a suitable portion of the reference solution (14.2) to an absorption cell with a 1-cm light path and adjust the <u>photometerspectrophotometer</u> to the initial setting, using a light band centered at approximately 545 nm. While maintaining this adjustment, take the <u>photometriespectrophotometric</u> readings of the calibration solutions.
- 14.5 Calibration Curve—Plot the net photometric readings of the calibration solutions against milligrams of manganese per 50 mL of solution. Follow the instrument manufacturer's instructions for generating the calibration curve.

15. Procedure

15.1 Test Solutions—Select and weigh a sample in accordance with the following: following.

	Tolerance in	
Sample	Sample	Dilution,
Weight, g	Weight, mg	mL
0.80	0.5	100
0.35	0.3	100
0.80	0.5	500
	Weight, g 0.80 0.35	Sample Sample Weight, g Weight, mg 0:80 0:5 0:35 0:3

15.1.1

	Tolerance in	
Sample	Sample	Dilution,
Weight, g	Weight, mg	mL
0.80	<u>0.5</u>	<u>mL</u> 100
0.35	0.3	100
0.80	0.5	500
	Weight, g 0.80 0.35	Sample Sample Weight, g Weight, mg 0.80 0.5 0.35 0.3

- 15.1.2 For Samples Containing Not More Than 0.5 % Tungsten—(Warning—See Practices E50 for details pertaining to the special hazards associated with the use of HClO₄.)
- 15.1.2.1 To dissolve samples that do not require HF, add 8 mL to 10 mL of HCl (1 + 1), and heat. Add HNO₃ as needed to hasten dissolution, and then add 3 mL to 4 mL in excess. When dissolution is complete, cool, then add 10 mL of HClO₄; evaporate to fumes to oxidize chromium, if present, and to expel HCl. Continue fuming until salts begin to separate. Cool, add 50 mL of water, and digest if necessary to dissolve the salts. Cool and transfer the solution to a 100-mL volumetric flask. Proceed to 15.1.315.1.4.
- 15.1.2.2 For samples whose dissolution is hastened by HF, add 8 mL to 10 mL of HCl (1 + 1), and heat. Add HNO₃ and a few drops of HF as needed to hasten dissolution, and then add 3 mL to 4 mL of HNO₃. When dissolution is complete, cool, then add 10 mL of HClO₄, evaporate to fumes to oxidize chromium, if present, and to expel HCl. Continue fuming until salts begin to separate. Cool, add 50 mL of water, digest if necessary to dissolve the salts, cool, and transfer the solution to either a 100-mL or 500-mL volumetric flask as indicated in 15.1. Proceed to 15.1.315.1.4.
- 15.1.3 For Samples Containing More Than 0.5 % <u>Tungsten: Tungsten—(Warning—See Practices E50 for details pertaining to the special hazards associated with the use of HClO.)</u>
- 15.1.3.1 To dissolve samples that do not require HF, add 8 mL to 10 mL of H₃PO₄, 10 mL of HClO₄, 5 mL to 6 mL of H₂SO₄, and 3 mL to 4 mL of HNO₃. Heat moderately until the sample is decomposed, and then heat to copious white fumes for ±010 min to 12 min or until the chromium is oxidized and the HCl is expelled, but avoid heating to fumes of sulfur trioxide (SOSO₃). Cool, add 50 mL of water, and digest if necessary to dissolve the salts. Transfer the solution to either a 100-mL or 500-mL volumetric flask as directed in 15.1. Proceed to ±5.1.315.1.4.
- 15.1.3.2 For samples whose dissolution is hastened by HF, add 8 mL to 10 mL of H₃PO₄, 10 mL of HClO₄, 5 mL to 6 mL of H₂SO₄, 3 mL to 4 mL of HNO₃, and a few drops of HF. Heat moderately until the sample is decomposed, and then heat to copious white fumes for ±010 min to 12 min or until the chromium is oxidized and the HCl is expelled, but avoid heating to fumes of SO₃. Cool, add 50 mL of water, digest if necessary to dissolve the salts, cool, and transfer the solution to a 100-mL or 500-mL volumetric flask as directed in ±5.115.1.1. Proceed to ±5.1.315.1.4.
- 15.1.3.3 Cool the solution, dilute to volume, and volume mix. Allow insoluble matter to settle, or dry-filter through a coarse paper and discard the first 15 to 15 mL to 20 mL of the filtrate, before taking aliquots.
- 15.1.4 Using a pipet, transfer 20-mL aliquots to two 50-mL borosilicate glass volumetric flasks; treat one as directed in 15.3 and the other as directed in 15.4.1.
- 15.2 Reagent Blank Solution—Carry a reagent blank through the entire procedure using the same amounts of all reagents with the sample omitted.
 - 15.3 *Color Development*—Proceed as directed in 14.3.
 - 15.4 Reference Solutions:
- 15.4.1 Background Color Solution—To one of the sample aliquots in a 50-mL volumetric flask, add 10 mL of nitrie-phosphorie $\underline{\text{HNO}_3}$ - $\underline{\text{H}_3\text{PO}_4}$ acid mixture, and heat the solution at not less than 90 °C for $\underline{\text{20}}$ 20 min to 30 min (Note 2). Cool, dilute to volume (with untreated water), and mix.
- 15.4.2 Reagent Blank Reference Solution—Transfer the reagent blank solution (15.2) to the same size volumetric flask as used for the test solutions and transfer the same size aliquots as used for the test solutions to two 50-mL volumetric flasks. Treat one portion as directed in 15.3 and use as reference solution for test samples. Treat the other as directed in 15.4.1 and use as reference solution for background color solutions.
- 15.5 <u>Photometry—Spectrophotometry—</u>Establish the cell corrections with the reagent blank Reference solution to be used as a reference solution for background color solutions. Take the <u>photometric spectrophotometric</u> readings of the background color solutions and the test solutions versus the respective reagent blank reference solutions as directed in 14.4.

16. Calculation

16.1 Convert the net <u>photometrics pectrophotometric</u> reading of the test solution and of the background color solution to milligrams of manganese by means of the calibration curve. Calculate the percent of manganese as follows:

Manganese,
$$\% = (A - B)/(C \times 10)$$
 (1)

where:

A = manganese found in 50 mL of the final test solution, mg,

B = apparent manganese found in 50 mL of the final background color solution, mg, and

C = sample weight represented in 50 mL of the final test solution, g.

17. Precision and Bias

- 17.1 Precision—Nine laboratories cooperated in testing this test method and obtained the data summarized in Table 1.
- 17.2 Bias—No information on the accuracy of this test method is known. The accuracy The bias of this test method may be judged by comparing accepted reference values with the corresponding arithmetic average obtained by interlaboratory testing, testing, such as the data listed in Table 1.

SULFUR BY THE COMBUSTION-IODATE TITRATION METHOD

18. Scope

18.1 This test method covers the determination of sulfur in concentrations from 0.006 % to 0.1 %.

19. Summary of Test Method

19.1 A major part of the sulfur in the sample is converted to sulfur dioxide (SO_2) by combustion in a stream of oxygen. During the combustion, the SO_2 is absorbed in an acidified starch-iodide solution and titrated with potassium iodate solution. The latter is standardized against steels of known sulfur content to compensate for characteristics of a given apparatus and for day-to-day variation in the percentage of sulfur recovered as SO_2 . Compensation is made for the blank due to accelerators and boats (or crucibles).

20. Interferences

20.1 The elements ordinarily present do not interfere if their concentrations are under the maximum limits shown in 1.1.

21. Apparatus

21.1 Apparatus for Determination of Sulfur by Direct Combustion—The apparatus must be suitable for the combustion of the sample in oxygen to form SO₂ and must provide an absorption vessel in which the SO₂ is titrated. A typical arrangement is shown in Fig. 1.

21.1.1 Oxygen Purifiers—The regular commercial tank oxygen is satisfactory. It must be passed through two pressure reduction valves (approximately 207 kPa (30 psig) and 14 kPa to 28 kPa (2 psig to 4 psig), respectively) or a suitable two-stage reduction valve to provide an even and adequate flow of oxygen through a tower containing H₂SO₄ and through an absorption tower containing 20 to 30-mesh inert base impregnated with sodium hydroxide (NaOH) and anhydrous magnesium perchlorate

TABLE 1 Statistical Information—Manganese by the Metaperiodate Photometrie Method

https://standards.itel

Test Specimen catalog/standards/sist	Manganese Found, %	Repeatability (R ₁ , Practice E173)	Reproducibility (R ₂ , Practice - 24 E173)
1. Nickel alloy, 77Ni-20Cr (NIST 169, 0.073 Mn)	0.074	0.002	0.008
2. High-temperature alloy — 68Ni 14Cr 7A1-6Mo — (NIST 1205, 0.29 Mn)	0.289	0.007	0.026
3. Cobalt alloy 41Co- 20Ni-20Cr-4Mo-4W (NIST 168, 1.50 Mn)	1.49	0.03	0.08
4. Stainless steel 18Cr-9Ni — (NIST 101e, 1.77 Mn)	1.79	0.07	0.07

TABLE 1 Statistical Information—Manganese by the Metaperiodate Spectrophotometric Method

Test Specimen	Manganese Found, %	Repeatability (R ₁ , Practice E173)	Reproducibility (R ₂ , Practice E173)
1. Nickel alloy, 77Ni-20Cr	0.074	0.002	0.008
(NIST 169, 0.073 % Mn, certified)			
2. High-temperature alloy,	0.289	0.007	0.026
68Ni-14Cr-7Al-6Mo			
(NIST 1205, 0.29 % Mn,			
not certified)			
Cobalt alloy,	1.49	0.03	0.08
41Co-20Ni-20Cr-4Mo-4W			
(NIST 168, 1.50 % Mn,			
not certified)			
4. Stainless steel 18Cr-9Ni	1.79	0.07	0.07
(NIST 101e, 1.77 % Mn,			
certified)			

(Mg(ClO₄)₂). A flowmeter and quick-acting shut-off valve for use during preheating periods must precede the resistance furnace assembly. A flowmeter must also precede the induction furnace assembly.

21.1.2 Combustion Furnace—An electric tube furnace capable of continuous operation at 1425 °C to 1450 °C is recommended, since this temperature is required for some alloys. The combustion may be accomplished either by resistance or induction heating. With the former, the temperature must be controlled as specified for each type of alloy. With the latter a rheostat to control the power input to the induction coil is required to avoid heating some types of samples too rapidly during the early stages of combustion. The combustion zone of the resistance furnace must be 200 mm to 250 mm (8 in. to 10 in.) in length and that of the induction furnace must amply provide for adequate heating of the sample.

21.1.3 Combustion Tube—The combustion tube of the resistance furnace must be of a low-sulfur refractory type that will withstand the maximum operating temperature without becoming porous. The tube must be of a suitable size to fit the particular furnace used and have an inside diameter large enough to accommodate the thimble, boat, and cover. A tapered-end tube is recommended.

21.1.4 Combustion Boats, Crucibles, and Covers—The boats and crucibles for use with the respective types of furnaces must be of adequate thickness to retain the molten slag and have a blank as low and consistent as possible. The boats for use with resistance furnaces should be 90 mm to 100 mm (3.5 in. to 4 in.) in length and may be provided with suitable covers. The crucibles for use with induction furnaces must have adequate capacity and may be provided with suitable covers. The blank requirements that apply to the boats and crucibles also apply to their covers. Prior to use, the boats and covers must be pre-fired at least 15 min at 1100 °C and then stored in a desiceator.

21.1.5 Ceramic Thimble—A porous ceramic thimble or liner with a small orifice drilled in the closed end is placed (closed end first) in the hot zone of the tube of the resistance furnace to prolong the life of the combustion tube by absorbing spattered slag and to act as a filter to remove metal oxide fumes from the gas stream.

21.1.6 Ceramic Filter—If a ceramic thimble is not available, a porous ceramic filter is placed in the hot zone of the furnace to remove metallic oxide fumes from the gas stream; it can be constructed from porous insulating fire brick capable of withstanding the operating temperatures. In induction furnaces, suitable precautions must be taken to prevent metallic oxides from entering the titration vessel.

21.1.7 Connections—A metal breech connector at the entrance of the combustion tube is recommended. If a rubber stopper is used it must be protected by heat-reflecting baffles, preferably of the double-disk type. Connection between the outlet end of the combustion tube and the absorption and titration assembly must be as short and free of bends as possible, with glass connections butted to minimize areas of rubber tubing exposed to gases. All rubber stoppers and tubing must be essentially free of sulfur.

21.1.8 Absorption and Titration Apparatus—The apparatus should consist of an absorption and titration vessel of appropriate volume and containing an inlet bubbler tube for the sulfur gases with a float valve to prevent back flow of liquid when the sample is starting to consume oxygen. The vessel must be shaped to effect complete absorption of SO₂ in a small volume of solution. The burst should be approximately 10 mL in capacity. Automatic titrations which utilize a photoelectric cell to activate a solution inlet valve are commercially available and may be used.

https://standards.jteh.ai/catalog/standards/sist/04a2618b-8592-43b8-9a42-1a127f08c8cd/astm-e1473-16


22. Reagents

- 22.1 Copper (Low-Sulfur) Accelerator—Rectangular strips for combustion boats used with a resistance furnace, or rings for erucibles used with an induction furnace.
 - 22.2 Iron (Low-Sulfur) Accelerator—Iron chips or iron powder.
- 22.3 Potassium Iodate Standard Solution A (Approximate Sulfur Equivalent = 0.1 mg S/mL)—Dissolve 0.2225 g of potassium iodate (KIO₃) in 900 mL of water containing 1 g of NaOH and dilute to 1 L.
- 22.4 Potassium Iodate Standard Solution B (Approximate Sulfur Equivalent = 0.02 mg S/mL)—Transfer 200 mL of KIO₃ Standard Solution A (approximate sulfur equivalent = 0.1 mg S/mL) to a 1-L volumetric flask, dilute to volume, and mix.
 - Note 3—The stated sulfur equivalents are based on complete conversion of sulfur to SO₂; this is a phenomenon that seldom, if ever, occurs.
- 22.5 Starch-Iodide Solution—Transfer 9 g of soluble (or arrowroot) starch to a 50-mL beaker, add 5 mL to 10 mL of water, and stir until a smooth paste is obtained. Pour the mixture slowly into 500 mL of boiling water. Cool, add 15 g of potassium iodide (KI), and stir until the KI is dissolved. Dilute to 1 L.
 - 22.6 Tin (Low-Sulfur) Accelerator, granular.

23. Calibration

23.1 Select a minimum of three standards (Note 6), two with sulfur contents near the high and low limits of the range for a given sample weight (24.1.3) and also one near the median. The median standard may be simulated, if necessary, by taking one half the sample weight of each of the other two.

Note 4—The accuracy of this test method is dependent to a large extent upon the accuracy of the methods used to certify the sulfur concentration in the calibration standards.



- 23.2 For sulfur concentrations greater than 0.02 % use KIO₃ Standard Solution A. For sulfur concentrations less than 0.02 % use KIO₃ Standard Solution B.
- 23.3 Select the standard with the lowest sulfur concentration and make several determinations as directed in 24.1 or 24.2 until the system is stabilized as shown by reproducible titrations.
- 23.4 Continue with multiple portions of each additional standard, as directed in 24.1 or 24.2, running the standards in ascending order of sulfur concentration.
- 23.5 Prepare a calibration curve by plotting the percentage of sulfur in each standard against the average of the millilitres of KIO₃ Standard Solution (or apparent percentage of sulfur for "direct-reading" burets). Prepare a separate calibration curve for each sample weight/sulfur range (24.1.3).
- 23.6 Repeat the calibration: (1) when another KIO₃ Standard Solution or another starch-iodide solution is used; (2) when a different lot of boats (or crucibles) is used; (3) when a different lot of accelerator is used; (4) when a different cylinder of oxygen is used; (5) when the system has not been in use for 1 h, or less than 1 h if the oxygen flow rate has not been maintained during that period; (6) when the system has been in use continuously for 8 h; (7) when the operating temperature has been changed; and (8) when a change in sample weight as indicated in 24.1.3 is required.

24. Procedure

- 24.1 Combustion with Resistance Furnace:
- 24.1.1 Adjust the temperature of the furnace to 1400 °C to 1425 °C.
- 24.1.2 Add 65 mL to 70 mL of HCl (1 + 99) and 2 mL of starch-iodide solution to the absorption vessel. Pass oxygen through the system at a constant rate which is the maximum compatible with the particular absorption system used but not less than 1.0 L/min and not more than 1.5 L/min. Add KIO₃ Standard Solution from the buret until the intensity of the blue color is that which is to be taken as the end point of the final titration. Read the buret and record as the initial reading, and refill the buret. Turn off the oxygen.
 - 24.1.3 Select and weigh a sample in accordance with the following:

Transfer the sample to a preignited combustion boat and spread it in a layer of uniform thickness.

- 24.1.4 Cover the sample with 0.5 g of iron accelerator and approximately 0.25 g of copper accelerator. Place a preignited cover on the boat and introduce it into the center of the combustion zone. Close the tube and allow the sample to heat for 1.5 min. Start the flow of oxygen at the rate used in 24.1.2.
- 24.1.5 Titrate the evolved SO_2 continuously with the appropriate KIO_3 Standard Solution at such a rate as to maintain as nearly as possible the initial intensity of the blue color. Continue the flow of oxygen for 10 min, record the buret reading, and subtract the initial reading obtained in 24.1.2. Drain the absorption vessel. If the net volume differs by more than a factor of three from that required for the sample previously analyzed, disregard the result and repeat the analysis a sufficient number of times to stabilize the system before proceeding as directed in 23.1.
 - 24.2 Combustion with Induction Furnace:
- 24.2.1 Turn on the power of the induction furnace and allow the electronic circuit to heat to operating temperature. Depress the starting button until the ammeter indicates that the current is flowing through the induction coil.
 - 24.2.2 Proceed as directed in 24.1.2.
 - 24.2.3 Proceed as directed in 24.1.3 substituting a crucible for the combustion boat.
- 24.2.4 Add 0.5 g of iron accelerator, 1.0 g of tin, and approximately 0.5 g of copper accelerator. Place a preignited cover on the crucible and introduce it into the center of the combustion zone. Close the tube, start the flow of oxygen at the rate used in 24.2.2, turn on the power, and increase it to the maximum at such a rate that spattering of the molten sample is avoided.
- 24.2.5 Proceed as directed in 24.1.5, but discontinue the flow of oxygen after 4 to 5 min or when the titration is complete. Turn off the power to the induction coil.

25. Calculation

25.1 Read the percentage of sulfur in the sample from the appropriate curve plotted as directed in 23.5.

26. Precision and Bias

- 26.1 Although samples covered by this test method with appropriate sulfur concentrations for evaluation of the test method were not available, the precision data summarized in 45.1 of Test Methods E353 should apply.
- 26.2 Twenty-two laboratories cooperated in testing this test method; six used resistance furnaces and reported eight sets of values (Note 5); sixteen used induction furnaces (Note 6). They obtained the data summarized in Table 2 for Material 7. Although

TABLE 2 Statistical Information—Sulfur

Test Material	Sulfur Found, %	Repeatability (R ₁ , Practice E173 ^A)	Reproducibility (R ₂ , Practice E173 ^A)
	Induction	Furnace	
1. No. 1, Test Methods E352	0.006 ^B	0.0016	0.0032
2. No. 2, Test Meth- ods E352	0.008 ^B	0.0013	0.0044
3. No. 3, Test Methods E350	0.014 ^B	0.0025	0.0029
4. No. 4, Test Methods E350	0.016 ^B	0.0018	0.0024
5. No. 6, Test Methods E350	0.032 ^C	0.0032	0.0049
6. No. 7, Test Meth- ods E350	0.141 ^D	0.0066	0.0126
7. Stainless steel 13Gr-0.3Me -(NIST 133a, 0.329S + NBS -10g, 0.109S: 0.286S)	0.286^E	0.0135	0.0201
	Resistance	Furnace	
1. No. 1, Test Meth- ods E352	0.006 ^B	0.0014	0.0024
2. No. 2, Test Methods E352	0.009 ^B	0.0007	0.0020
3. No. 3, Test Meth- ods E350	0.014 ^B	0.0014	0.0025
4. No. 4, Test Meth- ods E350	0.015 ^B	0.0017	0.0029
5. No. 6, Test Methods E350	0.032 ^C	0.0028	0.0041
6. No. 7, Test Methods E350	0.140 ^D	0.0074	0.0111
7. Stainless steel 13Gr-0.3Mo (NIST 133a, 0.329S + NBS 0.109S: 0.286S)	S 0.288 ^E	t Previ	0.0206

TABLE 2 Statistical Information—Silicon

https://standards.iteh

Test Specimen ds/	Silicon Found, %	Repeatability (R ₁ , Practice	Reproducibility (R ₂ , Practice
		E173)	E173)
	HCIO ₄ Del	nydration	
1. Ni-base alloy	0.029	0.006	0.026
75Ni-12Cr-6Al-			
4Mo-2Cb-0.7Ti			
	H ₂ SO ₄ Del	nydration	
1. Ni-base alloy	0.030	0.007	0.030
75Ni-12Cr-6Al-			
4Mo-2Cb-0.7Ti			
2. Co-base alloy	1.01	0.03	0.06
66Co-28Cr-4W-1.5N	i		

^A This test method was performed in accordance with the 1980 version of Practice

samples covered by this test method with sulfur concentration near the lower limit of the scope were not available for testing, the precision data obtained using the test methods indicated in Table 2 should apply. None was available to permit a test near the upper limit of the scope.

Note 5—The recovery of sulfur as SO₂ ranged from 72 % to 97 % with an average value of 83 % based on calibration standards designated b,c, and

Note 6—The recovery of sulfur as SO₂ ranged from 80 % to 96 % with an average value of 88 % based on calibration standards designated b,c, and d in Table 3.

^B Calibration standards: See Footnote ^A, Table 5, Test Methods E350.

Calibration standards: See Footnote ^B, Table 5, Test Methods E350.
 Calibration standards: See Footnote ^C, Table 5, Test Methods E350.

E Calibration standards: See Footnote D, Table 5, Test Methods E350.

26.3 Bias—No information on the accuracy of this test method is known. The accuracy of this test method may be judged by comparing accepted reference values with the corresponding arithmetic average obtained by interlaboratory testing.

SILICON BY THE GRAVIMETRIC METHOD

18. Scope

18.1 This test method covers the determination of silicon in concentrations from 0.05 % to 5.00 % in alloys containing not more than 0.1 % boron.

19. Summary of Test Method

19.1 After dissolution of the sample, silicic acid is dehydrated by fuming with sulfuric or $\frac{\text{perehlorie} \underline{\text{HclO}_4}}{\text{ecid}}$ acid. The solution is filtered, and the impure silica is ignited and weighted. The silica is then volatilized with $\frac{\text{hydrofluorie acid}}{\text{hydrofluorie acid}}$. The residue is ignited and weighted; the loss in weight represents silica.

20. Interferences

20.1 The elements normally present do not interfere. When boron is present in amounts greater than 0.1 %, the sample solution requires special treatment with methyl alcohol. (Warning—See Practices E50.) prior to acid dehydration. However, since no boron steels were tested, this special treatment was not evaluated and is not described in this test method.

21. Reagents

- 21.1 The analyst should <u>make certain ensure</u> by analyzing blanks and other checks that possible silicon contamination of reagents will not significantly bias the results.
- 21.2 *Perchloric HClO*₄*Acid*: —(Warning—See Practices E50 for details pertaining to the special hazards associated with the use of HClO₄.)
- 21.2.1 Select a lot of $HClO_4$ that contains not more than 0.0002 % silicon for the analysis of samples containing silicon in the range from 0.02 % to 0.10 % and not more than 0.0004 % silicon for samples containing more than 0.10 % by determining duplicate values for silicon as directed in 30.2.221.2.2 21.2.6 through 30.2.6.
- 21.2.2 Transfer 15 mL of HClO₄ (Note 73) to each of two 400-mL beakers. To one of the beakers transfer an additional 50 mL of HClO₄. Using a pipet, transfer 20 mL of sodium silicate (Na_2SiO_3) -solution (1 mL = 1.00 mg Si) to each of the beakers. Evaporate the solutions to fumes and heat for $\frac{1515 \text{ min}}{1500 \text{ min}}$ to 20 min at such a rate that HClO₄ refluxes on the sides of the beakers. Cool sufficiently, and add 100 mL of water (40 °C to 50 °C).
- Note 3—The 15-mL addition of $HClO_4$ eame-can be from the same lot as the one to be tested. Once a lot has been established as having less than 0.0002 % silicon, it should preferably be used for the 15-mL addition in all subsequent tests of other lots of acid.
- 21.2.3 Add paper pulp and filter immediately, using low-ash 11-cm medium-porosity filter papers. Transfer the precipitates to the papers, and scrub the beakers thoroughly with a rubber-tipped rod. Wash the papers and precipitates alternately with 3-mL to 5-mL portions of hot HCl (1 + 19) and hot water, for a total of six times. Finally wash the papers twice with H_2SO_4 (1 + 49). Transfer the papers to platinum crucibles.
- 21.2.4 Dry the papers and heat at 600 °C until the carbon is removed. Finally ignite at 1100 °C to 1150 °C or to constant weight (at least 30 min). Cool in a desiccator and weigh.
- 21.2.5 Add enough H_2SO_4 (1 + 1) to moisten the SiO_2 , and add 3 mL to 5 mL of HF. Evaporate to dryness and then heat at a gradually increasing rate until H_2SO_4 is removed. Ignite for 15 min at 1100 °C to 1150 °C, cool in a desiccator, and weigh.
 - 21.2.6 Calculate the percentage of silicon as follows:

Silicon,
$$\% = [(A - B) - (C - D)] \times 0.4674/E \times 100$$
 (2)

where:

 $A = \text{initial weight of crucible plus impure SiO}_2 \text{ when 65 mL of HClO}_4 \text{ was taken, g},$

B = final weight of crucible plus impurities when 65 mL of HClO₄ was taken, g,


 ϵ = final weight of crucible plus impurities when 15 mL of HClO₄ was taken, g,

 \underline{C} = final weight of crucible plus impure SiO₂ when 15 mL of HClO₄ was taken, g,

 \overline{D} = final weight of crucible plus impurities when 15 mL of HClO₄ was taken, g, and

 $E = \text{nominal weight (80 g) of 50 mL of HClO}_4$.

- 21.3 Sodium Silicate Solution (1.00 mg/mL Si)—Transfer 11.0 g of sodium silicate ($Na_2SiO_3\cdot9H_2O$) to a 400-mL beaker. Add 150 mL of water and dissolve the salt. Filter through a medium paper, collecting the filtrate in a 1-L volumetric flask, dilute to volume, and mix. Store in a polyethylene bottle. Use this solution to determine the suitability of the HClO₄.
 - 21.4 Tartaric Acid Solution (20.6 g/L)—Dissolve 20.6 g of tartaric acid (C₄H₆O₆) in water, dilute to 1 L, and filter.
- 21.5 *Water*—Use freshly prepared Type II water known to be free of silicon. Water distilled from glass, demineralized in columns containing silicon compounds, or stored for extended periods in glass, or combination thereof, has been known to pick up-absorb silicon.



22. Procedure

22.1 Select and weigh a sample in accordance with the following: following.

_	_	Tolerance	Dehydrating	Acid, mL
_	Sample	in Sample	H ₂ SO ₄	_
Silicon, %	Weight, g	Weight, mg	(1+4)	HCIO₄
0.05 to 0.10	5.0	5	150	75
0.10 to 1.0	4.0	4	100	60
1.0 to 2.0	3.0	3	100	50
2.0 to 5.0	2.0	2	100	40

Transfer it to a 400-mL beaker or a 300-mL porcelain casserole. Proceed as directed in 31.2 or 31.3. 22.1.1

Tolerance	Dehydrating Acid, mL
Sample in Sample H ₂ SO.	1
Silicon, % Weight, g Weight, mg (1+4)	HCĪO₄
0.05 to 0.10 5.0 5 150	75
0.10 to 1.0 4.0 4	60 50
1.0 to 2.0 3.0 100	50
2.0 to 5.0 2.0 2 100	40

- 22.1.2 Transfer the sample to a 400-mL beaker or a 300-mL porcelain casserole. Proceed as directed in 22.2 or 22.3.
- 31.2 Proceed as directed in 31.4 if tungsten is greater than 0.5 %.
- 31.3 Proceed as directed in 31.2 or 31.5 if tungsten is less than 0.5 %.
- 22.2 SulfuricH₂SO₄ Acid Dehydration: Dehydration—if tungsten is greater than 0.5 %.
- 22.2.1 Add amounts of HCl or HNO₃, or mixtures and dilutions of these acids, that are sufficient to dissolve the sample; and then add the H_2SO_4 (1 + 4) as specified in 30.121.1, and cover. Heat until dissolution is complete. Remove and rinse the cover glass; substitute a ribbed cover glass.
- 22.2.2 Evaporate until salts begin to separate; at this point evaporate the solution rapidly to the first appearance of fumes and fume strongly for 22 min to 3 min. Cool sufficiently, and add 100 mL of water (40 °C to 50 °C). Stir to dissolve the salts and heat, if necessary, but do not boil. Proceed immediately as directed in 31.622.4.
- 22.3 <u>PerchloricHClO₄</u> Acid <u>Dehydration: Dehydration—if tungsten is less than 0.5 % or use 22.2. (Warning—See Practices E60 for details pertaining to the special hazards associated with the use of HClO₄.)</u>
- 22.3.1 Add amounts of HCl or HNO₃, or mixtures and dilutions of these acids, which are sufficient to dissolve the sample, and cover. Heat until dissolution is complete. Add HNO₃ to provide a total of 35 mL to 40 mL, followed by HClO₄ as specified in the table in 31.122.1. Remove and rinse the cover glass; substitute a ribbed cover glass.
- 22.3.2 Evaporate the solution to fumes and heat for <u>1515 min</u> to 20 min at such a rate that the HClO₄ refluxes on the sides of the container. Cool sufficiently and add 100 mL of water (40 °C to 50 °C). Stir to dissolve the salts and heat to boiling. If the sample solution contains more than 100 mg of chromium, add, while stirring, 1 mL of tartaric acid solution for each 25 mg of chromium.
- 22.4 Add paper pulp and filter immediately, on a low-ash 11-cm medium-porosity filter paper. Collect the filtrate in a 600-mL beaker. Transfer the precipitate to the paper, and scrub the container thoroughly with a rubber-tipped rod. Wash the paper and precipitate alternately with 3-mL to 5-mL portions of hot HCl (1 + 19) and hot water until iron salts are removed but for not more than a total of ten washings. If $\frac{31.322.3}{21.322.3}$ was followed, wash the paper twice more with $\frac{1}{2}$ SO₄ (1 + 49), but do not collect these washings in the filtrate; discard the washings. Transfer the paper to a platinum crucible and reserve.
- 22.5 Add 15 mL of HNO₃ to the filtrate, stir, and evaporate as directed either in $\frac{31.222.2}{20.2}$ or $\frac{31.322.3}{20.2}$, depending upon the dehydrating acid used. Filter immediately, using a low-ash 9-cm 100-porosity filter paper, and wash as directed in $\frac{31.622.4}{20.2}$.
- 22.6 Transfer the paper and precipitate to the reserved platinum crucible. Dry the papers and then heat the crucible at 600 °C until the carbon is removed. Finally ignite at 1100 °C to 1150 °C to constant weight (at least 30 min). Cool in a desiccator and weigh.
- 22.7 Add enough H_2SO_4 (1 + 1) to moisten the impure silica (SiO₂), and add 3 mL to 5 mL of HF. Evaporate to dryness and then heat at a gradually increasing rate until H_2SO_4 is removed. Ignite at $\frac{1100 \text{ °C}}{\text{C}}$ to $\frac{1150 \text{ °C}}{\text{C}}$ for $\frac{15 \text{ min}}{\text{C}}$, instead of $\frac{1100 \text{ °C}}{\text{C}}$ to $\frac{1150 \text{ °C}}{\text{C}}$ after volatilization of SiO₂, cool in a desiccator, and weigh.

23. Calculation

23.1 Calculate the percent of silicon as follows:

Silicon,
$$\% = [((A - B) \times 0.4674)/C] \times 100$$
 (3)

where:

A = initial weight of crucible and impure SiO₂, g,



B = final weight of crucible and residue, g, and

C = sample used, g.

24. Precision and Bias

24.1 Eleven laboratories cooperated in testing this test method and obtained the data summarized in Table 32. A sample with silicon concentration content near the upper limit of the scope was not available for testing.

24.2 *Bias*—No information on the bias of this test method is known. The bias of this test method may be judged by comparing accepted reference values with the corresponding arithmetic average obtained by interlaboratory testing. data are presently available to determine the accuracy of this method.

COBALT BY THE ION-EXCHANGE-POTENTIOMETRIC TITRATION METHOD

25. Scope

25.1 This test method covers the determination of cobalt in concentrations from 2 % to 75 %.

26. Summary of Test Method

26.1 Cobalt is separated from interfering elements by selective elution from an anion-exchange column using hydrochloric acid. HCl. The cobalt is oxidized to the trivalent state with ferricyanide, and the excess ferricyanide is titrated potentiometrically with cobalt solution.

27. Interferences

27.1 The elements ordinarily present do not interfere if their concentrations contents are under the maximum limits shown in 1.1.

28. Apparatus

28.1 *Ion-Exchange Column*, approximately 25 mm in diameter and 300 mm long, in length, the length in length, the length in l

28.2 Apparatus for Potentiometric Titrations—Instruments for detecting the end points in pH (acid-base), oxidation-reduction, precipitation; and complexation titrations consist of a pair of suitable electrodes, a potentiometer, a buret, and a motor-driven stirrer. Titrations are based on the fact that when two dissimilar electrodes are placed in a solution there is a potential difference between them. This potential difference depends on the composition of the solution and changes as the titrant is added. A high-impedance electronic voltmeter follows the changes accurately. The end point of the titration may be determined by adding the titrant until the potential difference attains a predetermined value or by plotting the potential difference versus the titrant volume, the titrant being added until the end point has been passed.

28.2.1 An elaborate or highly sensitive and accurate potentiometer is not necessary for potentiometric titrations because the absolute cell voltage needs to be known only approximately, and variations of less than 1 MV are not significant. Such instruments should have a range of about 1.5 V and a readability of about 1 MV. Many of the pH meters satisfying the requirements for Apparatus No. 3A pH meters are also suitable for potentiometric titrations.

28.2.2 The electrode system must consist of a reference electrode and an indicator electrode. The reference electrode maintains a constant, but not necessarily a known or reproducible potential during the titration. The potential of the indicator electrode does change during the titration; further, the indicator electrode must be one that will quickly come to equilibrium. In this procedure a platinum indicator electrode and a saturated calomel reference electrode are appropriate.

28.3 Apparatus No. 3B, with a platinum Platinum and a saturated calomel electrode electrodes.

29. Reagents

- 29.1 Ammonium Citrate Solution (200 g/L)g/L).—Dissolve 200 g of di-ammonium hydrogen citrate in water and dilute to 1 L.
- 29.2 Cobalt, Standard Solution (1 mL = 1.5 mg of Co)—: Reagent No. 25B in Practices E50.



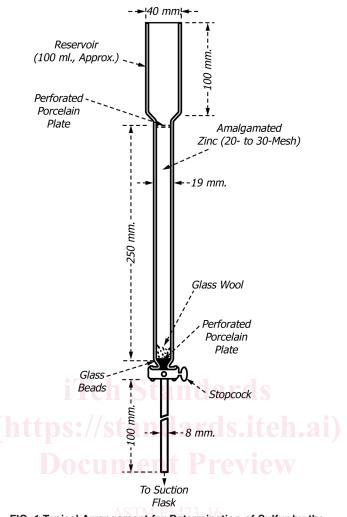


FIG. 1 Typical Arrangement for Determination of Sulfur by the sylvatandards iteh pi/catalog/star Direct-Combustion Method Jones Reductor 42-1a127(08c8cd/astm-e1473-16

29.2.1 Dry a weighing bottle in an oven at 130 °C for 1 h, cool in a desiccator, and weigh. Transfer 3.945 g of cobalt sulfate $(CoSO_4)^6$ that has been heated at 550 °C for 1 h to the weighing bottle. Dry the bottle and contents at 130 °C for 1 h, cool in desiccator, stopper the bottle, and weigh. The difference in weight is the amount of $CoSO_4$ taken. Transfer the weighed $CoSO_4$ to a 400-mL beaker, rinse the weighing bottle with water, and transfer the rinsings to the beaker. Add 150 mL of water and 20 mL of HNO₃, and heat to dissolve the salts. Cool, transfer to a 1-L volumetric flask, dilute to volume, and mix.

Preparation—Dry a weighing bottle in an oven at $130\,^{\circ}\text{C}$ for 1 h, cool in a desiccator, and weigh. Transfer $3.945\,\text{g}$ of cobalt sulfate $(\text{CoSO}_4)^6$ that has been heated at $550\,^{\circ}\text{C}$ for 1 h to the weighing bottle. Dry the bottle and contents at $130\,^{\circ}\text{C}$ for 1 h, cool in desiccator, stopper the bottle, and weigh. The difference in weight is the amount of CoSO_4 taken. Transfer the weighed CoSO_4 to a 400-mL beaker, rinse the weighing bottle with water, and transfer the rinsings to the beaker. Add $150\,\text{mL}$ of water and $20\,\text{mL}$ of HNO₃, and heat to dissolve the salts. Cool, transfer to a 1-L volumetric flask, dilute to volume, and mix.

29.2.2 Standardization—Calculate the cobalt concentration as follows:

Cobalt, mg/mL = weight of $CoSO_4$, g, $\times 0.38026$

Standardization—Calculate the cobalt concentration as follows:

Cobalt, mg/mL = weight of CoSO₄, g, \times 0.38026

29.3 Ion-Exchange Resin:⁷

29.3.1 Use an anion exchange resin of the alkyl quaternary ammonium type (chloride form) consisting of spherical beads having a nominal crosslinkage of 8 %, and 200200-nominal to 400 nominal400-nominal mesh size. To remove those beads greater than about 180 µm in diameter as well as the excessively fine beads, treat the resin as follows: Transfer a supply of the resin to a beaker, cover with water, and allow sufficient time (at least 30 min) for the beads to undergo maximum swelling. Place a No. 80 (180-µm)

⁶ Cobalt sulfate (99.9 % minimum) prepared from the hexamine salt by G. Frederick Smith Chemical Co., Columbus, OH, is satisfactory for this purpose.

⁷ Available from the Dow Chemical Co., Midland, MI.