



Designation: D3944 – 12 (Reapproved 2017)

Standard Test Method for Solidification Point of Petroleum Wax¹

This standard is issued under the fixed designation D3944; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1 This test method covers a procedure for rapidly determining the solidification point of petroleum wax.

NOTE 1—This test method is also applicable to similar materials such as synthetic waxes but the precision may vary.

1.2 The values stated in SI units are to be regarded as the standard.

1.2.1 *Exception*—The values given in parentheses are for information only

1.3 *This standard does not purport to address all of the safety problems, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

1.4 *This international standard was developed in accordance with internationally recognized principles on standardization established in the Decision on Principles for the Development of International Standards, Guides and Recommendations issued by the World Trade Organization Technical Barriers to Trade (TBT) Committee.*

2. Referenced Documents

- 2.1 *ASTM Standards:*²
- D87 Test Method for Melting Point of Petroleum Wax (Cooling Curve)
 - D127 Test Method for Drop Melting Point of Petroleum Wax, Including Petrolatum
 - D938 Test Method for Congealing Point of Petroleum Waxes, Including Petrolatum
 - E1 Specification for ASTM Liquid-in-Glass Thermometers

3. Terminology

3.1 *Definitions of Terms Specific to This Standard:*

¹ This test method is under the jurisdiction of ASTM Committee D02 on Petroleum Products, Liquid Fuels, and Lubricants and is the direct responsibility of Subcommittee D02.10 on Properties of Petroleum Waxes and Alternative Wax-like Materials.

Current edition approved June 1, 2017. Published July 2017. Originally approved in 1980. Last previous edition approved in 2012 as D3944 – 12. DOI: 10.1520/D3944-12R17.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

3.1.1 *solidification point of petroleum wax, n*—that temperature in the cooling curve of the wax where the slope of the curve first changes significantly as the wax sample changes from a liquid to a solid state.

4. Summary of Test Method

4.1 A 50 mg sample of wax is placed in a test tube at ambient temperature and heated above the solidification point of the wax sample. A thermocouple probe, attached to a recorder, is inserted into the wax sample, which is allowed to cool at room temperature. The thermocouple response of the cooling wax traces a curve on the chart paper of the recorder. The first significant change in the slope of the curve is the solidification point.

5. Significance and Use

5.1 The related methods of determining the melt point of petroleum wax are relatively time-consuming. This method endeavors to reduce the duration of testing significantly and at the same time maintain a reasonable precision. This method can be useful for quality control of petroleum waxes as well as research and product development work on these waxes.

5.2 For methods used for testing melt points of petroleum waxes, see Tests Method D87, D127, including Petrolatum and Test Method D938.

6. Apparatus

6.1 *Thermocouple*, with an iron-constantan junction.³

6.2 *Recorder*, capable of recording voltage and equipped with a time-base module. The recorder should have the following minimum specifications:

6.2.1 *Span*, 0 mV to 10 mV or other suitable ranges.

6.2.2 *Accuracy*, 0.25 % of full scale.

³ Suitable thermocouples are available from: Claud S. Gordon Co., 5710 Kenosha St., Richmond, IL 60071, (815) 678-2211. For "J" (iron-constantan) junction the following is suitable: Xactpak Type MM Assembly, Catalog No. 402-1101.

Junction: grounded (G)
Transition fitting: TH 2780-020
Thermocouple wire: J30-1-305
L (length of metal sheath)
E (lead length): specify length desired.

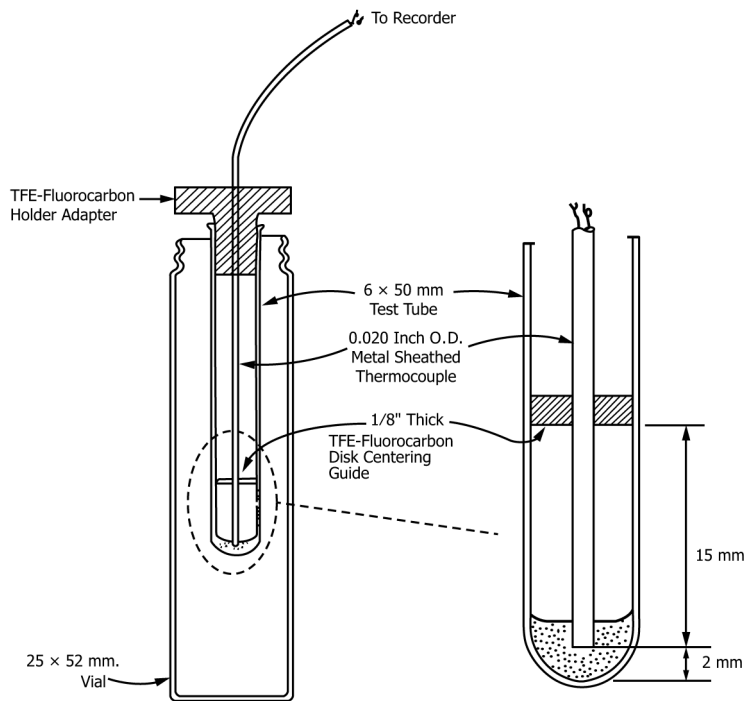


FIG. 1 Solidification Point Apparatus

6.2.3 *Step Response Time*, 1 s full scale, 3 s full scale is also appropriate.

6.2.4 *Zero Junction/Reference Junction/Temperature Compensated Junction*—Must be included.

6.3 *TFE-Fluorocarbon Holder Adapter*—See Fig. 1 and Fig. 2.⁴

6.4 *TFE-Fluorocarbon Disk Centering Guide*—See Fig. 1 and Fig. 2.⁴

6.5 *Test Tubes*, 6 mm by 50 mm.

6.6 *Vial*, 25 mm by 52 mm.

6.7 *Apparatus for Calibrating Temperature Recorder:*

6.7.1 *Stainless Steel Beaker*, 1000 mL.

6.7.2 *Heating Mantle*, to fit 6.7.1.

6.7.3 *Autotransformer* to control heat to 6.7.2.

6.7.4 *Variable-Speed-Stirrer*.

6.7.5 *Thermometer*, or other temperature measuring device, as specified in A1.1.

6.8 *Methods for Heating Specimen:*

6.8.1 *Hot Air Blower* at 1000 W, 1200 W, or other suitable power. This could be a laboratory or a household hair dryer type.

6.8.2 *Aluminum Heating Block*, about 50 mm by 50 mm by 50 mm. In the center of one face of the block, a hole is made 7 mm in diameter and 37 mm deep to accommodate a 6 mm by 50 mm test tube and another hole adjacent to it to accommodate a 110 V, 30 W cartridge heater, about 9 mm by 38 mm, commercially available (see Fig. 2).

6.8.2.1 *Autotransformer*, to control heat in 6.8.2.

⁴ Not commercially available and hence must be made in a machine shop or elsewhere.

7. Procedure

7.1 Calibrate the recorder at least every 60 days when in frequent use (see Annex A1).

7.2 Obtain a wax sample representative of the material to be tested.

7.3 Using a balance accurate to at least 1 mg, weigh 50 mg \pm 5 mg of sample by putting a few tiny pieces of solid wax into a tared 6 mm by 50 mm test tube.

7.4 Start the temperature recorder. A horizontal pen speed of about 150 mm (5 in.)/10 min for a X-Y recorder or a chart speed of about 150 mm (5 in.)/10 min for a strip chart recorder is usually appropriate.

7.5 Heat the sample by any convenient method, such as by use of:

7.5.1 A hot air blower.

7.5.2 An aluminum heating block.

7.6 When using any method of heating a sample, note that the wax absorbs heat slowly. Hence caution must be used not to overheat the surface near the heating medium. Overheated wax can degrade. A minute amount of degradation affects results.

7.7 When the sample melts, insert the thermocouple probe into the melted wax.

7.8 Let the wax sample temperature rise 10 °C to 15 °C above the expected solidification point.

7.9 Transfer the 6 mm by 50 mm test tube, together with its heated specimen, from the heating medium to a 25 mm by 52 mm vial which acts as a cooling chamber (See Fig. 1).

7.10 Let the specimen cool until the curve traced by the cooling wax on the recorder chart paper levels off.