
**Paper and board — Determination of air
permeance (medium range) —**

**Part 4:
Sheffield method**

*Papier et carton — Détermination de la perméance à l'air (valeur
moyenne) —*

iTeh STANDARD PREVIEW
Partie 4: Méthode Sheffield
(standards.iteh.ai)

ISO 5636-4:2005

<https://standards.iteh.ai/catalog/standards/sist/60add8d6-3845-45f3-85a5-89a54ff2d5a6/iso-5636-4-2005>



PDF disclaimer

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

iTeh STANDARD PREVIEW
(standards.iteh.ai)

[ISO 5636-4:2005](https://standards.iteh.ai/catalog/standards/sist/60add8d6-3845-45f3-85a5-89a54ff2d5a6/iso-5636-4-2005)

<https://standards.iteh.ai/catalog/standards/sist/60add8d6-3845-45f3-85a5-89a54ff2d5a6/iso-5636-4-2005>

© ISO 2005

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Case postale 56 • CH-1211 Geneva 20
Tel. + 41 22 749 01 11
Fax + 41 22 749 09 47
E-mail copyright@iso.org
Web www.iso.org

Published in Switzerland

Contents

Page

Foreword	iv
Introduction	v
1 Scope	1
2 Normative references	1
3 Terms and definitions	1
4 Principle	2
5 Apparatus	2
6 Sampling	3
7 Conditioning	3
8 Preparation of test pieces	4
9 Calibration	4
9.1 Variable-area flow-measuring device	4
9.2 Electronic flow-measuring device	4
10 Procedure	4
10.1 Test atmosphere	4
10.2 Determination of air flow rate	4
11 Calculation and expression of results	5
11.2 Calculation of air permeance	5
11.3 Standard deviation	5
12 Test report	5
Annex A (normative) Care and maintenance of the test instrument using variable-area flowmeters	6
Annex B (normative) Calibration of flowmeters	7
Annex C (informative) Conversion table	11
Bibliography	12

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 5636-4 was prepared by Technical Committee ISO/TC 6, *Paper, board and pulps*, Subcommittee SC 2, *Test methods and quality specifications for paper and board*.

This second edition cancels and replaces the first edition (ISO 5636-4:1986), which has been technically revised.

ISO 5636 consists of the following parts, under the general title *Paper and board — Determination of air permeance (medium range)*:

- *Part 1: General method*
- *Part 2: Schopper method*
- *Part 3: Bendtsen method*
- *Part 4: Sheffield method*
- *Part 5: Gurley method*

iTeh STANDARD PREVIEW
(standards.iteh.ai)
<https://standards.iteh.ai/catalog/standards/sist/60add8d6-3845-45f3-85a5-89a54ff2d5a6/iso-5636-4-2005>

Introduction

Basic requirements and general operating procedures for the determination of air permeance are given in ISO 5636-1 (see [1] in the Bibliography). Other parts of ISO 5636 specify detailed requirements and operating procedures applicable to other types of apparatus. Since all these methods determine the air flow rate through a specified area under a specified pressure difference when the test piece is clamped to avoid lateral surface leakage, they should in principle give the same result.

iTeh STANDARD PREVIEW (standards.iteh.ai)

[ISO 5636-4:2005](https://standards.iteh.ai/catalog/standards/sist/60add8d6-3845-45f3-85a5-89a54ff2d5a6/iso-5636-4-2005)

<https://standards.iteh.ai/catalog/standards/sist/60add8d6-3845-45f3-85a5-89a54ff2d5a6/iso-5636-4-2005>

iTeh STANDARD PREVIEW
(standards.iteh.ai)

ISO 5636-4:2005

<https://standards.iteh.ai/catalog/standards/sist/60add8d6-3845-45f3-85a5-89a54ff2d5a6/iso-5636-4-2005>

Paper and board — Determination of air permeance (medium range) —

Part 4: Sheffield method

1 Scope

This part of ISO 5636 specifies a method of determining the air flow rate through unit area of a sheet of paper or board, under unit pressure difference using apparatus called the Sheffield instrument.

The method is applicable to papers and boards having air permeances between 0,02 $\mu\text{m}/(\text{Pa}\cdot\text{s})$ and 25 $\mu\text{m}/(\text{Pa}\cdot\text{s})$. The method is not suitable for papers and boards with a rough surface, such as crêpe paper and corrugated papers, which cannot be securely clamped to avoid surface leakage.

iTeh STANDARD PREVIEW

2 Normative references (standards.iteh.ai)

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies. <https://standards.iteh.ai/standards/sist/60add8d6-3845-45f3-85a5-89a54ff2d5a6/iso-5636-4-2005>

ISO 186, *Paper and board — Sampling to determine average quality*

ISO 187, *Paper, board and pulps — Standard atmosphere for conditioning and testing and procedure for monitoring the atmosphere and conditioning of samples*

ISO 11605, *Paper and board — Calibration of variable-area flowmeters*

3 Terms and definitions

For the purposes of this document, the following terms and definitions apply.

3.1

air permeance

mean air flow rate through unit area under unit pressure difference in unit time, under specified conditions

NOTE 1 Air permeance is expressed in micrometres per pascal second [$1 \text{ ml}/(\text{m}^2\cdot\text{Pa}\cdot\text{s}) = 1 \mu\text{m}/(\text{Pa}\cdot\text{s})$].

NOTE 2 This property is called air permeance, and not air permeability, because it is reported as a sheet property and is not normalized with respect to thickness to give a material property per unit thickness.


NOTE 3 The Sheffield unit is not defined, since it has been found that the scale units (Sheffield units) on different instruments can correspond to different air flows, and there is no precise physical definition. This part of ISO 5636 requires that the flowmeters be calibrated to give a flow rate in millilitres per minute.

4 Principle

A test piece is clamped between two rubber orifice plates of known dimensions, with the absolute air pressure on one side of the test piece equivalent to atmospheric pressure and the difference in pressure between the two sides of the piece maintained at a small but substantially constant value. The air flow rate through the test area is determined and the air permeance is calculated.

5 Apparatus

The apparatus, see Figure 1 for an example of one type of instrument, shall consist of an air supply, an air-pressure control and an air-flow-measuring device, and a test assembly which houses a measuring head in which the test piece can be securely clamped.

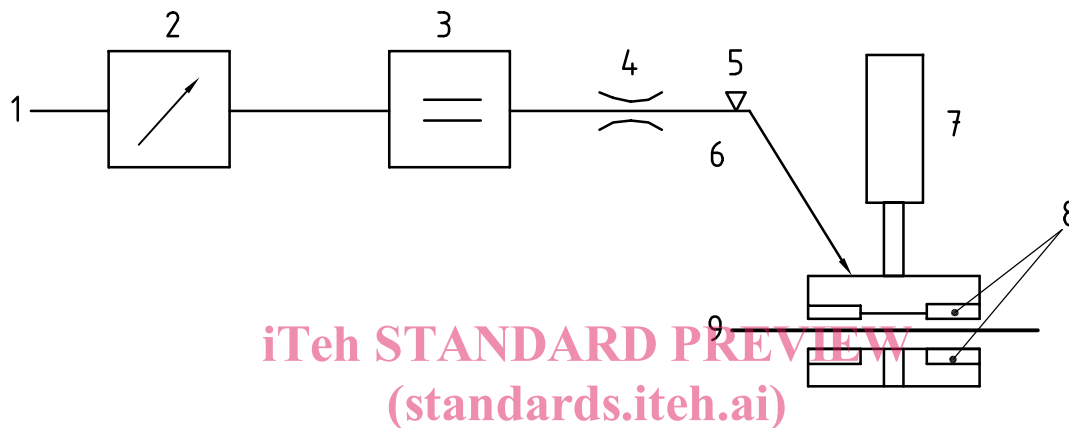

Key

- 1 air supply
- 2 pressure regulator
- 3 flow-measuring device
- 4 flow impedance
- 5 shut-off valve
- 6 measurement air
- 7 clamping air pressure
- 8 orifice plates
- 9 test piece

ISO 5636-4:2005
<https://standards.iteh.ai/catalog/standards/sist/60add8d6-3845-45f3-85a5-89a54ff2d5a6/iso-5636-4-2005>

Figure 1 — Principles of operation of one type of apparatus

5.1 Air supply, free from water, oil and other contaminants, at a pressure of 420 kPa to 950 kPa. A small compressor using laboratory air is preferred to external compressed air.

5.2 Pressure-regulating device, to reduce the pressure to the nominal pressure at the measuring head of 10,3 kPa (variable-area flow-measuring devices) or 9,85 kPa (electronic flow-measuring devices).

5.3 Pressure manometer, with a suitable range to enable the air pressure at the measuring head to be set to the specified pressure within 2 % of the nominal value.

5.4 Flow-measuring device, of either a variable-area or an electronic type, for measuring the air flow rate to the measuring head. The air flow rate shall be measurable to an accuracy of ± 5 % of the measured value.

5.4.1 Variable-area flow-measuring device, consisting of three variable-area flowmeters each having a tapered glass column containing a metering float suspended by the air flow in the column (see ISO 5636-1^[1]). The three columns shall be chosen with dimensions such that they enable measurements to be made on a continuous scale of flow rate from 10 ml/min to 3 000 ml/min, with some overlap of scales between columns. Each column shall be provided with a means of adjusting the flow rate (float-position knob) and a means of span calibration (calibrating knob). This type of instrument shall operate at a supply pressure of 10,3 kPa.

At air flow rates greater than 1 200 ml/min, the pressure drop in the Sheffield system is substantial. To ensure reproducibility of results, it is necessary that the tubing used to connect the flowmeter to the measuring head be carefully controlled with a length of $1,50 \text{ m} \pm 0,01 \text{ m}$ and an internal diameter of $6,25 \text{ mm} \pm 0,25 \text{ mm}$. For the same reason, openings in valves and other fittings on the instrument must not be changed from those provided by the instrument manufacturer.

5.4.2 Electronic flow-measuring device, for measuring the air flow to the measuring head. The inlet pressure to the measurement device shall be controlled at 9,85 kPa.

NOTE The 9,85 kPa pressure is the typical pressure measured downstream of variable-area flow tubes that have been calibrated using the air bleeds (zero and span-adjustment) to the atmosphere.

5.5 Test piece clamping device (test assembly), incorporating a detachable measuring head with a set of rubber orifice plates to provide a test area of $283,5 \text{ mm}^2$ (19 mm diameter), constructed so that a test piece can be clamped between the orifice plates.

NOTE Additional sets of orifice plates may be available for the following four optional test areas:

- 71 mm^2 (9,5 mm diameter);
- $1\,135 \text{ mm}^2$ (38 mm diameter);
- $2\,550 \text{ mm}^2$ (57 mm diameter);
- $4\,540 \text{ mm}^2$ (76 mm diameter);

but the use of these test areas is not in accordance with this part of ISO 5636. Doubling the test area does not necessarily double the air flow, since the specific design of the instrument means that the pressure difference is affected by the test area.

5.6 Flat non-porous plate, of approximate dimensions $100 \text{ mm} \times 100 \text{ mm}$, which can be clamped between the rubber orifice plates to check the zero reading.

5.7 Calibration plate device, to enable the test assembly to be connected to an external calibration system (see Clause 9 and Annex B).

6 Sampling

Sampling is not included in this part of ISO 5636. If the mean quality of a lot is to be determined, sampling shall be carried out in accordance with ISO 186. If the tests are made on another type of sample, make sure that the test pieces taken are representative of the sample received.

7 Conditioning

Condition the samples in accordance with ISO 187.

8 Preparation of test pieces

Prepare the test pieces in the same atmospheric conditions as were used to condition the samples.

Cut not less than ten test pieces, each at least 15 mm larger in both dimensions than the diameter of the circular orifice of the rubber plate to be used, and identify their two sides, for example top side and bottom side. The test area shall be free from folds, wrinkles, holes, watermarks or defects not inherent in the sample. Do not handle the part of the test piece which will become the test area.

9 Calibration

9.1 Variable-area flow-measuring device

Calibrate the instrument against an external flow-measuring device as described in B.1, and prepare a calibration graph or chart as described in B.2.

Calibrate the instrument sufficiently frequently to ensure that the reading does not deviate at any time by more than $\pm 5\%$ from the true value.

9.2 Electronic flow-measuring device

Carry out the internal adjustment of the flowmeter according to the manufacturer's instructions. Check the calibration of the instrument against an external flow-measuring device as described in B.1.

10 Procedure

10.1 Test atmosphere <https://standards.iteh.ai/catalog/standards/sist/60add8d6-3845-45f3-85a5-89a54ff2d5a6/iso-5636-4-2005>

Carry out all testing under the same atmospheric conditions as those used to condition the sample in accordance with ISO 187.

10.2 Determination of air flow rate

10.2.1 Make sure that the instrument is level on a surface free from vibrations. Check that the air pressure to the measuring head is correct (see 5.4.1 or 5.4.2). Check that the air flow reading obtained with the non-porous plate (see 5.6) clamped in the measurement gap is zero.

Apply the internal adjustment procedure described in the manufacturer's instructions frequently if the instrument is being used for long periods (at least twice in an 8 h day), and whenever the air supply to the instrument is interrupted.

NOTE For daily use, it is preferable to leave the air supply on in order to minimize the drifts in the regulator.

10.2.2 Place a test piece in the measuring gap and measure the air flow rate in accordance with the manufacturer's instructions. Record the result.

All papers are hygro-sensitive to some degree, and readings should be taken at the initial stabilization point to avoid any possible effect of the incoming air adding moisture to, or extracting moisture from, the test piece.

10.2.3 Test the remaining test pieces by the same method, ensuring that, in half the tests, the top side of the test piece faces the direction of air flow, and in the other half, the bottom side of the test piece faces the direction of air flow.

11 Calculation and expression of results

11.1 If the instrument provides readings in “Sheffield units”, convert each reading to an air flow rate in millilitres per minute, using the calibration chart or graph prepared as described in B.2.

11.2 Calculation of air permeance

Calculate the mean air flow rate, q . Convert the results to give the air permeance, P , of the sample, in micrometres per pascal second, using the formula

$$P = 1,62 \times \frac{q}{A} \quad (1)$$

where

q is the average air flow rate, expressed in millilitres per minute, to three significant figures;

A is the area, in square millimetres, of the test piece exposed by the rubber orifice plates.

NOTE The constant 1,62 in this equation is based on the supply pressure of 10,3 kPa used in the flow tube instruments.

If there is a difference of more than 10 % between mean results for the two directions of air flow through the test piece, calculate a separate result for each direction.

iTeh STANDARD PREVIEW
(standards.iteh.ai)

11.3 Standard deviation

Calculate the standard deviation or coefficient of variation of replicate tests.

[ISO 5636-4:2005](https://standards.iteh.ai/catalog/standards/sist/60add8d6-3845-45f3-85a5-89a54ff2d5a6/iso-5636-4-2005)

<https://standards.iteh.ai/catalog/standards/sist/60add8d6-3845-45f3-85a5-89a54ff2d5a6/iso-5636-4-2005>

12 Test report

The test report shall include the following information:

- a) a reference to this part of ISO 5636;
- b) date and place of testing;
- c) all the information necessary for complete identification of the sample;
- d) the make and model number of the instrument, and if appropriate, the flowmeter, used;
- e) the number of test pieces tested,
- f) the mean air permeance(s), in micrometres per pascal second, to three significant figures;
- g) the standard deviation or coefficient of variation (as detailed in 11.2);
- h) any deviation from the specified procedure which may have affected the result.