
**Textiles — Determination of the slippage
resistance of yarns at a seam in woven
fabrics —**

**Part 3:
Needle clamp method**

iTeh STANDARD PREVIEW

*Textiles — Détermination de la résistance au glissement des fils de
couture dans les tissus —*

(standards.iteh.ai)

Partie 3: Méthode de la griffe

[ISO 13936-3:2005](https://standards.iteh.ai/catalog/standards/sist/dc0cc5e4-6c1a-448a-9fa1-bdbc1e3d1457/iso-13936-3-2005)

<https://standards.iteh.ai/catalog/standards/sist/dc0cc5e4-6c1a-448a-9fa1-bdbc1e3d1457/iso-13936-3-2005>



PDF disclaimer

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

iTeh STANDARD PREVIEW
(standards.iteh.ai)

[ISO 13936-3:2005](https://standards.iteh.ai/catalog/standards/sist/dc0cc5e4-6c1a-448a-9fa1-bdbc1e3d1457/iso-13936-3-2005)

<https://standards.iteh.ai/catalog/standards/sist/dc0cc5e4-6c1a-448a-9fa1-bdbc1e3d1457/iso-13936-3-2005>

© ISO 2005

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Case postale 56 • CH-1211 Geneva 20
Tel. + 41 22 749 01 11
Fax + 41 22 749 09 47
E-mail copyright@iso.org
Web www.iso.org

Published in Switzerland

Contents

Page

Foreword.....	iv
1 Scope	1
2 Normative references	1
3 Terms and definitions	1
4 Principle	2
5 Apparatus and materials	2
6 Atmosphere for conditioning and testing	3
7 Sampling and preparation of test specimens	3
8 Test procedure	5
9 Calculation and expression of results	6
10 Test report	8
Annex A (informative) Suggested procedure for sampling	9
Annex B (informative) Example of pattern for cutting out test specimens from the laboratory samples	10
Annex C (informative) Alternative procedure for apparel fabrics	11
Bibliography	12

<https://standards.iteh.ai/catalog/standards/sist/dc0cc5e4-6c1a-448a-9fa1-bdbc1e3d1457/iso-13936-3-2005>

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 13936-3 was prepared by Technical Committee ISO/TC 38, *Textiles*, Subcommittee SC 24, *Conditioning atmospheres and physical tests for textile fabrics*.

ISO 13936 consists of the following parts, under the general title *Textiles — Determination of the slippage resistance of yarns at a seam in woven fabrics*:

— *Part 1: Fixed seam opening method*

— *Part 2: Fixed load method*

— *Part 3: Needle clamp needle*

iTeh STANDARD PREVIEW
(standards.iteh.ai)

[ISO 13936-3:2005](https://standards.iteh.ai/catalog/standards/sist/dc0cc5e4-6c1a-448a-9fa1-bdbc1e3d1457/iso-13936-3-2005)

<https://standards.iteh.ai/catalog/standards/sist/dc0cc5e4-6c1a-448a-9fa1-bdbc1e3d1457/iso-13936-3-2005>

Textiles — Determination of the slippage resistance of yarns at a seam in woven fabrics —

Part 3: Needle clamp method

1 Scope

This part of ISO 13936 describes a method for the determination of the resistance offered by the yarns of a woven fabric to slippage while being held in a needle clamp under conditions of stress.

This method provides a means to negate variations introduced by seam preparation or sewing thread variation that can have a marked influence on test results.

This method is not applicable to stretch fabrics or for industrial fabric, e.g. beltings.

2 Normative references **(standards.iteh.ai)**

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 139, *Textiles — Standard atmospheres for conditioning and testing*

ISO 7500-1, *Metallic materials — Verification of static uniaxial testing machines — Part 1: Tension/compression testing machines — Verification and calibration of the force-measuring system*

ISO 10012-1, *Quality assurance requirements for measuring equipment — Part 1: Metrological confirmation system for measuring equipment*

3 Terms and definitions

For the purposes of this document, the following terms and definitions apply.

3.1

constant rate-of-extension testing machine

tensile testing machine having one clamp fixed whilst the other is moving with a constant speed throughout the test where the entire testing system is virtually free from deflection

3.2

strip test

tensile test for which the full width of the test specimen is gripped in the jaws

3.3 yarn slippage
movement in a woven fabric of weft yarns over warp yarn (or warp yarns over weft yarns) as a result of a pulling action

NOTE Seam slippage is a fabric property not to be confused with seam strength.

3.4 warp slippage
slipping of warp yarns over weft yarns, during which the warp yarns are at right angles to the direction of pull

3.5 weft slippage
slipping of weft yarns over warp yarns, during which the weft yarns are at right angles to the direction of pull

3.6 gauge length
distance between the two effective clamping points of the testing device

4 Principle

A pinned and an unpinned test specimen are separately extended by using a tensile testing machine fitted with a needle-clamping device for the pinned specimen and conventional jaws for the unpinned specimen, to produce, in the case of the use of a chart recorder, two force/extension curves originating from the same abscissa. The yarn slippage, expressed in millimetres, is determined by comparing the two curves at specified force applications.

(standards.iteh.ai)

5 Apparatus and materials

ISO 13936-3:2005

<https://standards.iteh.ai/catalog/standards/sist/dc0cc5e4-6c1a-448a-9fa1-entire/iso-13936-3-2005>

5.1 CRE machine, having the following general characteristics.

- a) The tensile-testing machine shall be provided with a means for indicating or recording both the maximum force applied to the test specimen in stretching it to rupture and the corresponding extension of the test specimen.
- b) Under conditions of the use, the accuracy of the apparatus shall be at least class 1 in accordance with ISO 7500-1. The error of indicated or recorded maximum force at any point in the range in which the machine is used shall not exceed $\pm 1\%$, and the error of the indicated or recorded jaw separation shall not exceed ± 1 mm.
- c) If recording of force and elongation is obtained by means of data acquisition boards and software, the frequency of data collection shall be at least 8 per second. If the machine is not equipped with data acquisition boards and applicable software, a chart recorder is necessary.
- d) The machine shall be capable of constant rates of extension of 50 mm/min \pm 5 mm/min (and 20 mm/min \pm 2 mm/min).
- e) The machine shall be capable of gauge lengths of (100 ± 1) mm and (20 ± 1) mm.
- f) Metrological confirmation of tensile testing machine shall be in accordance with ISO 10012-1.

5.2 Needle-clamp clamping device, with a row of needles on one side and corresponding holes on the other as shown in Figure 1.

The number and characteristics of these needles depend on the application of the fabrics as given in Table 1.

Table 1 — Number and characteristics of needle-clamp needles for different fabrics

Criteria	Apparel fabrics	Furnishing and upholstery fabrics
Number of needles per 5 cm width	17	7
Diameter of the needle shank (mm)	0,5 ± 0,03	0,9 ± 0,03
Space between axes of adjacent needles (mm)	2,5 ± 0,1	7,0 ± 0,1
Needle height (mm)	8,0 ± 0,1	8,0 ± 0,1
Type of needle	round point	round point

The stop position (see Figures 1 and 2) for apparel fabrics is different from that for furnishing and upholstery fabrics to ensure the correct positioning of the test specimen.

5.3 Conventional-jaws clamping device, having the central point of the two jaws of the machine in the line of pull, the front edges at right angles to the line of pull and their clamping faces in the same plane.

The jaws shall be capable of holding the test specimen without allowing it to slip, and shall be designed so that they do not cut or otherwise weaken the test specimen. The faces of the jaws shall be smooth and flat, except if, even with packing, the test specimen cannot be held satisfactorily with flat-faced jaws or rubber-faced jaws; in these cases, engraved or corrugated jaws shall be used. Suitable packing materials for use with either smooth or corrugated jaws include paper, leather, plastics or rubber sheet.

The jaw faces should preferably have a width of at least 60 mm but shall be not less than the width of the test specimen.

5.4 Equipment for cutting test specimens and fraying them to obtain the required width.

6 Atmosphere for conditioning and testing

The standard atmosphere for conditioning and testing textiles shall be as specified in ISO 139.

7 Sampling and preparation of test specimens

7.1 Sampling


Select samples either in accordance with the procedure laid down in the material specifications for the fabric or as agreed between the interested parties. In case of the absence of specifications, an example sampling procedure is given in Annex A. An example of cutting test specimens from the laboratory sample is given in Annex B. Avoid test areas with folded or creased places, selvages and areas not representative of the fabric.

7.2 Preparation of test specimens

7.2.1 From each laboratory sample, cut two sets of 5 test specimens (300 mm long and 60 mm wide) 150 mm from the selvage, one set in the warp direction and the other in the weft direction.

7.2.2 Remove approximately the same number of threads from each of the long edges of the cut strip until the width of the test specimen is 50 mm.

7.2.3 Draw a reference line at half length of the test specimen and identify each end.

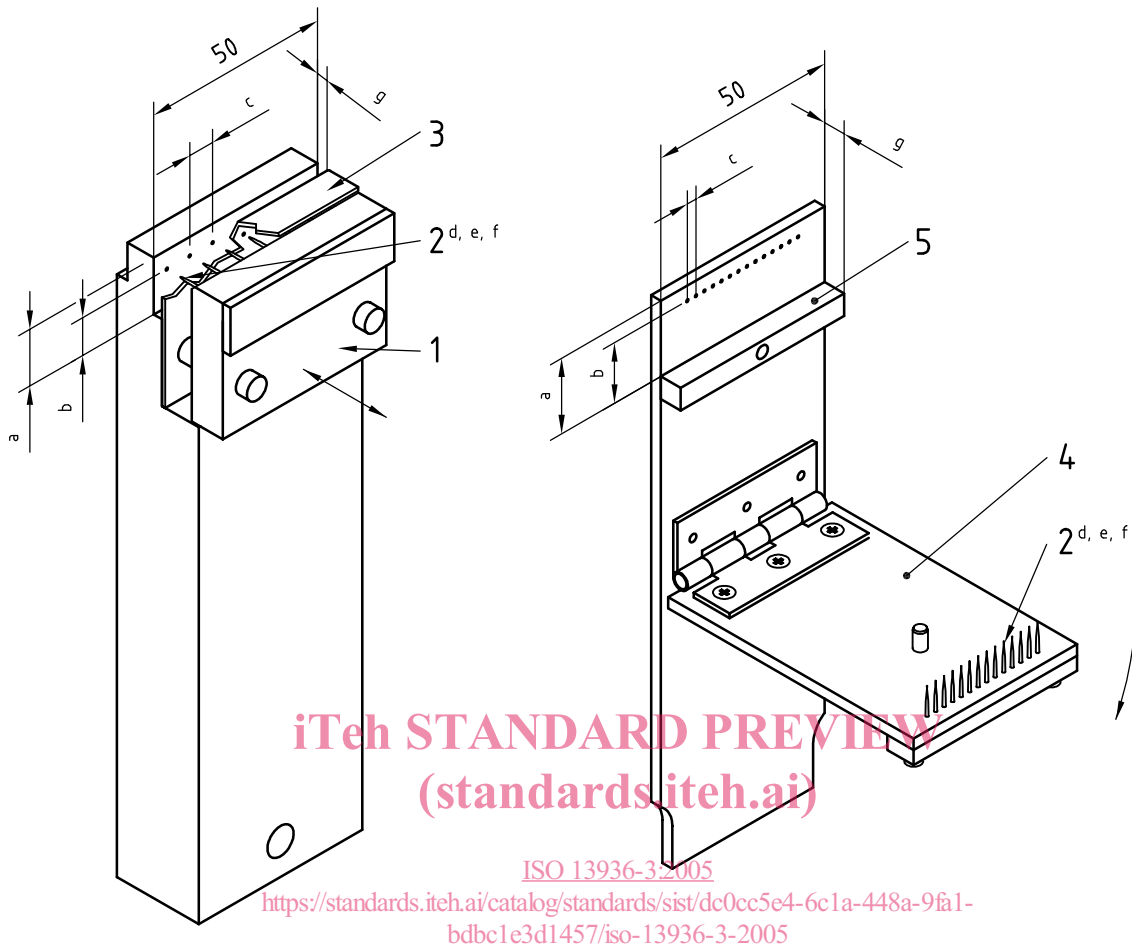

Key

- 1 moving jaw (moving jaw clamping and opening mechanism not shown)
- 2 needles^{d, e, f}
- 3 guard
- 4 hinged jaw
- 5 stop

Specifications of this part of ISO 13936:

Dimension or other characteristic	For furnishing and upholstery fabrics	For apparel fabrics
a Distance from stop to top edge of pin device (mm)	20 ± 0,5	15 ± 0,5
b Distance from stop to centre of pin line (mm)	15 ± 0,5	10 ± 0,5
c Distance between axes of adjacent needles (mm)	7 ± 0,1	2,5 ± 0,1
d Diameter of the needle base (mm)	0,9 ± 0,03	0,5 ± 0,03
e Needle height (mm)	8 ± 0,5	8 ± 0,5
f Number of needles	7	17
g Fabric slot width (mm)	2,25 ± 0,25	2,25 ± 0,25

Figure 1 — Diagram of needle bar clamp with specified dimensions and characteristics

8 Test procedure

Condition the test specimens for a minimum of 24 h in accordance with Clause 6.

Set the tensile testing machine to give a constant rate of traverse of (50 ± 5) mm/min.

Attach the two conventional clamps to the tensile testing machine.

Set the gauge length to (100 ± 1) mm.

Mount one end of the test specimen in the clamps as shown in Figure 2.

Set the moving clamp in motion, engage any device to record the force/extension curve and extend the test specimen until the force is equal to (250 ± 5) N.

Return the moving clamp to the original position and remove the specimen.

Place the needle clamp in the bottom jaw of the tensile testing machine (see Figure 1) or replace the conventional jaw by a needle clamp as described in Figure 1.

Move the clamps of the tensile testing machine until they are (100 ± 1) mm apart.

NOTE The gauge length is measured between the effective clamping point of the top jaw and the line of needles in the needle clamp.

Fasten the other end of the test specimen in the needle clamp by pressing the needles into the test specimen. The needles shall be parallel to the thread system across the width of the sample (see Figure 2).

The width of the test specimen shall lie parallel to the stop device. The positioning of the pins for the apparel fabric and the furnishing and upholstery fabric is defined in Figure 2.

Re-clamp the other end of test specimen in the top jaw in order to avoid a loose test specimen.

Put the moving clamp in motion, engage any device to record the force/extension curve and extend the test specimen until the force equals (250 ± 5) N.

The force of 250 N has been determined to result in a complete force/extension curve. A lower maximum force applied to the test specimen, depending on the type of fabrics, may be defined as follows:

- a) for apparel fabric (100 ± 5) N;
- b) for furnishing and upholstery fabric (200 ± 5) N.

Return the moving clamp to the original position.

Repeat the test procedure (Clause 8) with the remaining test specimens so that one pairs of curves is produced for each test specimen.