

Designation: D2658 - 04

Standard Test Method for Determining Interior Dimensions of Fiberboard Boxes (Box Gage Method)¹

This standard is issued under the fixed designation D2658; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ε) indicates an editorial change since the last revision or reapproval.

1. Scope

- 1.1 This test method covers the determination of the interior dimensions of regular slotted or special slotted styles of single-wall corrugated, double-wall corrugated, and solid fiberboard boxes.
- 1.2 This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.

2. Referenced Documents

2.1 ASTM Standards:²

D585 Practice for Sampling and Accepting a Single Lot of Paper, Paperboard, Fiberboard, and Related Product

D685 Practice for Conditioning Paper and Paper Products for Testing

D996 Terminology of Packaging and Distribution Environments

D4332 Practice for Conditioning Containers, Packages, or Packaging Components for Testing

E691 Practice for Conducting an Interlaboratory Study to Determine the Precision of a Test Method

2.2 ANSI Standard:

B46.1 Surface Texture Surface Roughness, Waviness and Lay³

3. Terminology

3.1 *Definitions*—General terms in this test method are defined in Terminology D996.

- 3.2 Definitions of Terms Specific to This Standard:
- 3.2.1 *depth*—the distance between the innermost surfaces of the box measured perpendicular to the length and width.
- 3.2.2 *interior dimensions*—the shortest distances between opposite walls.
- 3.2.3 *length*—the larger of the two dimensions of the open face.
- 3.2.4 *regular slotted*—one-piece box with all flaps the same length and outer flaps meeting. Inner flaps may or may not meet, but do not overlap.
- 3.2.5 *special slotted*—one-piece box with all flaps meeting or not meeting but not overlapping.
- 3.2.6 *width*—the lesser of the two dimensions of the open

4. Significance and Use

- 4.1 The interior dimensions are important properties in the general construction of a box, and accurate methods of measurement are required for research work, routine control, and acceptance testing for conformance to specifications. For containers to carry and protect their contents effectively and efficiently, the containers must be of proper and uniform size. This method involves a degree of human judgment and assumes careful and accurate placement and reading of specified apparatus.
- 4.2 Method A, Measuring Lot of Boxes—determines if a lot (i.e., production run) is within specified tolerance for each dimension (length, width, and depth). A minimum of five specimens are measured. The test result for each dimension is the individual measurements of that dimension on all specimens. If any test result is outside of a specified tolerance, that box specimen should be re-measured using Method B to determine final test results.
- 4.3 *Method B, Measuring Single Boxes*—determines if one particular box is within specified tolerance for each dimension. The test result for each dimension is the average of all measurements of that dimension.

¹ This test method is under the jurisdiction of ASTM Committee D10 on Packaging and is the direct responsibility of Subcommittee D10.27 on Paper and Paperboard Products.

Current edition approved Dec. 1, 2004. Published December 2004. Originally approved in 1967. Last previous edition approved in 1999 as D2658 – 94 (1999). DOI: 10.1520/D2658-04.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

³ Available from American National Standards Institute, 25 W. 43rd St., 4th Floor, New York, NY 10036.



5. Apparatus

- 5.1 *Measuring Equipment*, consisting of two flat metal plates mounted on each end and at right angles to a telescoping spacing bar (Fig. 1).
- 5.1.1 *Metal Plates* The metal plates shall be not less than ³/₁₆ in. (4.76 mm) thick and shall have length and width dimensions of 4 by 3 in. (102 by 76 mm) with a maximum surface roughness height of 64 μin. (1.63 μm), in accordance with ANSI B46.1. All sharp edges shall be relieved and corners shall be rounded with approximately ¹/₄-in. (6.35-mm) radius. The plates shall be mounted firmly at each end of the telescoping bar and must be parallel to each other within 0.02 in. (0.5 mm).
- 5.1.2 Spacing Bar— Provision shall be made for adjusting and locking the spacing bar at the linear distance between the two plane surfaces. If the spacing bar incorporates a built-in scale for convenience in reading measurements, it shall be accurate to one half of the minimum measurement unit; that is, if the minimum measurement unit is $\frac{1}{16}$ in. (1.6 mm), the instrument must be accurate to $\frac{1}{22}$ in. (0.8 mm), etc.
- 5.2 Size and Weight Ranges—Correct weight of the measuring instrument is important. Weights of instruments for three basic size ranges shall conform to the specifications given in Table 1.

TABLE 1 Instrument Weight for Three Basic Size Ranges

Size Range of Boxes, in. (mm)	Instrument Weight, oz (g)
Up to 10 ^A (254)	2 lb 0 ± 2 (907 ± 57)
10 to 18 (254 to 457)	2 lb 8 \pm 2 (1134 \pm 57)
18 to 34 (457 to 864)	3 lb 6 \pm 3 (1530 \pm 85)

^A A purchased instrument may have a minimum usable size of 6 in. (152 mm).

6. Sampling dards iteh ai/catalog/standards/si

6.1 Select specimens at random in accordance with good practice or sampling procedures.

7. Test Specimens

- 7.1 Method A, Measuring Lot of Boxes—
- 7.1.1 In no instance shall fewer than five specimens be measured and taken as representative of the lot.
- 7.1.2 For large lots, a formal sampling plan is advised. Application of Practice D585 is suggested.


Note 1—Acceptance or rejection of a production lot should be based on a sampling plan mutually agreeable to both the supplier and user of the boxes as indicated in a specification, contract, or other agreement.

8. Conditioning

8.1 Condition the boxes for measuring in accordance with Practice D685 and Practice D4332.

9. Procedure

- 9.1 For each box to be measured, set up and square the box in the normal manner and place it on a smooth, flat surface with the bottom flaps folded into position but not secured by any type of sealing device or preparation.
- 9.2 Measuring Length— Measure the length dimension between the two end panels, holding the instrument as close as possible to the side panel opposite the manufacturer's joint. Place one end of the instrument firmly against one end of the box and adjust the other end until it is just tight enough that, when released with the box inclined so that the side panel closest to the instrument is at an angle of approximately 65° to the horizontal, the instrument will slide slowly down the side of the box and come to rest at the bottom. When the correct extension of the instrument has been obtained, lock it, and if equipped with a self-contained scale, read the distance between the faces directly. If the instrument does not incorporate a scale, remove the instrument from the box and measure the distance between the outer surfaces of the plates by means of a separate scale accurate to ½2 in. (0.8 mm).
- 9.3 *Measuring Width* Measure the width dimension of the box between the two side panels, holding the instrument as close as possible to the end panel opposite the manufacturer's

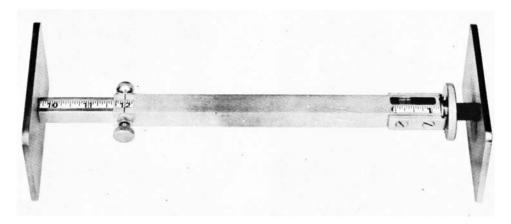

Note 1—The unit shown covers the middle range from 10 to 18 in. (254 to 457 mm). Rounded knurled knob at upper left is lifted to set gage to the nearest full unit measurement below box dimension. Knurled knob at lower left is used to lock extension rod in place. Adjusting nut at right end moves right end plate to proper tension against side of box. Fractions of unit measurement over initial adjustment are read at right end scale. Reading shown is $12\frac{5}{16}$ in.

FIG. 1 Detail of Measuring Equipment