# INTERNATIONAL STANDARD

ISO 17657-3

First edition 2005-09-15

# Resistance welding — Welding current measurement for resistance welding —

Part 3: Current sensing coil

Teh STrésistance — Mesurage des courants en soudage par résistance — Mesurage des courants en soudage par

S Partie 3: Tore de mesure de courant

ISO 17657-3:2005 https://standards.iteh.ai/catalog/standards/sist/8034a5bc-ff4a-4560-bd7e-dd4ac78a8a63/iso-17657-3-2005



#### PDF disclaimer

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

# iTeh STANDARD PREVIEW (standards.iteh.ai)

ISO 17657-3:2005 https://standards.iteh.ai/catalog/standards/sist/8034a5bc-ff4a-4560-bd7e-dd4ac78a8a63/iso-17657-3-2005

#### © ISO 2005

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Case postale 56 • CH-1211 Geneva 20
Tel. + 41 22 749 01 11
Fax + 41 22 749 09 47
E-mail copyright@iso.org
Web www.iso.org

Published in Switzerland

# Contents

Page

Forewo	ord	. iv
Introdu	ıction	v
1	Scope	1
2	Normative references	1
3	Terms and definitions	1
4	Physical environment and operating conditions	2
5 5.1 5.2 5.3	Classification of current sensing coils and designation of product	2 2
6 6.1 6.2 6.3 6.4 6.5 6.6 6.7	Requirements for current sensing coils  Current sensing coil and connecting lead  Conversion coefficient  Measuring accuracy  Mechanical strength  Setting position error  Influence of ambient temperature lands itch ai  Thermal property of cover materials  Test  ISO 17657-32005	3 4 4 4 4
7 7.1 7.2 7.3 7.4 7.5 7.6	Test procedures /standards.itch.ai/catabog/standards/sis/8034a5bc-ff4a-4560-bd7c- Conversion coefficient	5 6 6 8
8	Marking	8
Annex	A (informative) Design of current sensing coils	9
Annex	B (informative) Governing parameters of the conversion coefficient	12
	C (informative) Type of current sensing coils and their recommended specification range	
Annex	D (informative) Frequency response of current sensing coils	17

#### **Foreword**

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 17657-3 was prepared by Technical Committee ISO/TC 44, Welding and allied processes, Subcommittee SC 6, Resistance welding.

ISO 17657 consists of the following parts, under the general title Resistance welding — Welding current measurement for resistance welding: (standards.iteh.ai)

Part 1: Guidelines for measurement

ISO 17657-3:2005

Part 2: Welding current https://standards.itch.ai/catalog/standards/sist/8034a5bc-ff4a-4560-bd7e-

so-17657-3-2005

- Part 3: Current sensing coil
- Part 4: Calibration system
- Part 5: Verification of welding current measuring system

### Introduction

Requests for official interpretations of any aspect of this part of ISO 17657 should be directed to the Secretariat of ISO/TC 44/SC 6 via your national standards body. A complete listing of these bodies can be found at <a href="http://www.iso.org">http://www.iso.org</a>.

# iTeh STANDARD PREVIEW (standards.iteh.ai)

ISO 17657-3:2005 https://standards.iteh.ai/catalog/standards/sist/8034a5bc-ff4a-4560-bd7e-dd4ac78a8a63/iso-17657-3-2005

# iTeh STANDARD PREVIEW (standards.iteh.ai)

ISO 17657-3:2005

https://standards.iteh.ai/catalog/standards/sist/8034a5bc-ff4a-4560-bd7e-dd4ac78a8a63/iso-17657-3-2005

# Resistance welding — Welding current measurement for resistance welding —

### Part 3:

## **Current sensing coil**

### 1 Scope

This part of ISO 17657 specifies current sensing coils of the toroidal-coil type as a current sensor for welding current meters or a welding current measuring system used to monitor the welding current in resistance welding, and is applicable for both current types, i.e. alternating current of 50 Hz or 60 Hz and direct current.

#### 2 Normative references

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 669, Resistance welding — Resistance welding equipment — Mechanical and electrical requirements <u>ISO 17657-32005</u>

ISO 17657-4, Resistance swelding chai/c Welding current 8 measurement 6 for dresistance welding — Part 4: Calibration system dd4ac78a8a63/iso-17657-3-2005

#### 3 Terms and definitions

For the purposes of this document, the terms and definitions given in ISO 669 and the following apply.

#### 3 1

#### current sensing coil (toroidal coil)

multi-wound coil, in which wire is wound around a non-magnetic core of constant cross-section, used for detecting the magnetic flux generated by current

NOTE The coil is mounted around or encircles a conductor through which the current to be measured passes.

#### 3.2

#### reference current sensing coil

current sensing coil calibrated at a higher accuracy than the highly accurate class defined in this part of ISO 17657

#### 3.3

#### conversion coefficient

ratio of output voltage from a current sensing coil against the welding current, expressed in millivolts per kiloamp (mV/kA)

NOTE The value is proportional to the frequency of the measured current, and is defined with a perfectly full-wave current of 50 Hz as the test current.

#### 3.4

#### frequency response

feature indicating the influence of frequency of test current on the conversion coefficient

#### 3.5

#### accuracy

scatter and deviation of the conversion coefficient

NOTE The output load of the current sensing coil strongly influences the value of the conversion coefficient. If the output load and/or input impedance of an integrator changes, the conversion coefficient may deviate even though both devices have been separately calibrated in a highly accurate class.

## 4 Physical environment and operating conditions

Unless otherwise specified, the current sensing coil shall be capable of operating under the following conditions:

- at an ambient air temperature between +5 °C and +40 °C;
- in relative humidity up to 95 %;
- at altitudes up to 1 000 m above mean sea level;
- where gas, fine dust, oil mist, spatters, etc. are included in the air such as those caused by ordinary arc or spot welding work.

When the operating conditions are not of any of those specified above, an agreement may be needed between the manufacturer and the purchaser.

ISO 17657-3:2005

https://standards.iteh.ai/catalog/standards/sist/8034a5bc-ff4a-4560-bd7e-

#### 5 Classification of current sensing coils and designation of product

#### 5.1 Class of current sensing coils

The current sensing coils shall be classified depending on construction, conversion coefficient and measuring accuracy. Classifications by the accuracy are shown in Table 1.

Table 1 — Classification of current sensing coils

Classification	Measuring accuracy	Application
Highly accurate class	$\pm0,\!5$ % of full scale	Laboratory use
Accurate class	$\pm$ 1,0 % of full scale	Routine use for highly accurate systems
Ordinary class	$\pm3,0$ % of full scale	Routine use for ordinary systems

#### 5.2 Standard values of the conversion coefficient

Rated values of the standard conversion coefficient, K, shall be of 150 mV/kA, 220 mV/kA and 1,5 V/kA for full-wave alternating current of 50 Hz.

NOTE If a different test frequency is used for defining the conversion coefficient, the value can be converted by using equation (1) described in 7.1.

#### 5.3 Designation of products

The following shall be indicated:

- design type as designated by type of construction;
- conversion coefficient;
- specified accuracy class;
- coil size (length for flexible type, and inner diameter for rigid type).

The designation of length can be omitted if the value is not needed.

EXAMPLE 1 Flexible type of 800 mm length, conversion coefficient of 150 mV/kA at 50 Hz, and accurate class.

Flexible (800 mm) 150 mV/kA, 50 Hz, class 1.0

EXAMPLE 2 Rigid type of 200 mm inner diameter, conversion coefficient of 180 mV/kA at 60 Hz, and highly accurate class.

Rigid (200 mm) 180 mV/kA, 60 Hz, class 0.5

# 6 Requirements for current sensing coils PREVIEW

## 6.1 Current sensing coil and connecting leaditeh.ai)

The current sensing coil, connector and connecting lead from the coil to the integrator/amplifier shall be designed such that the coil is sensitive only to magnetic flux generated by current flow through the conductor within the coil. Any external magnetic flux across the coil is not measured. The output of the coil is proportional to a derivative of the measured current waveform.

If a flexible or rigid hatched-type coil is used, both ends of the sensing coil shall be fixed leaving little or no space between the ends. To avoid wave distortion, the connecting lead and connector should be protected from magnetic flux and should have low inductance.

A low inductive resistance shall be connected to the ends of the connecting lead as the output load,  $R_L$ . The value should be constant between 200  $\Omega$  and 1 k $\Omega$ .

#### 6.2 Conversion coefficient

The rated conversion coefficient of current sensing coils should conform with those described in 5.2. The values shall be checked, and adjusted according to the method described in 7.1 using full-wave currents. The scatter of the conversion coefficient shall be checked using a reference current meter and data acquisition system, or a reference current sensing coil and a data acquisition system. The correction shall be performed by inserting a small resistance,  $r_a$ , in the end of coil or the end of connection lead as shown in Figure A.1. The coefficient value should not be adjusted by controlling the value of the output load  $R_1$ .

If the coils are checked with an alternating current of 60 Hz, the value shall be divided by 1,2 (= 60/50) to get the conversion coefficient in 50 Hz.

The input impedance of an integrator, connected to the current sensing coil, influences the value of conversion coefficient. The output voltage should be measured with a high-input impedance device larger than 500 k $\Omega$  as for the data acquisition system, with the output load specified in 6.1 connected if the coil does not include a resistor. The conversion coefficient values for an alternating current of 60 Hz can be checked and adjusted although the value is indicated in 50 Hz. In the case of an alternating current of 60 Hz, the conversion coefficient marked on the coil is calculated according to Equation (1) described in 7.1.

© ISO 2005 – All rights reserved

#### 6.3 Measuring accuracy

The measuring accuracy of current sensing coils shall be one shown in Table 1, and shall be checked according to the method described in 7.2 using full-wave alternating currents of 50 Hz or 60 Hz.

NOTE Current sensing coils with a small deviation of less than 1 % can be manufactured, which meet the repeat bending requirements after 1 000 re-attachments, provided the current conductor is located at positions B, F or H, or near the position illustrated in Figure 1.

#### 6.4 Mechanical strength

Mechanical tests shall be applied only to flexible coils. After using mechanical tests according to the methods described in 7.3.2 to 7.3.6 with full-wave alternating currents at 50 Hz or 60 Hz, the measuring accuracy of the tested coil shall comply with those shown in Table 1.

#### 6.5 Setting position error

Scatters of the conversion coefficient for the test coil shall be checked according to the method described in 7.4 using full-wave alternating currents of 50 Hz or 60 Hz. The scatters and/or deviation shall be within the measuring accuracy stipulated in Table 1.

#### 6.6 Influence of ambient temperature

The influence of ambient temperature on the current sensing coil shall be evaluated according to the method described in 7.5. The scatters and/or deviations of conversion coefficient shall be measured according to the method described in 7.2, and the values shall be within the measuring accuracy shown in Table 1.

(standards.iteh.ai)

#### 6.7 Thermal property of cover materials

ISO 17657-3:2005

The cover of current sensing coils shall not be damaged by coming into contact with a wire heated to a temperature of 60 °C. If the current sensing coil is mounted within a transformer, the coil shall withstand temperatures according to the insulation class of the transformer.

#### 6.8 Test

#### 6.8.1 Type test

Some type tests shall be carried out on the same product according to Clause 5:

- a) construction;
- b) conversion coefficient test;
- c) measuring accuracy test;
- d) mechanical tests;
- e) positioning test;
- f) thermal test;
- g) contact test.


#### 6.8.2 Acceptance test

- a) construction;
- b) conversion coefficient test.

### 7 Test procedures

#### 7.1 Conversion coefficient

The conversion coefficient shall be measured with a reference welding current measuring system, or with a reference current sensing coil combined with a data acquisition system in accordance with ISO 17657-4. The value shall be adjusted by an appropriate procedure.

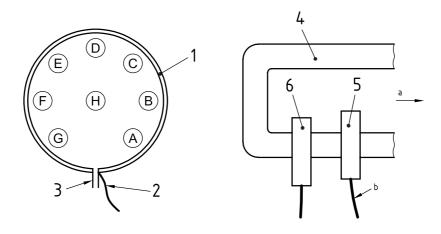

#### Key

- 1 test coil 4 conductor
- 2 lead cable iTeh STANDARD 5 reference coil W
- 3 fixing of flexible coil output connector of rigid coil 6 test coil (standards.iteh.ai)

  A to H Conductor positions.
- a To power source.

ISO 17657-3:2005

To reference welding current meterich ai/catalog/standards/sist/8034a5bc-ff4a-4560-bd7e-dd4ac78a8a63/iso-17657-3-2005

Figure 1 — Examples of the arrangement of a current sensing coil and their position numbers

The test should be carried out at position of B, D, F and H shown in Figure 1 with full-wave alternating currents of 50 Hz or 60 Hz, and within the range 5 kA to 10 kA. Then the measured result shall be indicated by a value indicated for 50 Hz.

The reference welding current meter, reference current sensing coil, and a data acquisition system shall be calibrated at least every year in accordance with ISO 17657-4.

If the current frequency used for the test differs from 50 Hz, the value shall be converted using Equation (1); e.g. when the coefficient is defined with a current of 60 Hz, the standard value should be converted to a value described for 60 Hz by Equation (1), then adjusted. The detail regarding the converting is explained in Annex B.

$$K_{\mathsf{t}} = K_{\mathsf{m}} \times \frac{f_{\mathsf{t}}}{f_{\mathsf{m}}} \tag{1}$$

where

 $K_t$  is the conversion coefficient value at frequency  $f_t$ ;

 $K_{\rm m}$  is the conversion coefficient measured with an alternating current of 50 Hz or 60 Hz;

 $f_t$  is the frequency to estimate the conversion coefficient  $K_t$ ;

 $f_{\rm m}$  is the frequency when the conversion coefficient is defined (50 Hz or 60 Hz).