

Designation: A304 – $05^{\epsilon 2}$

Standard Specification for Carbon and Alloy Steel Bars Subject to End-Quench Hardenability Requirements¹

This standard is issued under the fixed designation A304; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

This standard has been approved for use by agencies of the Department of Defense.

1. Scope*

- 1.1 This specification covers hot-worked alloy, carbon, and carbon-boron steels in a variety of compositions and sizes, which may attain specified depth of hardening in the end quench test. These steel compositions are identified by the suffix letter "H" added to the conventional grade number.
- 1.2 This specification provides for analyses other than those listed under Tables 1 and 2. Special hardenability limits are also permissible when approved by the purchaser and manufacturer.
- 1.3 The values stated in inch-pound units are to be regarded as the standard.

2. Referenced Documents

2.1 ASTM Standards:²

A29/A29M Specification for Steel Bars, Carbon and Alloy, Hot-Wrought, General Requirements for

A108 Specification for Steel Bar, Carbon and Alloy, Cold-Finished

A255 Test Methods for Determining Hardenability of Steel E112 Test Methods for Determining Average Grain Size E527 Practice for Numbering Metals and Alloys in the Unified Numbering System (UNS)

3. Terminology

3.1 Definitions of Terms Specific to This Standard:

3.1.1 hardenability—the relative ability of a steel to harden under heat treatment becomes apparent in the degree to which the material hardens when quenched at different cooling rates. It is measured quantitatively, usually by noting the extent or depth of hardening of a standard size and shape test specimen in a standardized quench. In the "end-quench" test the "depth of hardening" is the distance along the specimen from the quenched end to a given hardness.

4. Ordering Information

- 4.1 Orders for material under this specification should include the following information, in proper sequence:
 - 4.1.1 Quantity (weight),
- 4.1.2 Name of material (alloy, carbon, or carbon-boron steel),
 - 4.1.3 Cross-sectional shape,
 - 4.1.4 Size,
 - 4.1.5 Length,
 - 4.1.6 Grade,
 - 4.1.7 End-quenched hardenability (see Section 9),

 - 4.1.8 Report of heat analysis, if desired (see Section 7),
 - 4.1.9 Special straightness, if required,
 - 4.1.10 ASTM designation and date of issue,
 - 4.1.11 End use or special requirements, and
 - 4.1.12 Leaded steel, when required.

Note 1—A typical ordering description is as follows: 10 000 lb, alloy bars, round, 4.0 in. dia by 10 ft, Grade 1340H, J 40/56 = 6/16 in., heat analysis required, ASTM A304, dated ____

- 4.2 The purchaser shall specify the desired grade, including the suffix letter "H," in accordance with Table 1 or Table 2.
- 4.3 Band limits are shown graphically and as tabulations in Figs. 2-87, inclusive. For specifications purposes, the tabulated values of Rockwell C hardness are used. Values below 20 Rockwell C hardness (20 HRC) are not specified because such values are below the normal range of the C scale. The graphs are shown for convenience in estimating the hardness values

 $[\]varepsilon^1$ Note—Editorial changes made to text and Figure 18 in July 2005.

 $[\]varepsilon^2$ Note—Correction made editorially to UNS 15260 in Table 2 in August 2005.

¹ This specification is under the jurisdiction of ASTM Committee A01 on Steel, Stainless Steel and Related Alloys and is the direct responsibility of Subcommittee

Current edition approved July 28, 2005. Published March 2005. Originally approved in 1947. Last previous edition approved in 2004 as A304 - 04. DOI: 10.1520/A0304-05E02.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For Annual Book of ASTM Standards volume information, refer to the standard's Document Summary page on the ASTM website



obtainable at various locations on the end quench test bar and for various locations in oil or water quenched rounds. The relationship between end-quench distance and bar diameter is approximate and should be used only as a guide.

- 4.4 Two points from the tabulated values are commonly designated according to one of Methods A, B, C, D, or E, which are defined in the following paragraphs. Those various methods are illustrated graphically in Fig. 1.
- 4.4.1 *Method A*—The minimum and maximum hardness values at any desired distance. This method is illustrated in Fig. 1 as points *A-A* and would be specified as 43 to 54 HRC at J3. Obviously the distance selected would be that distance on the end quench test bar that corresponds to the section used by the purchaser.
- 4.4.2 *Method B*—The minimum and maximum distances at which any desired hardness value occurs. This method is illustrated in Fig. 1 as points *B-B* and would be specified as 39 HRC at J4 minimum and J9 maximum. If the desired hardness does not fall on an exact sixteenth position, the minimum distance selected should be the nearest sixteenth position toward the quenched end and the maximum should be the nearest sixteenth position away from the quenched end.
- 4.4.3 *Method C*—Two maximum hardness values at two desired distances, illustrated in Fig. 1 as points *C-C*.
- 4.4.4 *Method D*—Two minimum hardness values at two desired distances, illustrated in Fig. 1 as points *D-D*.
- 4.4.5 *Method E*—Any minimum hardness plus any maximum hardness. When hardenability is specified according to one of the above Methods A to E, the balance of the hardenability band is not applicable.
- 4.5 In cases when it is considered desirable, the maximum and minimum limits at a distance of ½6 in. from the quenched end can be specified in addition to the other two points as previously described in 4.4.1-4.4.5, inclusive.
- 4.6 In cases when it is necessary to specify more than two points on the hardenability band (exclusive of the maximum and minimum limits at a distance of ½16 in.), a tolerance of two points Rockwell C (HRC) over any small portion of either curve (except at a distance of ½16 in.) is customary. This tolerance is necessary because curves of individual heats vary somewhat in shape from the standard band limits and thus deviate slightly at one or more positions in the full length of the curves.

5. Manufacture

- 5.1 Melting Practice—The steel shall be made by one or more of the following primary processes: open-hearth, basic-oxygen, or electric-furnace. The primary melting may incorporate separate degassing or refining and may be followed by secondary melting using electroslag remelting or vacuum arc remelting. Where secondary melting is employed, the heat shall be defined as all of the ingots remelted from a single primary heat.
- 5.2 Slow Cooling—Immediately after hot working, the bars shall be allowed to cool when necessary to a temperature below the critical range under suitable conditions, to prevent injury by too rapid cooling.

6. General Requirements

6.1 Material furnished under this specification shall conform to the applicable requirements of the current edition of Specification A29/A29M or A108, unless otherwise provided for in this specification.

7. Chemical Composition

- 7.1 The heat analysis shall conform to the requirements as to chemical composition prescribed in Tables 1 and 2 for the grade specified by the purchaser.
- 7.2 When a steel cannot be identified by a standard grade number in accordance with Tables 1 and 2, other compositions may be specified, as agreed upon between the purchaser and the manufacturer. Generally, hardenability bands will not be available for such compositions.
- 7.3 When requested by the manufacturer, and approved by the purchaser, other steels capable of meeting the purchaser's specified hardenability may be furnished in place of the grade specified by the purchaser.

8. Grain Size Requirements

- 8.1 The steel shall conform to the fine austenitic grain size requirement of Specification A29/A29M.
- 8.2 Hardenability values specified in this specification are based on fine-grain steels and are not applicable to coarse-grain material. In case coarse-grain steel is desired, the hardenability values shall be negotiated between the purchaser and the manufacturer.

9. End-Quench Hardenability Requirements

- 9.1 The end-quench hardenability shall conform to the requirements specified on the purchase order.
- 9.2 The hardenability values shall be specified in accordance with the applicable values in Figs. 2-87 inclusive for the grade specified. See Fig. 1 for method of specifying hardenability.
- 9.3 When agreed upon between the purchaser and manufacturer, special hardenability limits may be ordered and shall be reflected on the purchase order.

10. Test Specimens

- 10.1 *Number and Location*—The number and location of test specimens shall be in accordance with the manufacturer's standard practice and shall adequately represent the hardenability of each heat.
- 10.2 *Thermal Treatment*—All forged or rolled hardenability test specimens must be normalized prior to testing. Cast specimens need not be normalized.

11. Test Methods

- 11.1 Grain Size—Test Methods E112.
- 11.2 End-Quench Hardenability—Test Method A255.

12. Certification and Reports of Testing

12.1 When the full H-band is specified for alloy steels, the hardenability can be reported by listing hardness values at the following distances from the quenched end of the test specimen: 1 through 16 sixteenths, then 18, 20, 22, 24, 28, and 32 sixteenths of an inch.



12.2 Tables 2-18 in Test Methods A255 are to be used to calculate hardenability from the chemical ideal diameter for the grades shown in 10.1 of Test Methods A255. Hardenability results are to be reported for the first 10 sixteenths (16 mm), then 12, 14, 16, 18, 20, 24, 28, and 32 sixteenths of an inch.

Note 2—The reporting hardenability using the calculated method differs from the procedure shown in 6.4 of Test Methods A255.

12.3 For carbon H-steels, distances from the quenched end may be reported by listing sixteenths or half sixteenths (rather

than full sixteenths only as with alloy steels). Units of sixteenths rather than thirty-seconds are followed for all steels to avoid misunderstanding. When the full H-band is specified half sixteenths through 8 may be reported, as well as the distances listed in 12.1.

13. Keywords

13.1 alloy steel bars; carbon steel bars; end quench hardenability; steel bars

SUMMARY OF CHANGES

Committee A01 has identified the location of selected changes to this specification since the last issue, A304 - 04, that may impact the use of this specification (Approved March 1, 2005).

(1) Changed Manganese on H 51300 in Table 1.

Committee A01 has identified the location of selected changes to this specification since the last issue, A304 - 96, that may impact the use of this specification (Approved March 1, 2004).

(1) New section 12.2 added.

(2) Previous section 12.2 renumbered as 12.3.

TABLE 1 Chemical Requirements of Alloy H Steels^A

Note 1— Phosphorus and sulfur in open-hearth steel is 0.035 %, max, and 0.040 %, max respectively. Phosphorus and sulfur in electric-furnace steel (designated by the prefix letter "E") is 0.025 %, max.

Note 2—Small quantities of certain elements are present in alloy steels that are not specified or required. These elements are considered as incidental and may be present to the following maximum amounts: copper, 0.35 %; nickel, 0.25 %; chromium, 0.20 %; molybdenum, 0.06 %.

Note 3—Chemical ranges and limits shown in this table are subject to the permissible variation for product analysis shown in Specification A29/A29M.

Note 4—Standard "H" Steels can be produced with a lead range of 0.15–0.35 %. Such steels are identified by inserting the letter "L" between the second and third numerals of the grade designation, for example, 41L40H. Lead is generally reported as a range of 0.15–0.35 %.

UNS Desig-	Grade Designation			Chemical Con	nposition, %		
nation ^A		Carbon	Manganese	Silicon	Nickel	Chromium	Molybdenum
H 13300	1330 H	0.27-0.33	1.45–2.05	0.15-0.35	00-709u131u7 e	534/astiir a304	-0362
H 13350	1335 H	0.32-0.38	1.45-2.05	0.15-0.35			
H 13400	1340 H	0.37-0.44	1.45-2.05	0.15-0.35			
H 13450	1345 H	0.42-0.49	1.45-2.05	0.15-0.35	•••		
H 40270	4027 H	0.24-0.30	0.60-1.00	0.15-0.35			0.20-0.30
H 40280	4028 H ^B	0.24-0.30	0.60-1.00	0.15-0.35			0.20-0.30
H 40320	4032 H	0.29-0.35	0.60-1.00	0.15-0.35			0.20-0.30
H 40370	4037 H	0.34-0.41	0.60-1.00	0.15-0.35			0.20-0.30
H 40420	4042 H	0.39-0.46	0.60-1.00	0.15-0.35			0.20-0.30
H 40470	4047 H	0.44-0.51	0.60-1.00	0.15-0.35	•••		0.20-0.30
H 41180	4118 H	0.17-0.23	0.60-1.00	0.15-0.35		0.30-0.70	0.08-0.15
H 41300	4130 H	0.27-0.33	0.30-0.70	0.15-0.35		0.75-1.20	0.15-0.25
H 41350	4135 H	0.32-0.38	0.60-1.00	0.15-0.35		0.75-1.20	0.15-0.25
H 41370	4137 H	0.34-0.41	0.60-1.00	0.15-0.35		0.75-1.20	0.15-0.25
H 41400	4140 H	0.37-0.44	0.65-1.10	0.15-0.35		0.75-1.20	0.15-0.25
H 41420	4142 H	0.39-0.46	0.65-1.10	0.15-0.35		0.75-1.20	0.15-0.25
H 41450	4145 H	0.42-0.49	0.65-1.10	0.15-0.35		0.75-1.20	0.15-0.25
H 41470	4147 H	0.44-0.51	0.65-1.10	0.15-0.35		0.75-1.20	0.15-0.25
H 41500	4150 H	0.47-0.54	0.65-1.10	0.15-0.35		0.75-1.20	0.15-0.25
H 41610	4161 H	0.55-0.65	0.65-1.10	0.15-0.35	•••	0.65-0.95	0.25-0.35
H 43200	4320 H	0.17-0.23	0.40-0.70	0.15-0.35	1.55–2.00	0.35-0.65	0.20-0.30
H 43400	4340 H	0.37-0.44	0.55-0.90	0.15-0.35	1.55-2.00	0.65-0.95	0.20-0.30
H 43406	E4340 H	0.37-0.44	0.60-0.95	0.15-0.35	1.55-2.00	0.65-0.95	0.20-0.30
H 44190	4419 H	0.17-0.23	0.35-0.75	0.15-0.35			0.45-0.60
H 46200	4620 H	0.17-0.23	0.35-0.75	0.15-0.35	1.55-2.00		0.20-0.30
H 46210	4621 H	0.17-0.23	0.60-1.00	0.15-0.35	1.55-2.00		0.20-0.30
H 46260	4626	0.23-0.29	0.40-0.70	0.15-0.35	0.65-1.05		0.15-0.25



TABLE 1 Continued

UNS Desig-	Grade Designation			Chemical Con	nposition, %		
nation ^A		Carbon	Manganese	Silicon	Nickel	Chromium	Molybdenum
1.47400	4740.11	0.45.0.04	0.00.005	0.45, 0.05	0.05.4.05	0.00.000	0.00.0.40
H 47180	4718 H	0.15-0.21	0.60-0.95	0.15-0.35	0.85–1.25	0.30-0.60	0.30-0.40
H 47200	4720 H	0.17-0.23	0.45-0.75	0.15–0.35	0.85–1.25	0.30-0.60	0.15–0.25
H 48150	4815 H	0.12-0.18	0.30-0.70	0.15-0.35	3.20-3.80		0.20-0.30
H 48170	4817 H	0.14-0.20	0.30-0.70	0.15-0.35	3.20-3.80		0.20-0.30
H 48200	4820 H	0.17–0.23	0.40-0.80	0.15-0.35	3.20–3.80	•••	0.20-0.30
H 50401	50B40 H ^C	0.37-0.44	0.65-1.10	0.15-0.35		0.30-0.70	
H 50441	50B44 H ^C	0.42-0.49	0.65-1.10	0.15-0.35		0.30-0.70	
H 50460	5046 H	0.43-0.50	0.65-1.10	0.15-0.35		0.13-0.43	
H 50461	50B46 H ^C	0.43-0.50	0.65-1.10	0.15-0.35		0.13-0.43	
H 50501	50B50 H ^C	0.47-0.54	0.65-1.10	0.15-0.35		0.30-0.70	
H 50601	50B60 H ^C	0.55-0.65	0.65-1.10	0.15-0.35		0.30-0.70	
H 51200	5120 H	0.17-0.23	0.60-1.00	0.15-0.35		0.60-1.00	
H 51300	5130 H	0.27-0.33	0.60-1.00	0.15-0.35		0.75–1.20	
H 51320	5132 H	0.29-0.35	0.50-0.90	0.15-0.35		0.65-1.10	
H 51350	5135 H	0.32-0.38	0.50-0.90	0.15-0.35		0.70-1.15	
H 51400	5140 H	0.37-0.44	0.60-1.00	0.15-0.35		0.60-1.00	
H 51450	5145 H	0.42-0.49	0.60-1.00	0.15-0.35		0.60-1.00	
H 51470	5147 H	0.45-0.52	0.60-1.05	0.15-0.35		0.80-1.25	
H 51500	5150 H	0.47-0.54	0.60-1.00	0.15-0.35		0.60-1.23	•••
H 51550	5155 H	0.50-0.60	0.60-1.00	0.15-0.35		0.60-1.00	
H 51600	5160 H	0.55-0.65	0.65–1.10	0.15-0.35		0.60-1.00	
H 51601	51B60H ^C	0.55–0.65	0.65–1.10	0.15-0.35		0.60-1.00	
H 61180	6118 H ^D	0.15-0.21	0.40-0.80	0.15-0.35		0.40-0.80	
H61500	6150 H ^E	0.47-0.54	0.60-1.00	0.15-0.35		0.75–1.20	
H 81451	81B45 H ^C	0.42-0.49	0.70-1.05	0.15-0.35	0.15-0.45	0.30-0.60	0.08-0.15
H 86170	8617 H	0.14-0.20	0.60-0.95	0.15-0.35	0.35-0.75	0.35-0.65	0.15-0.25
H 86200	8620 H	0.17-0.23	0.60-0.95	0.15-0.35	0.35-0.75	0.35-0.65	0.15-0.25
H 86220	8622 H	0.19-0.25	0.60-0.95	0.15-0.35	0.35-0.75	0.35-0.65	0.15-0.25
H 86250	8625 H	0.22-0.28	0.60-0.95	0.15-0.35	0.35-0.75	0.35-0.65	0.15-0.25
H 86270	8627 H	0.24-0.30	0.60-0.95	0.15-0.35	0.35-0.75	0.35-0.65	0.15-0.25
H 86300	8630 H	0.27-0.33	0.60-0.95	0.15-0.35	0.35-0.75	0.35-0.65	0.15-0.25
H 86301	86B30 H	0.27-0.33	0.60-0.95	0.15-0.35	0.35-0.75	0.35-0.65	0.15-0.25
H 86370	8637 H	0.34-0.41	0.70-1.05	0.15-0.35	0.35-0.75	0.35-0.65	0.15-0.25
H 86400	8640 H	0.37-0.44	0.70-1.05	0.15-0.35	0.35-0.75	0.35-0.65	0.15-0.25
H 86420	8642 H	0.39-0.46	0.70-1.05	0.15-0.35	0.35-0.75	0.35-0.65	0.15-0.25
H 86450	andan 8645 H	0.42-0.49	0.70-1.05	0.15-0.35	0.35-0.75	0.35-0.65	0.15-0.25
H 86451	86B45 H ^C	0.42-0.49	0.70-1.05	0.15-0.35	0.35-0.75	0.35-0.65	0.15-0.25
H 86500	8650 H	0.42-0.49 0.47-0.54	0.70-1.05	0.15-0.35	0.35-0.75	0.35-0.65	0.15-0.25 0.15-0.25
H 86550	8655 H		0.70-1.05	0.15-0.35			0.15-0.25 0.15-0.25
H 86600	8660 H	0.50–0.60 0.55–0.65	0.70-1.05 0.70-1.05	0.15-0.35	0.35-0.75 0.35-0.75	0.35–0.65 0.35–0.65	0.15-0.25 0.15-0.25
L 07000	9700 11	0.17.0.00	0.60.005	0.15, 0.05	0.25 0.75	0.25 0.65	0.00.000
H 87200 H 87400	8720 H 8740 H	0.17-0.23 0.37-0.44	0.60-0.95 0.70-1.05	0.15-0.35 0.15-0.35	0.35–0.75 0.35–0.75	0.35-0.65 0.35-0.65	0.20-0.30 0.20-0.30
1107400	074011	0.57-0.44	0.70-1.03	0.15-0.05	0.55-0.75	0.55-0.65	0.20-0.50
H 88220	8822 H	0.19–0.25	0.70-1.05	0.15-0.35	0.35-0.75	0.35-0.65	0.30-0.40
H 92600	9260 H	0.55-0.65	0.65-1.10	1.70-2.20			
H 93100	9310 H	0.07-0.13	0.40-0.70	0.15-0.35	2.95–3.55	1.00-1.45	0.08-0.15
H 94151	94B15 H ^C	0.12-0.18	0.70-1.05	0.15-0.35	0.25-0.65	0.25-0.55	0.08-0.15
H 94171	94B17 H ^C	0.14-0.20	0.70-1.05	0.15-0.35	0.25-0.65	0.25-0.55	0.08-0.15
H 94301	94B30 H ^C	0.27-0.33	0.70-1.05	0.15-0.35	0.25-0.65	0.25-0.55	0.08-0.15

^A New designations established in accordance with Practice E527 and SAE J 1086, Recommended Practice for Numbering Metals and Alloys (UNS).

^B Sulfur content range is 0.035 to 0.050 %.

^C These steels can be expected to have a 0.0005 % min boron content.

^D Vanadium content range is 0.10 to 0.15 %.

^E Minimum vanadium content is 0.15 %.

TABLE 2 Chemical Requirements of Carbon H-Steels^A

UNS Designation ^B	Grade Designation		Che	emical Composition, %		
	_	Carbon	Manganese	Phosphorus, max	Sulfur, max	Silicon
H 10380	1038 H	0.34-0.43	0.50-1.00	0.040	0.050	0.15-0.30
H 10450	1045 H	0.42-0.51	0.50-1.00	0.040	0.050	0.15-0.30
H 15220	1522 H	0.17-0.25	1.00-1.50	0.040	0.050	0.15-0.30
H 15240	1524 H	0.18-0.26	1.25-1.75	0.040	0.050	0.15-0.30
H 15260	1526 H†	0.21-0.30	1.00-1.50	0.040	0.050	0.15-0.30
H 15410	1541 H	0.35-0.45	1.25-1.75	0.040	0.050	0.15-0.30
H 15211 ^C	15B21 H ^C	0.17-0.24	0.70-1.20	0.040	0.050	0.15-0.30
H 15351 ^C	15B35 H ^C	0.31-0.39	0.70-1.20	0.040	0.050	0.15-0.30
H 15371 ^C	15B37 H ^C	0.30-0.39	1.00-1.50	0.040	0.050	0.15-0.30
H 15411 ^C	15B41 H ^C	0.35-0.45	1.25-1.75	0.040	0.050	0.15-0.30
H 15481 ^C	15B48 H ^C	0.43-0.53	1.00-1.50	0.040	0.050	0.15-0.30
H 15621 ^C	15B62 H ^C	0.54-0.67	1.00-1.50	0.040	0.050	0.40-0.60

[†]Correction made editorially

iTeh Standards (https://standards.iteh.ai) Document Preview

ASTM A304-05e2

https://standards.iteh.ai/catalog/standards/sist/68fcf891-923a-4b7e-8d08-7b9df3fd7854/astm-a304-05e2


^A Standard H Steels can be produced with a lead range of 0.15–0.35 %. Such steels are identified by inserting the letter "L" between the second and third numerals of the grade designation, for example, 15L22 H. Lead is generally reported as a range of 0.15–0.35 %.

^E New designations established in accordance with Practice E527 and SAE J 1086, Recommended Practice for Numbering Metals and Alloys (UNS).

 $^{^{\}it C}$ These steels can be expected to have 0.0005 % min boron content.



Hardenability Band

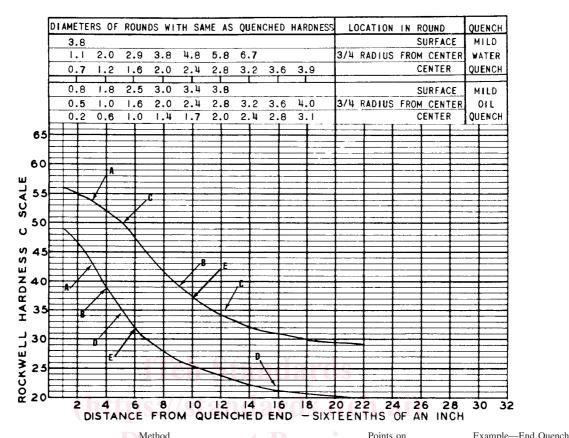


	Method	Points on	Example—End Quench
		Charts	Hardenability
A	Minimum and maximum hardness values at a designated distance	A-A	HRC 43 to 54 at J3
В	A hardness value at minimum and maximum distances	B-B	HRC 39 at J4 minimum and J9 maximum
C	The maximum hardness values at two designated distances	C-C	HRC50 at J5 maximum
			HRC 34 at J12 maximum
Dhttps:/	Two minimum hardness values at two distances \$\sist/68fcf891-923a-4b7e-8c	D-D7b9df3f6	HRC 35 at J5 minimum 05e2
			HRC 21 at J16 minimum
E	Any minimum hardness plus any maximum hardness	E-E	HRC 32 at J6 minimum
			HRC 37 at J10 maximum

FIG. 1 Examples Illustrating Alternative Method of Specifying Hardenability Requirements (tabulated hardness values are used in ordering)



	SS LIMITS F			_					LNA			- DF	ND		330	<u>-</u> "			
J" DISTANCE	1330 M				<u> </u>		M		+-	Si				-			-		
SIXTEENTHS -	MAX	MIN		0.2		.33	1.45	/ 2.05	0.	15/	.35			ŀ			-		
	56	49		_	70	.33		2.00	1_	,,,	.50			ŀ	i_		1		
2	56	47																	
3	55	74.86		D1 AM	TERS	OF RO	UNDS	WITH	SAME	AS Q	WENCH	ED HA	RONESS	10	CATION	(IN 1	ROUND	- 1	QUENC
	53	10		3	.8												SURFAC	Έ	HILE
	52	35				.0 2	9 3	8 - 4	.8 5	.8 6	1.7	-		3/4	RADIUS	FRO	M CENT	ER	WATE
:	50	31		0	.7 1	.2 1	6 2	0 2	. 4 2	.8 3	1.2 3	.6 3	.9			- (CENTER	1	DUENC
;	48	28				=				1	ī	Ī	i	=				\Rightarrow	
	45	26		_		.8 2			.4 3								SURFAC		MILC
•							6 2		.4 2			.6 4		3/4	RADIUS		4 CENT		OIL
9	43	25		0	.2 0	.6 1	0 1	# 1	.7 2	.0 2	2.14 2	.8 3	. !	L		(CENTER	1.10	QUEN
10	145	23	6	s⊨≕	-	-	=	_	==		+	 	-	==			-		
- 11	140	22		` 	=	!				-	!	+	1	-	-	_		=	#
12	39	21	6	Œ	1			E		•	Ŧ	ŧ		_		_	-		.1 -
13	38	20		<u> </u>									=				<u> </u>		
19	37	_		.==	1			==	==	-	=	-					1		=
15	36	-	₹ 5	3		=		=	=	=	 	-	=		=			=	+
16	35	- 1	ပ္မွ				-			-		-	1	_	_		==	_	
			ى ئ							_		1							1
18	34	-		\Rightarrow	-	ــــــ	\rightarrow		-	-	<u> </u>	+	ļ.,	=	=	=			1
20	33	- 1	97.4	≕⊫e	X-	=	\Rightarrow	_	-	-	+	-	+-	=	!		-	=	#
22	32	-	9	\blacksquare	-/-		=	\sim	==	1=	1	=		-	1	_	===	-	+-
24	31		24			=					1-						1		
26	31	- 1		H	<u> </u>	۸			=	١.	†	+-	=	=			+		#=
28	31.	-	۳.	.F	-	1	=		-		>	1	1-		-		!		#=
30	30	-	₹ 3	┱	=	+					F .		_		-	-	=		1
32	30		Ι.	Æ		=						==	⊨≡		_	_			\mathbf{I}
MEAT TOTAL	ING TEMPERATI	pce	رد ر	"=			$\overline{}$			1==	1	1	<u> </u>			\equiv			\equiv
	ENDED BY SA		¥ .	- 	⊨		\vdash	=		Ė	+	1	=			=			\pm
*NORMAL I			₹ 2:	5	=	+		1	==	-	+	+ -	-					_	-
	TIZE 1600		3 2 S	\equiv		1		=	\sim		=	1	—		-			=	+-
MUSIENI	1125 1600	-r	2 20	ـــــــار	2 .		5		0 1	_	4	16 1	8 2	0 2		4 2	6 2		30

 $Note - 1 \ in. = 25.4 \ mm.$ FIG. 2 Limits for Hardenability Band 1330 H

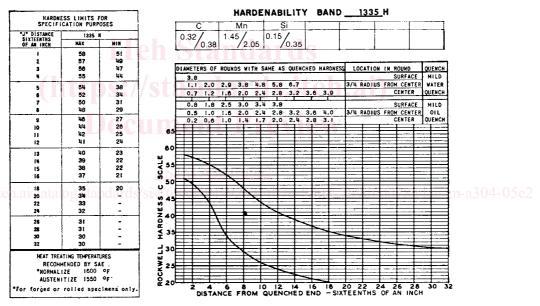


Note -1 in. = 25.4 mm.

FIG. 3 Limits for Hardenability Band 1335 H



	SS LIMITS FO		HARDENABILITY BAND 1340 H	
J" DISTANCE	1340 H			
SIXTEENTHS OF AN INCH	MAX	MIN	0.37	
1	60	53	7 0.11	
2	80	52		
3	59	51	DIAMETER'S OF ROUNDS WITH SAME AS QUENCHED HARDNESS LOCATION IN ROUND	QUEN
*	58	119	3.8 SURFACE	MIL
	57	146	1.1 2.0 2.9 3.8 4.8 5.8 6.7 3/4 RADIUS FROM CENTE	
ă	5e	40	0.7 1.2 1.6 2.0 2.4 2.8 3.2 3.6 3.9 CENTER	QUEN
,	55	35	0.8 1.8 2.5 3.0 3.4 3.8 SURFACE	MILI
	54	33		
9	52	31	0.5 1.0 1.6 2.0 2.4 2.8 3.2 3.6 4.0 3/4 RADIUS FROM CENTE 0.2 0.6 1.0 1.4 1.7 2.0 2.4 2.8 3.1 CENTER	QUEN
10	51	29	V.2 0.6 1.0 1.4 1.7 2.0 2.4 2.6 3.1	1400
10	50	28	65	
12	148	27		
			60	
18	46	26		==
14	MA	25	₹ 55	==
15	42	25	3	\equiv E
16	41	24	" 50 S	
18	39	23		==
20	38	23		
22	37	22	v T	
24	36	22		=
26	35	21	240	=
26	35	21		_
30	314	20	£ 35	
32	34	20		_
34	J4		30	
	TING TEMPERATI			=
	ENDED BY SA		3 25	
"NORMAL I			25	
AUSTENI	TIZE 1550	ot	2 4 6 8 10 12 14 16 18 20 22 24 26 28	30

 $Note-1 \ in. = 25.4 \ mm.$ FIG. 4 Limits for Hardenability Band 1340 H

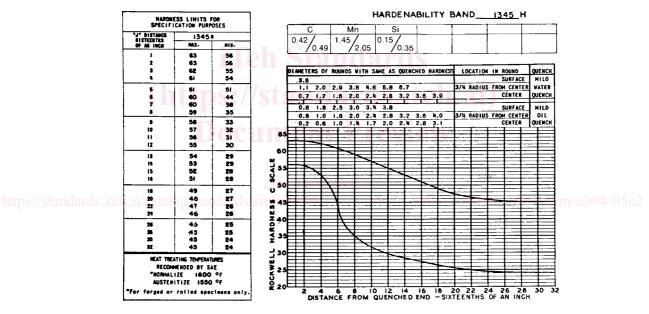

Note -1 in. = 25.4 mm.

FIG. 5 Limits for Hardenability Band 1345 H



	SS LIMITS F				_		С		HAH		VAB	Si	T D.	- 171	<u> </u>	40	Z6 F	¶ ★ Mo			
"J" DISTANCE	40276	4 4028H						-+;		-	0.1	-	-		_		<u>_</u>	20 /	-		
SEXTEENTHS -	MAX	MIN			١٠	.24	/o.s		0.60	1.00			35				ΙΟ.		.30		
1	52	45			٠							HITR	CON	ITE	IT 0.	035/0	.050				
2	50	40										****								_	
3	48	31			01/	MET	ERS	OF R	DUNDS	WITH	SAME	AS Q	UENCH	D HA	RONESS	LO	CATION	CINI	ROUND	l Qr	UENC
•	140	25			г	3.8	1									$\overline{}$			SURFAC	\Box	MILL
	34	22			Г	1,1		0 2	.9 3	.8 4	.8 5	.8 6	.7			3/4	RADIUS	FRO	CENT	ER Y	MATE
	30	20				0.7	<u> </u>	2 1	.6 2	.0 2	. 14 2	.8 3	.2 3	.6 3	. 0	1			ENTER	~_1a	UENC
;	28				⊨				i i		I		Ï		Ľ.	=	_			=	
i 1	26	<u>.</u>			L	0.8						.8				↓			SURFAC		HIL
					ᆫ	0.5							.2 3		.0	3/4	RADIUS		1 CENT		016
•	25	-			L.,	0.2	0.	6 1	.0 1	<u>. 4 . 1</u>	.7 2	.0 2	.4 2	.0 3		L			CENTER		UEN
10	25	- 1		65	H	+		<u> </u>	!	!	!	-	! 	=	•	!	=	=	=		+
	24	- 1				=		_	1	_			-	-	1	-			===	=	⇇
12	23			60	Æ	\equiv			1	i	1	=		-							Ξ.
13	23				Έ	\equiv			1			-	<u> </u>			1_			\vdash	=	1
14	22	- 1	•	١	Ħ	\Rightarrow		=	 	1	<u>t </u>		<u> </u>		<u> </u>	!	-	=	-		+
15	22	- 1	₹	55	憎	==		_	 	-	 			=	-	-		=	\blacksquare	=	#
16	21	- 1	SCAL	}		4		=	-	1	 		-		1	-	!	-	1	=	+
			•	50	⊟	\boldsymbol{x}			Ε.						I					=	1
18	21	-	·	,		-13					1		<u>L</u> .		l	_				_	+-
20	20	-	•1		뵥	#	\rightarrow			-	<u> </u>		-	-	-	ļ <u> </u>		==		==	⇇
22	-	-	41		H	¥	\rightarrow			1		!	ŧ	-	-	1—	=	===	=	_	+-
24			<u>ا</u>		Ħ	¥	-			-	1	ļ	1	-	1-		_	-		=	1
26	-	-	وَ	-0	ˈ⊟	- 1		Ц				E								\equiv	ΞΞ
28	• '	-	~		H	#		4	=	=	!	=	=	=	=	=	=	-	⇇	=	+=
30	-	-	¥	35	Ħ	#	\vdash	+	=-	-	1-	-	1	_	_			-	=	=	+
92	-	- 1			Ħ	#	\blacksquare	=	-		-	⇇		-	-					=	
HEAT TREAT	TING TEMPERATI	IRES		,		#	+		$\overline{}$	=		==	\equiv							\equiv	Ŧ
	ENDED BY SA		2		Ħ	\Rightarrow	=\;		<u> </u>	-	-	-	-		==	!	=	=	=	=	#
*NORHAL I			2	25	Ħ	#		=	+	\Rightarrow	$\overline{}$	 	=	=	=	-	-	-	=	=	‡=
AUSTENI			×	25 20	\blacksquare	\pm		$\overline{}$	-	1	=	_	=	=	1	 -	=	=	\vdash	=	1
AUSTERI		imens only.	ĕ	20	\Box	둧	=		6	8	0 1	2 1	4 1	6	6 2	0 2		4 2	6 2		30

 $$No{\rm TE}{-}1$$ in. = 25.4 mm. FIG. 6 Limits for Hardenability Band 4027 H and 4028 H

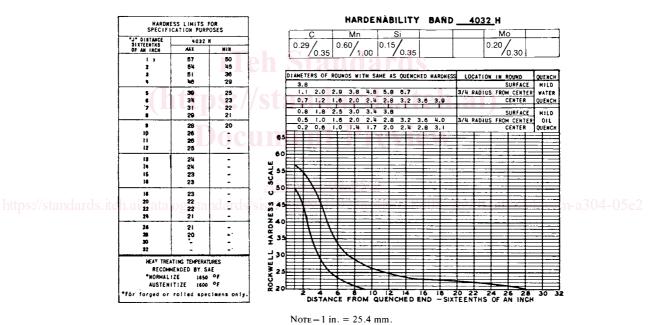



FIG. 7 Limits for Hardenability Band 4032 H

9



HARDNE SPECIFIC	SS LIMITS F	OSES						C IN A		111	- DF	ARU	4	037	_			
J* DISTANCE	4037			C	-	M	n	+-	Si	_				_	Mo	-+		
SIXTEENTHS OF AN INCH	HAX	NEN		0.34/	0.41	0.60/	/ 1.00	0.1	5/0	35				0.2	20/0	.30		
	59	52			0.41		1.00		/	001					, ,	.00		
2	57	#8																
3	54	42		DIAMETER	S OF F	ROUNDS	WITH	SAME	AS O	JENCH	ED HA	RDNESS	1.00	CATION	IN F	OHND	\Box_c	WEN
4	51	35		3.8												URFAC		MIL
	45	30		1.1	2.0	2.9 3.	8 4.	8 5	.8 6	.7			3/4 (RADIBS		CENT		WAT
i	38	26		0.7	1.2	1.6 2.	0 2.	4 2	.8 3	.2 3	.6 3	.9				ENTER		UEN
7	34	23			1				<u> </u>		L						_	
	32	22		0.8		2.5 3.			.8							URFAC		MIL
	30	21		0.5		1.6 2.						.0	3/4	RADIUS		CENT		10
10	29	20		0.2	0.6	1.0 1.	4 1.	1 2	.0 2	.4 2	.8 3	· !	┡	. —		ENTER	_10	UEN
ii	28		65						_			=					=	\pm
12	27	- 1				+			===	=	=	=	=				=	+
- :-			60					=	-			-		-	-		=	#
13	26		ш	$\vdash \mathcal{A}^{\vdash}$		+		_	-	=	\vdash							Τ
15	26 26	-	¥ 55		=	=		=	=	=	-	-	-	=		-		+
16	25		8		VI	4 =			-	-	!		=	-				#
			50	N		=				=		=					=	Ξ
18	25	-	ບ້າ		-1	+ -		=	=	-		=	=				=	#
20	25	-	v 45		T						==	<u> </u>						1
22	25	-	S		=			-		<u> </u>							_	\pm
24	24	-	ม 2 40		-	₩			_	=	=	-		= -			=	+
26	24	-	7 40 8 4 35	HE.	$\nabla =$					==							\equiv	Ξ
28	24		α ≤ 35	===	V	\uparrow		==	==	-	—	!	=		_		=	+
30	23	- 1	£ 33			$\pm \overline{\zeta}$						-					=	Ŧ
32	23	1	30 بـ		+	+											_	Ŧ
HEAT TREAT	ING TEMPERATI	IRES	_, 50		-1.5							\vdash						I
	ENDED BY SA		¥		=	*		=	_	_		-				= =		+
*NORMAL I		or	₹ 25		=	$\overline{}$		=	-		•	=	_	-			=	土
	TIZE 1550	o _F	ROCKWE 22												-			Ξ
r forged or		- 1	æ 20	2	4	6 8	\sim	0 1	2 !		6 1	8 2	0 2	2 2	4 2	6 2		30

 $\label{eq:Note-1} Note-1 \ \mbox{in.} = 25.4 \ \mbox{mm}.$ FIG. 8 Limits for Hardenability Band 4037 H

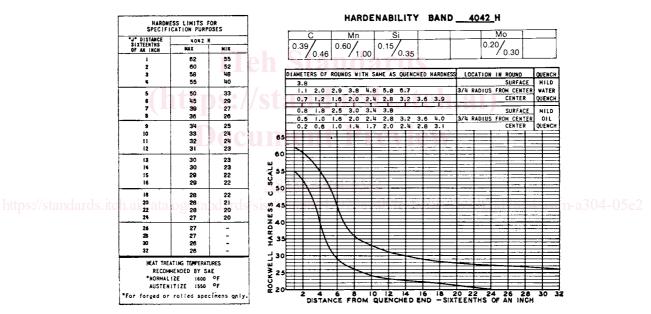

Note - 1 in. = 25.4 mm.


FIG. 9 Limits for Hardenability Band 4042 H



SIXTEERINS OF AM INCH 1 2 3 4 5 6 7 8	1047 MAX 64 62 60 58 55 52 47 43	91 MIN 57 55 50 42 35 32 30		DIA		0.51 S OF R	0.60	1.00		15/0	.35				G	0.20/	/ 0.30		
	62 60 58 55 52 47	55 50 42 35 32			METER		2,000,000	1.00	J. J	70	.35		!		_1_	_/	0.30		
	58 55 52 47	50 42 35 32				S OF R	0,,,,,,,												
	58 55 52 47	35 32				S OF R	Or HUBO												
	55 52 47	35 32						WITH	SAME	AS O	ENCH	D HAF	DNESS	100	ATTO	C IN F	CHIND	٦,	UEN
	52 47	32															URFAC		HIL
	47					2.0 2	.9 3.	8 4.	8 5.	8 6.	.7	-		3/4 (RADIUS	S FROM			VAT
					0.7	1.2 1	.8 2.	0 2.	4 2.	8 3.	.2 3	.6 3	9	1			ENTER	: To	UEN
	43			=											=			#	
		28		\vdash			.5 3.			_							URFAC		MIL
	40	28			0.5		.6 2.				.2 3			3/4	RADIUS	S FROM			01
	38	27			0.2	- I.	.0 1	4 1	7 2.	0 2	.4 2	8 3				, `	ENTER	19	UEN
ii l	37	26	. •	85	\pm	—						_				=			Ξ
12	35	26		Ħ	\star	+									\equiv		П		Ξ
13	34	25	•	o⊟	\rightarrow	=			\equiv		<u> </u>		_	=			Ħ		+-
15	33	25	w		_	\star							Н					-	Ε
15	33	25	4 :	55 ==	\mathbf{x}	1	=	=	=		=	=		=	=	=			#
16	32	25	SCALE		\blacksquare					-					=			_	#
 +-	32			so⊟	+1	_	\						Ш						Ξ
18	31	24	υ		==1	Η	1			=	_			_	=	=			+
20	30	24	9 4	ظ¢ه	#	1			\equiv		-	=	Ė		=	=			‡
22	30	23	v	`'∄	-	¥					İ					\equiv			Ξ
24	30	23	2	⊫₀	-	1=	-				-	=			=	=			+
26	30	22	HARDN	'`⊟		1													Ŧ
28	29	22	<u>چ</u> .	⊒ود	\pm	#\	-		$\overline{}$		⊨								E
30	29	21	₹.	3 7	-	\rightarrow			\rightarrow	$\overline{}$			=	=	=	==		=	+
32	29	21	و بـ	⊟		==`	\leftarrow					Ų	i					_	E
HEAT TREATII	NG TEMPERATI	IRES	, ,	³°⊟	\pm	-	X												F
	NDED BY SA		¥.	⊟								\equiv							Ξ
*NORMAL I ZE		OF	£ 2	25⊟	+	$\Rightarrow =$	-				_	-	_						ŧ
AUSTENITI		or	ROCKWE	≣₀و	\pm	1	=				-							_	#

Note -1 in. = 25.4 mm.

FIG. 10 Limits for Hardenability Band 4047 H

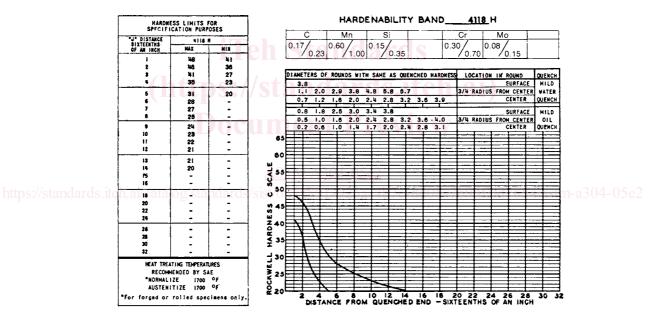

Note -1 in. = 25.4 mm.

FIG. 11 Limits for Hardenability Band 4118 H

11



	ESS LIMITS I	
"J" DISTANCE	4130	
SIXTEENTHS OF AN INCH	MAX	MIX
1	58	119
2	-55	46
3	'53	-42
	51	38
5	49	34
•	47	31
7	An	29
	#5	27
9	40	26
to	38	28
11	38	25
12	35	25
13	34	24
14	34	24
15	33	23
16	33	23
18	32	22
20	32	21
22	32	20
24	31	
26	31	-
28	30	-
30	30	-
32	29	-
	ATING TEMPERAT	NE.
NORMAL		o.F
AUSTEN	1T1ZE 1600	°F
*For forged or	rolled spec	imens only.

HARDENABILITY BAND 4130 H

С	Mn	Si	Cr	Mo	
0.27/0.33	0.30/	0.15	0.75/	0.15	

Di	_	_	ìS.	OF	R	אטכ	DS	WI	TH	SAF	ΙĘ	AS	QΙ	JEN	CHE	D	HAR	DNES	s	Ļ0	CATIO	11				QUE	
-	3.		2.	0	,	. 9	3	я	ш	.8	5	. 8	8	. 7		_			37	<u> </u>	RADIUS			URFA			LD
Ħ	0.		-	2		.6	_	.0	_			_	_	-	3.	6	3.	9	1	-				ENTE		QUE	
F	₩.	Ą.	7	8	,	.5	3	.0	-3	.4	3	.R				<u></u>		_	Ŧ					URFA	CE	-	LO
- 1	0.		_	0	_	.6	_	.0		. 4.			3	. 2	3.	6	4.	0	3/	ų,	RADIU	S F					11
	O.	2	0.	6	1.	.0	-1	.4	1	.7	2.	0	2	. 4	2.	8	3.	Ī.	L			_	C	ENTE	R	QUE	NC
65	1	\equiv	_	H	_	H		1	_	H	=	-	_	H	_				1.	=	_	Ε.	=		£	#	=
E	\perp	÷	_		_		Ξ	E	=				_				Ш	_	Ŧ		_				F	=	=
80⊟								E	-						_			_	Ŧ	_			=		Ŧ	=	_
F	Ħ		=		=	-	=	-	-		_	-	_	E	_	F	=	_	+	=	=	1			\pm	1	Ξ
55	7	V	_		Ξ		_		=		=		=	Е			Ш		1			=				=	=
E	\equiv		/	Ш		E	=	=		=			_	Ξ	_	Ξ	_	_	\pm	-	=		_		Ė	1	
50=	\forall			\sim	Ξ		_		=				_		_		_		+		-	⊨	\equiv		+	_	
E	\perp				_				_				_		_				=				=		1	\exists	_
45=	\pm	\mathbf{r}	-	=	_	Þ	7	=	=	Ħ	_	=	_	=		-	=		+	_		1	=		+-	-	=
⊨	Ħ	_	$\overline{}$		_			k	_								J	_	+=			ļ	= :		ļ.,	#	=
40	\pm		1				_		≺	⇇			_	Ξ	_	E	≡	=	+	=		-				∄	
 ⊨	\blacksquare			\			_			\sim	_		_	H	_	E	\equiv		+	=	-	1	_	=	+	=	
35-	Ш				$\overline{}$	Ε					_		-	Е	_	Н			Ξ	=		Ξ	-				
30⊨	\pm	=	=		_	E	_	╘						E	=		1		+	_		E	_		Ξ	⇉	=
	İ		_		_		₹						Ξ	Ε	_		Ш	_								=	==
, <u>,</u> E	\blacksquare	=	_	Ш	_		_		=	_	=	-							1	=		ŧ		Ш	L		
F	\Box	Ē	=	F	Ξ	Ε	_	Ε		E			=	F	-		_		E				_	-	‡_	-7	=
25	\pm		=		Ξ	E	Ξ	E		╘	Ξ		Ξ	E	=	Е	_	_	┶.	_					1	_	Ē
	2		4			5		B		0		2		4		6	- 1:			2	2 2 THS	4	2		8 5	30)

Note-1 in. = 25.4 mm.

FIG. 12 Limits for Hardenability Band 4130 H

	LIMITS F							DENA		1 1	DA.			133				
DISTANCE	SPECIFICATION PURPOSES STANCE 4135 M		-		Ξ		/In		<u>Si</u>	-	_		Cr	1	Mc			
TEENTHS -	MAX	KIK	1	0.32		0.60		0.15				0.7			.15/	0.25	ļ	
AR INCH			h h		0.38	10	1.00	1	0.35		_	<u> </u>	/1.	20		0.25	!	
1 1	58 58	51 50																
2	57	49		DIAME	ERS OF	POLIN	DS WIT	H SAME	AS OII	ENCHE	D HAR	DNESS	1.00	ATION	18/ 5	CHIND	O#	ENCH
	56	48	1	3.			JU #11	II OAITE	A0 40	Ciroine		0		A. 10.		URFACI		ILD
	4 7		1/~4	1		2.9	3.8	4.8 5	.8 6.	7			3/4 R	ADIUS		CENT		ATER
5	56	47		0.				2.4 2			6 3.	-				ENTER		ENCH
7 11	56 54	45 42								- 0.	Ť	~			_			
	53	42		0.					.8							SURFACI		IILD
-			1	0.				2.4 2					3/4 8	RADIUS		CENTI ENTER		OI L SENCH
9	52	38		0.	2 0.6	1.0	1.4	1.7 2	.0 2.	4 2	8 3.		_		`	ENIER T I	_ <u>L</u> v	I
10	51 50	36 34		5									7					
12	70	33			=	==		-							_			
			6	۰		=		\equiv									_	
13	48	32	w		$\overline{}$		===	-		-	\vdash						_	=
16	47	31	2/5	5	_	\prec	_		1	_								
15	46 45	30 30	SCALI		$-\Lambda D$	ΩA	_	- 0										=
10	40	30	- 5	0			==	1	<u> </u>		=					1 1		
18	1114	29	. 0		00.0		A 5		\sim	_				4.00	-			1
20 ata	42	28	SISMA	5	X .	X	<u> </u>	+	1/C			=			I	0.	47	15
22	O ¥1	27	E S			_									-			
24	40	27	Z 4	ا ا			\rightarrow	_	+	=				\sim	-	<u> </u>		=
26	39	27	6	1	-	=	=>	=	1	=			=					
28	38	26		5				\mathcal{X}	I									-
30	38	26	¥ 3	$\exists \exists$		_	-	+>	⇇					=				<u> </u>
32	37	26	- 3	ہ⊞	==			=	\geq									-
	ING TEMPERAT		Ē	5														
"NORMAL 12	E 1600	of	1 5								1=			1	=			E
AUSTENIT	1ZE 1550	of	Į Ž,	٦		\equiv	==:	_1_	_	4	6 1	8 2		2 2	<u> </u>	26 2		30 3


Note-1 in. = 25.4 mm.

FIG. 13 Limits for Hardenability Band 4135 H



HARDENABILITY BAND HARDNESS LIMITS FOR SPECIFICATION PURPOSES Cr Si Mc 4137 M 0.15 0.34 0.41 0.60 1.00 0 0.15 0.75 / 1.20 59 59 58 58 52 51 50 119 DIAMETERS OF ROUNDS WITH SAME AS QUENCHED HARDNESS LOCATION IN ROUND QUENCH SURFACE MILD 3/4 RADIUS FROM CENTER WATER CENTER QUENCH 3,8 1.1 2.0 2.9 3.8 4.8 5.8 5.7 57 57 56 55 #3 #8 #8 6,7 [,2],6 2,0 2,4 2,8 3,2 3,6 3,9 0,8 1,8 2,5 3,0 3,4 3,8 0,5 1,0 1,6 2,0 2,4 2,8 3,2 3,6 4,0 0,2 0,6 1,0 1,4 1,7 2,0 2,4 2,8 3,1 SURFACE MILD OM CENTER OIL CENTER QUENCH OM CENTER CENTER ¥0 39 37 38 55 54 53 52 51 50 49 48 35 34 33 33 13 14 15 16 46 45 44 43 32 31 30 30 v 18 20 22 29 \$\$ 35 8 3 40 3 5 26 28 30 12 42 42 41 30 29 29 29 HEAT TREATING TEMPERATURES RECOMMENDED BY SAE "NORMALIZE 1600 OF AUSTENITIZE 1550 OF For torged or rolled specimens only

Note-1 in. = 25.4 mm. FIG. 14 Limits for Hardenability Band 4137 H

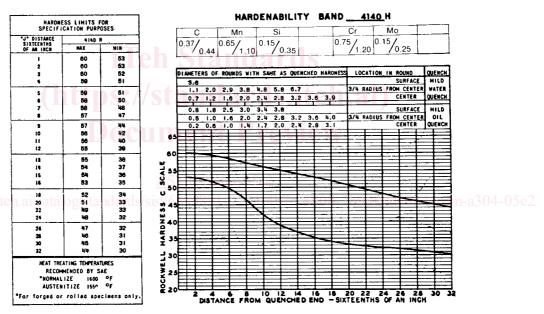


Note-1 in. = 25.4 mm.

FIG. 15 Limits for Hardenability Band 4140 H



HARDENABILITY BAND ___ 4142_H HARDNESS LIMITS FOR SPECIFICATION PURPOSES Cr Mo "J" DISTANCE SIXTEENTHS OF AN INCH 4142 H To.75 0.39 0.65 0.15/0.35 0.15 70.25 0.46 /1.10 1.20 55 55 54 53 52 52 52 61 LOCATION IN ROUND QUENCH SURFACE MILD DIAMETERS OF ROUNDS WITH SAME AS QUENCHED HARDNESS 3.8 1.1 2.0 2.9 3.8 4.8 5.8 6.7 0.7 1.2 1.6 2.0 2.4 2.8 3.2 3.6 3.9 0.8 1.8 2.6 3.0 3.4 3.8 0.5 1.0 1.6 2.0 2.4 2.8 3.2 3.6 4.0 0.2 0.6 1.0 1.4 1.7 2.0 2.4 2.8 3.1 3/4 RADIUS FROM CENTER WATER CENTER QUENCH 53 52 51 50 61 61 60 60 SURFACE HILD 3/4 RADIUS FROM CENTER DIL CENTER QUENCH 60 59 59 58 48 47 65 45 44 58 57 57 56 42 41 40 39 13 14 15 16 55 54 53 53 37 36 35 34 υ 18 20 22 24 SSENORAL SENORAL 52 51 51 50 34 34 33 33 26 ROCKWELL S 20 HEAT TREATING TEMPERATURES RECOMMENDED BY SAE *NORMALIZE 1600 °F AUSTEN (TIZE 1550 °F 4 6 8 10 12 14 16 DISTANCE FROM QUENCHED END 18 20 22 24 26 28 - SIXTEENTHS OF AN INCH For forged or rotted specimens only.

 $N_{OTE}-1$ in. = 25.4 mm. FIG. 16 Limits for Hardenability Band 4142 H

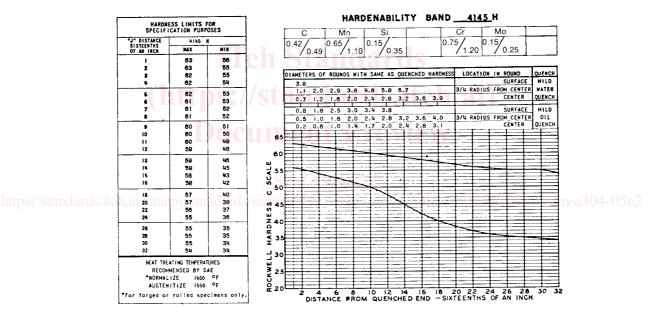

Note + 1 in. = 25.4 mm.

FIG. 17 Limits for Hardenability Band 4145 H