



Standard Test Method for Brinell Hardness of Metallic Materials¹

This standard is issued under the fixed designation E 10; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reappraisal. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reappraisal.

This standard has been approved for use by agencies of the Department of Defense.

1. Scope*

1.1 This test method (Test Method A) covers the determination of the Brinell hardness of metallic materials, including methods for the verification of Brinell hardness testing machines (Test Method B) and the calibration of standardized hardness test blocks (Test Method C).

1.2 The values stated in SI units are to be regarded as the standard.

NOTE 1—In common terminology, the equivalent force in kgf is substituted for N.

1.3 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

2. Referenced Documents

2.1 *ASTM Standards:*²

- E 4 Practices for Force Verification of Testing Machines
- E 29 Practice for Using Significant Digits in Test Data to Determine Conformance with Specifications
- E 74 Practice of Calibration of Force-Measuring Instruments for Verifying the Force Indication of Testing Machines
- E 140 Hardness Conversion Tables for Metals Relationship Among Brinell Hardness, Vickers Hardness, Rockwell Hardness, Superficial Hardness, Knoop Hardness, and Scleroscope Hardness

3. Terminology

3.1 *Definitions of Terms Specific to This Standard:*

¹ This test method is under the jurisdiction of ASTM Committee E28 on Mechanical Testing and is the direct responsibility of Subcommittee E28.06 on Indentation Hardness Testing.

Current edition approved Jan. 1, 2007. Published January 2007. Originally approved in 1924. Last previous edition approved in 2001 as E 10 – 01^{ε1}.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

3.1.1 *Brinell hardness number*—a number, which is proportional to the quotient obtained by dividing the test force by the curved surface area of the indentation which is assumed to be spherical and of the diameter of the ball.

$$HBW = 0.102 \times \frac{2F}{\pi D(D - \sqrt{D^2 - d^2})} \quad (\text{See Table 1}) \quad (1)$$

where:

D = diameter of the ball, mm,

F = test force, N, and

d = mean diameter of the indentation, mm.

The Brinell hardness is denoted by the symbol: HBW.

3.1.1.1 *Discussion*—In former standards, a steel ball was allowed for hardness values below 450. In cases when a steel ball was used, the Brinell hardness was denoted by HB or HBS.

3.1.1.2 *Discussion*—The symbol HBW is preceded by the hardness value. When conditions other than those specified in 11.1.2 are used, the hardness value is supplemented by an index indicating the test conditions in the order:

(1) Diameter of the ball, in mm,

(2) A value representing the test force in kgf (see Table 3), and,

(3) Duration of loading, in s.

Examples:

350 HBW 5/750 = Brinell hardness of 350 determined with a ball of 5-mm diameter and with a test force of 7.355 kN (750 kgf) applied for 10 to 15 s.
600 HBW 1/30/20 = Brinell hardness of 600 determined with a ball of 1-mm diameter and with a test force of 294.2 N (30 kgf) applied for 20 s.

3.1.1.3 *Discussion*—Brinell hardness numbers vary with the test force used; however, test results will generally be in agreement when the ratio of the test force to the square of the ball diameter is held constant (see Table 3).

3.1.1.4 *Discussion*—Table 2 lists the Brinell hardness numbers corresponding to various diameters of indentations for 29.4 kN (3000 kgf), 14.7 kN (1500 kgf), and 4.90 kN (500 kgf) test forces making it unnecessary to calculate for each test the value of the Brinell hardness number by the above equation in Table 1 when these forces are used with a 10-mm diameter ball.

3.1.2 *Brinell hardness test*—an indenter (tungsten carbide ball with diameter D) is forced into the surface of a test piece and the diameter of the indentation d left in the surface after removal of the test force, F , is measured. (see Table 1 and Figs. 1 and 2.)

*A Summary of Changes section appears at the end of this standard.

TABLE 1 Symbols and Designations

NOTE 1—Constant = $\frac{1}{g_n} = \frac{1}{9.80665} = 0.102$

Symbol	Designation
D	Diameter of the ball, mm
F	Test force, N
d	Mean diameter of the indentation, mm
h	Depth of the indentation, mm
HBW	Brinell hardness $= \text{Constant} \times \frac{\text{Test force}}{\text{Surface area of indentation}}$ $= 0.102 \times \frac{2F}{\pi D(D - \sqrt{D^2 - d^2})}$

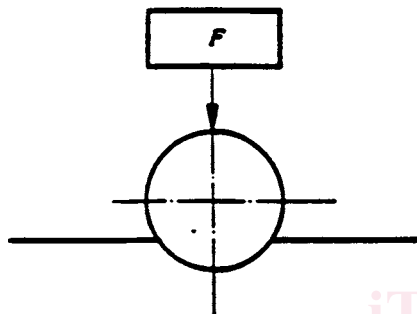


FIG. 1 Principle of Test

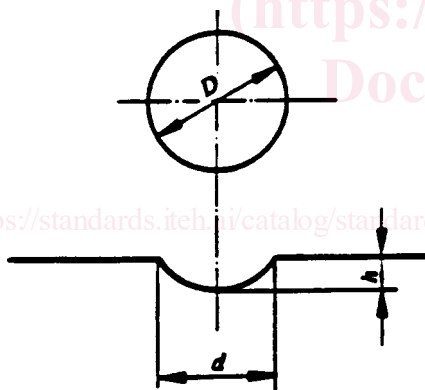


FIG. 2 Principle of Test

3.1.2.1 *Discussion*—The tungsten carbide ball may be used for materials with a Brinell hardness not exceeding 650.

3.1.3 *calibration*—adjustment of the significant parameters by comparison with values indicated by a reference instrument or by a set of reference standards.

3.1.4 *verification*—checking or testing to assure conformance with the specification.

4. Significance and Use

4.1 The Brinell hardness test is an empirical indentation hardness test. Brinell hardness tests provide useful information about metallic materials. This information may correlate to tensile strength, wear resistance, ductility, or other physical characteristics of metallic materials, and may be useful in quality control and selection of materials. Brinell hardness testing at the specific location on a part may not represent the

physical characteristics of the whole part or end product. Brinell hardness tests are considered satisfactory for acceptance testing of commercial shipments, and they have been used extensively in industry for this purpose.

TEST METHOD A—GENERAL DESCRIPTION AND TEST PROCEDURE FOR BRINELL HARDNESS TESTS

5. Apparatus

5.1 *Testing Machine*—Equipment for Brinell hardness testing usually consists of a testing machine which supports the test specimen and applies an indenting force to a ball in contact with the specimen. The design of the testing machines shall be such that no rocking or lateral movement of the indenter or specimen occurs while the force is being applied. The design of the testing machine shall ensure that the force to the indenter shall be applied smoothly and without impact forces. Precautions shall be taken to prevent a momentary high test force caused by the inertia of the system, hydraulic system overshoot, etc. See equipment manufacturer’s instruction manual for a description of the machine’s characteristics, limitations, and respective operating procedure.

5.2 *Brinell Balls:*

5.2.1 The standard ball for Brinell hardness testing shall be 10.000 mm in diameter with a deviation from this value of not more than 0.005 mm in any diameter. The ball shall be polished and free of surface defects. Smaller balls having the diameters and tolerances indicated in Table 4 may be used also provided the precautions set forth in 8.1 are observed.

5.2.2 The tungsten carbide ball indenter shall have a minimum hardness of 1500 HV10.

NOTE 2—**Caution:** The Brinell test is not recommended for material having hardness over 650 HBW (see 8.1).

5.2.2.1 The chemical composition of tungsten carbide balls shall be:

Tungsten Carbide (WC)	Balance
Cobalt (Co)	5.0 to 7.0 %
Total other Carbides	2.0 % max

5.2.2.2 The use of hardened steel ball indenters has been eliminated from this test method. Only tungsten carbide balls may now be used for this test method.

5.2.3 If a ball is used to test a specimen which shows a Brinell hardness greater than 650, the result should be considered suspect and the ball inspected for damage. If there is any evidence of damage, the ball shall be replaced.

5.3 *Measuring Device*—The divisions of the micrometer scale of the microscope or other measuring devices used for the measurement of the diameter of the indentations shall be such as to permit the direct measuring of the diameter to 0.1 mm and the estimation of the diameter to 0.05 mm.

NOTE 3—This requirement applies to the construction of the device only and is not a requirement for measurement of the indentation.

6. Test Specimen

6.1 There is no standard shape or size for a Brinell test specimen. The specimen upon which the indentation is made shall conform to the following:

TABLE 2 Brinell Hardness Numbers^A
 (Ball 10 mm in Diameter, Applied Forces of 500, 1500, and 3000 kgf)

NOTE 1—The values given in this table for Brinell hardness numbers are merely solutions of the equation given in the definition in 3.1.1, and include values for impression diameters outside the ranges recommended in 8.1. These values are indicated by italics.

Diameter of Indentation, mm	Brinell Hardness Number			Diameter of Indentation, mm	Brinell Hardness Number			Diameter of Indentation, mm	Brinell Hardness Number			Diameter of Indentation, mm	Brinell Hardness Number		
	500-kgf Force	1500-kgf Force	3000-kgf Force		500-kgf Force	1500-kgf Force	3000-kgf Force		500-kgf Force	1500-kgf Force	3000-kgf Force		500-kgf Force	1500-kgf Force	3000-kgf Force
2.00	158	473	945	2.60	92.6	278	555	3.20	60.5	182	363	3.80	42.4	127	255
2.01	156	468	936	2.61	91.8	276	551	3.21	60.1	180	361	3.81	42.2	127	253
2.02	154	463	926	2.62	91.1	273	547	3.22	59.8	179	359	3.82	42.0	126	252
2.03	153	459	917	2.63	90.4	271	543	3.23	59.4	178	356	3.83	41.7	125	250
2.04	151	454	908	2.64	89.7	269	538	3.24	59.0	177	354	3.84	41.5	125	249
2.05	150	450	899	2.65	89.0	267	534	3.25	58.6	176	352	3.85	41.3	124	248
2.06	148	445	890	2.66	88.4	265	530	3.26	58.3	175	350	3.86	41.1	123	246
2.07	147	441	882	2.67	87.7	263	526	3.27	57.9	174	347	3.87	40.9	123	245
2.08	146	437	873	2.68	87.0	261	522	3.28	57.5	173	345	3.88	40.6	122	244
2.09	144	432	865	2.69	86.4	259	518	3.29	57.2	172	343	3.89	40.4	121	242
2.10	143	428	856	2.70	85.7	257	514	3.30	56.8	170	341	3.90	40.2	121	241
2.11	141	424	848	2.71	85.1	255	510	3.31	56.5	169	339	3.91	40.0	120	240
2.12	140	420	840	2.72	84.4	253	507	3.32	56.1	168	337	3.92	39.8	119	239
2.13	139	416	832	2.73	83.8	251	503	3.33	55.8	167	335	3.93	39.6	119	237
2.14	137	412	824	2.74	83.2	250	499	3.34	55.4	166	333	3.94	39.4	118	236
2.15	136	408	817	2.75	82.6	248	495	3.35	55.1	165	331	3.95	39.1	117	235
2.16	135	404	809	2.76	81.9	246	492	3.36	54.8	164	329	3.96	38.9	117	234
2.17	134	401	802	2.77	81.3	244	488	3.37	54.4	163	326	3.97	38.7	116	232
2.18	132	397	794	2.78	80.8	242	485	3.38	54.1	162	325	3.98	38.5	116	231
2.19	131	393	787	2.79	80.2	240	481	3.39	53.8	161	323	3.99	38.3	115	230
2.20	130	390	780	2.80	79.6	239	477	3.40	53.4	160	321	4.00	38.1	114	229
2.21	129	386	772	2.81	79.0	237	474	3.41	53.1	159	319	4.01	37.9	114	228
2.22	128	383	765	2.82	78.4	235	471	3.42	52.8	158	317	4.02	37.7	113	226
2.23	126	379	758	2.83	77.9	234	467	3.43	52.5	157	315	4.03	37.5	113	225
2.24	125	376	752	2.84	77.3	232	464	3.44	52.2	156	313	4.04	37.3	112	224
2.25	124	372	745	2.85	76.8	230	461	3.45	51.8	156	311	4.05	37.1	111	223
2.26	123	369	738	2.86	76.2	229	457	3.46	51.5	155	309	4.06	37.0	111	222
2.27	122	366	732	2.87	75.7	227	454	3.47	51.2	154	307	4.07	36.8	110	221
2.28	121	363	725	2.88	75.1	225	451	3.48	50.9	153	306	4.08	36.6	110	219
2.29	120	359	719	2.89	74.6	224	448	3.49	50.6	152	304	4.09	36.4	109	218
2.30	119	356	712	2.90	74.1	222	444	3.50	50.3	151	302	4.10	36.2	109	217
2.31	118	353	706	2.91	73.6	221	441	3.51	50.0	150	300	4.11	36.0	108	216
2.32	117	350	700	2.92	73.0	219	438	3.52	49.7	149	298	4.12	35.8	108	215
2.33	116	347	694	2.93	72.5	218	435	3.53	49.4	148	297	4.13	35.7	107	214
2.34	115	344	688	2.94	72.0	216	432	3.54	49.2	147	295	4.14	35.5	106	213
2.35	114	341	682	2.95	71.5	215	429	3.55	48.9	147	293	4.15	35.3	106	212
2.36	113	338	676	2.96	71.0	213	426	3.56	48.6	146	292	4.16	35.1	105	211
2.37	112	335	670	2.97	70.5	212	423	3.57	48.3	145	290	4.17	34.9	105	210
2.38	111	332	665	2.98	70.1	210	420	3.58	48.0	144	288	4.18	34.8	104	209
2.39	110	330	659	2.99	69.6	209	417	3.59	47.7	143	286	4.19	34.6	104	208
2.40	109	327	653	3.00	69.1	207	415	3.60	47.5	142	285	4.20	34.4	103	207
2.41	108	324	648	3.01	68.6	206	412	3.61	47.2	142	283	4.21	34.2	103	205
2.42	107	322	643	3.02	68.2	205	409	3.62	46.9	141	282	4.22	34.1	102	204
2.43	106	319	637	3.03	67.7	203	406	3.63	46.7	140	280	4.23	33.9	102	203
2.44	105	316	632	3.04	67.3	202	404	3.64	46.4	139	278	4.24	33.7	101	202
2.45	104	313	627	3.05	66.8	200	401	3.65	46.1	138	277	4.25	33.6	101	201
2.46	104	311	621	3.06	66.4	199	398	3.66	45.9	138	275	4.26	33.4	100	200
2.47	103	308	616	3.07	65.9	198	395	3.67	45.6	137	274	4.27	33.2	99.7	199
2.48	102	306	611	3.08	65.5	196	393	3.68	45.4	136	272	4.28	33.1	99.2	198
2.49	101	303	606	3.09	65.0	195	390	3.69	45.1	135	271	4.29	32.9	98.8	198
2.50	100	301	601	3.10	64.6	194	388	3.70	44.9	135	269	4.30	32.8	98.3	197
2.51	99.4	298	597	3.11	64.2	193	385	3.71	44.6	134	268	4.31	32.6	97.8	196
2.52	98.6	296	592	3.12	63.8	191	383	3.72	44.4	133	266	4.32	32.4	97.3	195
2.53	97.8	294	587	3.13	63.3	190	380	3.73	44.1	132	265	4.33	32.3	96.8	194
2.54	97.1	291	582	3.14	62.9	189	378	3.74	43.9	132	263	4.34	32.1	96.4	193
2.55	96.3	289	578	3.15	62.5	188	375	3.75	43.6	131	262	4.35	32.0	95.9	192
2.56	95.5	287	573	3.16	62.1	186	373	3.76	43.4	130	260	4.36	31.8	95.5	191
2.57	94.8	284	569	3.17	61.7	185	370	3.77	43.1	129	259	4.37	31.7	95.0	190
2.58	94.0	282	564	3.18	61.3	184	368	3.78	42.9	129	257	4.38	31.5	94.5	189
2.59	93.3	280	560	3.19	60.9	183	366	3.79	42.7	128	256	4.39	31.4	94.1	188
4.40	31.2	93.6	187	5.05	23.3	69.8	140	5.70	17.8	53.5	107	6.35	14.0	42.0	84.0
4.41	31.1	93.2	186	5.06	23.2	69.5	139	5.71	17.8	53.3	107	6.36	13.9	41.8	83.7
4.42	30.9	92.7	185	5.07	23.1	69.2	138	5.72	17.7	53.1	106	6.37	13.9	41.7	83.4
4.43	30.8	92.3	185	5.08	23.0	68.9	138	5.73	17.6	52.9	106	6.38	13.8	41.5	83.1
4.44	30.6	91.8	184	5.09	22.9	68.6	137	5.74	17.6	52.7	105	6.39	13.8	41.4	82.8
4.45	30.5	91.4	183	5.10	22.8	68.3	137	5.75	17.5	52.5	105	6.40	13.7	41.2	82.5

TABLE 2 *Continued*

Diameter of Indentation, mm	Brinell Hardness Number			Diameter of Indentation, mm	Brinell Hardness Number			Diameter of Indentation, mm	Brinell Hardness Number			Diameter of Indentation, mm	Brinell Hardness Number		
	500-kgf Force	1500-kgf Force	3000-kgf Force		500-kgf Force	1500-kgf Force	3000-kgf Force		500-kgf Force	1500-kgf Force	3000-kgf Force		500-kgf Force	1500-kgf Force	3000-kgf Force
4.46	30.3	91.0	182	5.11	22.7	68.0	136	5.76	17.4	52.3	105	6.41	13.7	41.1	82.2
4.47	30.2	90.5	181	5.12	22.6	67.7	135	5.77	17.4	52.1	104	6.42	13.6	40.9	81.9
4.48	30.0	90.1	180	5.13	22.5	67.4	135	5.78	17.3	51.9	104	6.43	13.6	40.8	81.6
4.49	29.9	89.7	179	5.14	22.4	67.1	134	5.79	17.2	51.7	103	6.44	13.5	40.6	81.3
4.50	29.8	89.3	179	5.15	22.3	66.9	134	5.80	17.2	51.5	103	6.45	13.5	40.5	81.0
4.51	29.6	88.8	178	5.16	22.2	66.6	133	5.81	17.1	51.3	103	6.46	13.4	40.4	80.7
4.52	29.5	88.4	177	5.17	22.1	66.3	133	5.82	17.0	51.1	102	6.47	13.4	40.2	80.4
4.53	29.3	88.0	176	5.18	22.0	66.0	132	5.83	17.0	50.9	102	6.48	13.4	40.1	80.1
4.54	29.2	87.6	175	5.19	21.9	65.8	132	5.84	16.9	50.7	101	6.49	13.3	39.9	79.8
4.55	29.1	87.2	174	5.20	21.8	65.5	131	5.85	16.8	50.5	101	6.50	13.3	39.8	79.6
4.56	28.9	86.8	174	5.21	21.7	65.2	130	5.86	16.8	50.3	101	6.51	13.2	39.6	79.3
4.57	28.8	86.4	173	5.22	21.6	64.9	130	5.87	16.7	50.2	100	6.52	13.2	39.5	79.0
4.58	28.7	86.0	172	5.23	21.6	64.7	129	5.88	16.7	50.0	99.9	6.53	13.1	39.4	78.7
4.59	28.5	85.6	171	5.24	21.5	64.4	129	5.89	16.6	49.8	99.5	6.54	13.1	39.2	78.4
4.60	28.4	85.4	170	5.25	21.4	64.1	128	5.90	16.5	49.6	99.2	6.55	13.0	39.1	78.2
4.61	28.3	84.8	170	5.26	21.3	63.9	128	5.91	16.5	49.4	98.8	6.56	13.0	38.9	78.0
4.62	28.1	84.4	169	5.27	21.2	63.6	127	5.92	16.4	49.2	98.4	6.57	12.9	38.8	77.6
4.63	28.0	84.0	168	5.28	21.1	63.3	127	5.93	16.3	49.0	98.0	6.58	12.9	38.7	77.3
4.64	27.9	83.6	167	5.29	21.0	63.1	126	5.94	16.3	48.8	97.7	6.59	12.8	38.5	77.1
4.65	27.8	83.3	167	5.30	20.9	62.8	126	5.95	16.2	48.7	97.3	6.60	12.8	38.4	76.8
4.66	27.6	82.9	166	5.31	20.9	62.6	125	5.96	16.2	48.5	96.9	6.61	12.8	38.3	76.5
4.67	27.5	82.5	165	5.32	20.8	62.3	125	5.97	16.1	48.3	96.6	6.62	12.7	38.1	76.2
4.68	27.4	82.1	164	5.33	20.7	62.1	124	5.98	16.0	48.1	96.2	6.63	12.7	38.0	76.0
4.69	27.3	81.8	164	5.34	20.6	61.8	124	5.99	16.0	47.9	95.9	6.64	12.6	37.9	75.7
4.70	27.1	81.4	163	5.35	20.5	61.5	123	6.00	15.9	47.7	95.5	6.65	12.6	37.7	75.4
4.71	27.0	81.0	162	5.36	20.4	61.3	123	6.01	15.9	47.6	95.1	6.66	12.5	37.6	75.2
4.72	26.9	80.7	161	5.37	20.3	61.0	122	6.02	15.8	47.4	94.8	6.67	12.5	37.5	74.9
4.73	26.8	80.3	161	5.38	20.3	60.8	122	6.03	15.7	47.2	94.4	6.68	12.4	37.3	74.7
4.74	26.6	79.9	160	5.39	20.2	60.6	121	6.04	15.7	47.0	94.1	6.69	12.4	37.2	74.4
4.75	26.5	79.6	159	5.40	20.1	60.3	121	6.05	15.6	46.8	93.7	6.70	12.4	37.1	74.1
4.76	26.4	79.2	158	5.41	20.0	60.1	120	6.06	15.6	46.7	93.4	6.71	12.3	36.9	73.9
4.77	26.3	78.9	158	5.42	19.9	59.8	120	6.07	15.5	46.5	93.0	6.72	12.3	36.8	73.6
4.78	26.2	78.5	157	5.43	19.9	59.6	119	6.08	15.4	46.3	92.7	6.73	12.2	36.7	73.4
4.79	26.1	78.2	156	5.44	19.8	59.3	119	6.09	15.4	46.2	92.3	6.74	12.2	36.6	73.1
4.80	25.9	77.8	156	5.45	19.7	59.1	118	6.10	15.3	46.0	92.0	6.75	12.1	36.4	72.8
4.81	25.8	77.5	155	5.46	19.6	58.9	118	6.11	15.3	45.8	91.7	6.76	12.1	36.3	72.6
4.82	25.7	77.1	154	5.47	19.5	58.6	117	6.12	15.2	45.7	91.3	6.77	12.1	36.2	72.3
4.83	25.6	76.8	154	5.48	19.5	58.4	117	6.13	15.2	45.5	91.0	6.78	12.0	36.0	72.1
4.84	25.5	76.4	153	5.49	19.4	58.2	116	6.14	15.1	45.3	90.6	6.79	12.0	35.9	71.8
4.85	25.4	76.1	152	5.50	19.3	57.9	116	6.15	15.1	45.2	90.3	6.80	11.9	35.8	71.6
4.86	25.3	75.8	152	5.51	19.2	57.7	115	6.16	15.0	45.0	90.0	6.81	11.9	35.7	71.3
4.87	25.1	75.4	151	5.52	19.2	57.5	115	6.17	14.9	44.8	89.6	6.82	11.8	35.5	71.1
4.88	25.0	75.1	150	5.53	19.1	57.2	114	6.18	14.9	44.7	89.3	6.83	11.8	35.4	70.8
4.89	24.9	74.8	150	5.54	19.0	57.0	114	6.19	14.8	44.5	89.0	6.84	11.8	35.3	70.6
4.90	24.8	74.4	149	5.55	18.9	56.8	114	6.20	14.7	44.3	88.7	6.86	11.7	35.2	70.4
4.91	24.7	74.1	148	5.56	18.9	56.6	113	6.21	14.7	44.2	88.3	6.86	11.7	35.1	70.1
4.92	24.6	73.8	148	5.57	18.8	56.3	113	6.22	14.7	44.0	88.0	6.87	11.6	34.9	69.9
4.93	24.5	73.5	147	5.58	18.7	56.1	112	6.23	14.6	43.8	87.7	6.88	11.6	34.8	69.6
4.94	24.4	73.2	146	5.59	18.6	55.9	112	6.24	14.6	43.7	87.4	6.89	11.6	34.7	69.4
4.95	24.3	72.8	146	5.60	18.6	55.7	111	6.25	14.5	43.5	87.1	6.90	11.5	34.6	69.2
4.96	24.2	72.5	145	5.61	18.5	55.5	111	6.26	14.5	43.4	86.7	6.91	11.5	34.5	68.9
4.97	24.1	72.2	144	5.62	18.4	55.2	110	6.27	14.4	43.2	86.4	6.92	11.4	34.3	68.7
4.98	24.0	71.9	144	5.63	18.3	55.0	110	6.28	14.4	43.1	86.1	6.93	11.4	34.2	68.4
4.99	23.9	71.6	143	5.64	18.3	54.8	110	6.29	14.3	42.9	85.8	6.94	11.4	34.1	68.2
5.00	23.8	71.3	143	5.65	18.2	54.6	109	6.30	14.2	42.7	85.5	6.95	11.3	34.0	68.0
5.01	23.7	71.0	142	5.66	18.1	54.4	109	6.31	14.2	42.6	85.2	6.96	11.3	33.9	67.7
5.02	23.6	70.7	141	5.67	18.1	54.2	108	6.32	14.1	42.4	84.9	6.97	11.3	33.8	67.5
5.03	23.5	70.4	141	5.68	18.0	54.0	108	6.33	14.1	42.3	84.6	6.98	11.2	33.6	67.3
5.04	23.4	70.1	140	5.69	17.9	53.7	107	6.34	14.0	42.1	84.3	6.99	11.2	33.5	67.0

^A Prepared by the Engineering Mechanics Section, National Bureau of Standards.

6.1.1 *Thickness*—The thickness of the specimen tested shall be such that no bulge or other marking showing the effect of the test force appears on the side of the piece opposite the indentation. As a general rule, the thickness of the specimen shall be at least ten times the depth of the indentation (Table 5).

6.1.2 The minimum width shall conform with the requirements of 8.3.

6.1.3 *Finish*—When necessary, the surface on which the indentation is to be made shall be filed, ground, machined or polished with abrasive material so that the edge of the

TABLE 3 Test Conditions

Hardness Symbol	Ball Diameter D , mm	$0.102 F/D^2$	Test Force F Nominal Value	
HBW 10/3000	10	30	29.42	kN – (3000 kgf)
HBW 10/1500	10	15	14.71	kN – (1500 kgf)
HBW 10/1000	10	10	9.807	kN – (1000 kgf)
HBW 10/500	10	5	4.903	kN – (500 kgf)
HBW 10/250	10	2.5	2.452	kN – (250 kgf)
HBW 10/125	10	1.25	1.226	kN – (125 kgf)
HBW 10/100	10	1	980.7	N – (100 kgf)
HBW 5/750	5	30	7.355	kN – (750 kgf)
HBW 5/250	5	10	2.452	kN – (250 kgf)
HBW 5/125	5	5	1.226	kN – (125 kgf)
HBW 5/62.5	5	2.5	612.9	N – (62.5 kgf)
HBW 5/31.25	5	1.25	306.5	N – (31.25 kgf)
HBW 5/25	5	1	245.2	N – (25 kgf)
HBW 2.5/187.5	2.5	30	1.839	kN – (187.5 kgf)
HBW 2.5/62.5	2.5	10	612.9	N – (62.5 kgf)
HBW 2.5/31.25	2.5	5	306.5	N – (31.25 kgf)
HBW 2.5/15.625	2.5	2.5	153.2	N – (15.625 kgf)
HBW 2.5/7.812.5	2.5	1.25	76.61	N – (7.8125 kgf)
HBW 2.5/6.25	2.5	1	61.29	N – (6.25 kgf)
HBW 2/120	2	30	1.177	kN – (120 kgf)
HBW 2/40	2	10	392.3	N – (40 kgf)
HBW 2/20	2	5	196.1	N – (20 kgf)
HBW 2/10	2	2.5	98.07	N – (10 kgf)
HBW 2/5	2	1.25	49.03	N – (5 kgf)
HBW 2/4	2	1	39.23	N – (4 kgf)
HBW 1/30	1	30	294.2	N – (30 kgf)
HBW 1/10	1	10	98.07	N – (10 kgf)
HBW 1/5	1	5	49.03	N – (5 kgf)
HBW 1/2.5	1	2.5	24.52	N – (2.5 kgf)
HBW 1/1.25	1	1.25	12.26	N – (1.25 kgf)
HBW 1/1	1	1	9.807	N – (1 kgf)

TABLE 4 Tolerances for Brinell Hardness Balls

Ball Diameter, mm	Tolerance, mm
10	±0.005
5	±0.004
2.5	±0.003
2	±0.003
1	±0.003

TABLE 5 Minimum Thickness Requirements for Brinell Hardness Tests

Minimum Thickness of Specimen		Minimum Hardness for Which the Brinell Test May Safely Be Made		
in.	mm	3000-kgf Force	1500-kgf Force	500-kgf Force
1/16	1.6	602	301	100
1/8	3.2	301	150	50
3/16	4.8	201	100	33
1/4	6.4	150	75	25
5/16	8.0	120	60	20
3/8	9.6	100	50	17

indentation shall be clearly defined to permit the measurement of the diameter to the specified accuracy (see 9.1). Care should be taken to avoid overheating or cold working the surface.

7. Verification of Testing Machine

7.1 *Verification Methods*—The hardness testing machine shall be verified in accordance with one of the two acceptable methods of verifying Brinell hardness testing machines as given in Test Method B.

TABLE 6 Standard Test Forces

Ball Diameter, mm	Force	Recommended Range, HBW
10	29.42 kN (3000 kgf)	96 to 600
10	14.7 kN (1500 kgf)	48 to 300
10	4.90 kN (500 kgf)	16 to 100

TABLE 7 Hardness Ranges Used by Standard Test Block Method

100 to 200 HBW
300 to 400 HBW
500 to 600 HBW

7.2 *Test Force Range*—When direct verification is used, the Brinell hardness testing machine is acceptable for use over a test force range within which the error in test force does not exceed $\pm 1\%$. When indirect verification is used, the Brinell hardness machine is acceptable for use over a test force range within which the mean hardness value obtained is within $\pm 3\%$ of the Brinell hardness of the standardized test blocks used.

8. Procedure

8.1 *Magnitude of Test Force*—Typically, the force in the standard Brinell test shall be 29.42 kN (3000 kgf), 14.7 kN (1500 kgf), or 4.90 kN (500 kgf). It is recommended that the diameter of the indentation be between 24 and 60 % of the ball diameter. A lower limit in indentation diameter is necessary because of the risk in damaging the ball and difficulty measuring the indentation. The upper limit is necessary because of a reduction in sensitivity as the diameter of the indentation approaches the ball diameter. The thickness and spacing requirements of 6.1.1, 6.1.2, and 8.3 may determine the maximum permissible diameter of indentation for a specific test. Table 6 gives standard test forces and approximate Brinell hardness numbers for the above range of indentation diameters. It is not mandatory that the Brinell test conform to these hardness ranges, but it should be realized that different Brinell hardness numbers may be obtained for a given material by using different forces on a 10-mm diameter ball. For the purpose of obtaining a continuous scale of values it may be desirable, however, to use a single force to cover the complete range of hardness for a given class of materials. For softer metals, forces of 2.45 kN (250 kgf), 1.23 kN (125 kgf), or 0.981 kN (100 kgf) are sometimes used. The force used shall be specifically stated in the test report (see 11.1.2).

8.1.1 For testing thin or small specimens, a ball less than 10 mm in diameter is sometimes used. Such tests, which are not to be regarded as standard tests, will approximate the standard tests more closely if the relation between the applied force, F , measured in N, and the diameter of the ball, D , measured in mm is the same as in the standard tests,

where:

$$0.102F/D^2 = 30 \text{ for } 29.42 \text{ kN (3000 kgf) force and 10-mm ball,}$$

$$0.102F/D^2 = 15 \text{ for } 14.72 \text{ kN (1500 kgf) force and 10-mm ball, and}$$

$$0.102F/D^2 = 5 \text{ for } 4.90 \text{ kN (500 kgf) force and 10-mm ball.}$$

8.1.1.1 *Example*—A 1.23-kN (125-kgf) test force on a 5-mm diameter ball would approximate a standard 4.90-kN (500-kgf) test force on a 10-mm diameter ball.

8.1.2 Tests for soft metals often are made with the following force-diameter ratios:

$$0.102F/D^2 = 2.5 \quad (2)$$

$$0.102F/D^2 = 1.25$$

$$0.102F/D^2 = 1.0$$

8.1.3 When balls smaller than 10 mm in diameter are used, both the test force and ball size shall be specifically stated in the test report (see 3.1.1, 3.1.1.1, and 11.1.2).

8.2 *Radius of Curvature*—When indentations are made on a curved surface, the minimum radius of curvature of the surface shall be not less than 2½ times the diameter of the ball. Indentations made on curved surfaces may be slightly elliptical rather than circular in shape. The measurements of the indentation shall be taken as the mean of the major and minor axes.

8.3 *Spacing of Indentations*—The distance of the center of the indentation from the edge of the specimen or edge of another indentation shall be at least two and one half times the diameter of the indentation.

8.4 *Application of Test Force*—Apply the force to the specimen uniformly taking precautions to prevent a momentary overload of the system. Apply the full test force for 10 to 15 s.

8.4.1 If a duration of test force application other than 10 to 15 s is used, results of the test shall be reported using the nomenclature outlined in 3.1.1.2 and 11.1.2.

8.5 *Alignment*—The angle between the indenter force line and the surface of the specimen should be $90 \pm 2^\circ$ (see 9.1).

9. Measurement of Indentation

9.1 *Diameter*—In the Brinell hardness test, two diameters of the indentation at right angles to each other shall be measured and their mean value used as a basis for calculation of the Brinell hardness number for flat specimens. If the largest and smallest diameters for two readings of the same indentation differ by 0.1 mm or more, refer to the material specifications for further guidance. For routine tests and for tests to determine compliance with a material or product specification, the diameter of the indentation shall be estimated to 0.05 mm (0.0020 in.).

NOTE 4—These measurements are usually made with a low-magnification portable measuring device (approximately 20×) having a fixed scale in the eyepiece. If a more accurate determination is needed, as in referee or standardization tests, a laboratory comparator such as a micrometer measuring device is required.

10. Conversion to Other Hardness Scales or Tensile Strength Values

10.1 There is no general method for accurately converting Brinell hardness numbers to other hardness scales or tensile strength values. Such conversion are, at best, approximations and, therefore, should be avoided except for special cases where a reliable basis for the approximate conversion has been obtained by comparison tests.

NOTE 5—Hardness Conversion Tables E 140 for Metals give approximate hardness conversion values for specific materials such as steel,

austenitic stainless steel, nickel and high-nickel alloys, and cartridge brass.

11. Report

11.1 Whenever a Brinell hardness number is used, provide the following information:

11.1.1 The Brinell hardness number, which shall be reported rounded to three significant digits in accordance with rounding method in Practice E 29 (for example, 125 HBW, 99.2 HBW).

11.1.2 The test conditions when the Brinell hardness number is determined from forces other than 29.42 kN (3000 kgf), ball diameters other than 10 mm, and test force applications other than 10 to 15 s (see 3.1.1 and 8.4).

12. Precision and Bias

12.1 *Precision*—An interlaboratory comparison program is now in progress which, when completed, will be the basis of a statement on precision.

12.2 *Bias*—There is no basis for defining the bias for this test method.

TEST METHOD B—VERIFICATION OF BRINELL HARDNESS TESTING MACHINES

13. Scope

13.1 Test Method B covers two procedures for the verification of Brinell hardness testing machines. These are as follows:

13.1.1 *Direct Verification*—Separate verification of force application, indenter, and the measuring device for measuring the diameter of the indentation.

13.1.2 *Indirect Verification*—Verification by the standardized test block method.

13.2 New or rebuilt machines shall be initially checked by the direct verification method (see 13.1.1) before being placed in service.

13.3 Machines used for routine testing may be checked by either verification method.

14. General Requirements

14.1 Before a Brinell hardness testing machine is verified, the machine shall be examined to ensure that:

14.1.1 The machine is set up properly.

14.1.2 The ball holder, with a new ball whose nominal diameter has been checked (see 15.1.2), is mounted firmly in the plunger.

14.1.3 The force will be applied and removed without shock or vibration.

14.2 If the measuring device is integral with the machine, the machine shall be examined to ensure the following:

14.2.1 The change from test force application to measuring does not influence the readings.

14.2.2 The method of illumination does not affect the readings.

14.2.3 The center of the indentation is in the center of the field of view.

15. Verification

15.1 *Direct Verification*—Separate verification of force application, indenter, and measuring device: