



Designation: E1647 – 09

Standard Practice for Determining Contrast Sensitivity in Radiology¹

This standard is issued under the fixed designation E1647; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1 This practice covers the design and material selection of a contrast sensitivity measuring gauge used to determine the minimum change in material thickness or density that may be imaged without regard to spatial resolution limitations.

1.2 This practice is applicable to transmitted-beam radiographic and radioscopy imaging systems utilizing X-ray and gamma ray radiation sources.

1.3 The values stated in inch-pound units are to be regarded as standard. The SI units given in parentheses are for information only.

1.4 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.* For specific safety statements, see NIST/ANSI Handbook 114 Section 8, Code of Federal Regulations 21 CFR 1020.40 and 29 CFR 1910.96.

2. Referenced Documents

2.1 ASTM Standards:²

E139/B139M Specification for Phosphor Bronze Rod, Bar, and Shapes

E150/B150M Specification for Aluminum Bronze Rod, Bar, and Shapes

E161 Specification for Nickel Seamless Pipe and Tube

E164 Specification for Nickel-Copper Alloy Rod, Bar, and Wire

E166 Specification for Nickel-Chromium-Iron Alloys (UNS N06600, N06601, N06603, N06690, N06693, N06025, N06045, and N06696), Nickel-Chromium-Cobalt-Molybdenum Alloy (UNS N06617), and Nickel-Iron-Chromium-Tungsten Alloy (UNS N06674) Rod, Bar, and Wire

¹ This practice is under the jurisdiction of ASTM Committee E07 on Nondestructive Testing and is the direct responsibility of Subcommittee E07.01 on Radiology (X and Gamma) Method.

Current edition approved July 1, 2009. Published August 2009. Originally approved in 1994. Last previous edition approved in 2003 as E1647 – 03. DOI: 10.1520/E1647-09.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

E747 Practice for Design, Manufacture and Material Grouping Classification of Wire Image Quality Indicators (IQI) Used for Radiology

E1000 Guide for Radioscopy

E1025 Practice for Design, Manufacture, and Material Grouping Classification of Hole-Type Image Quality Indicators (IQI) Used for Radiology

E1255 Practice for Radioscopy

E1316 Terminology for Nondestructive Examinations

E1411 Practice for Qualification of Radioscopic Systems

E2002 Practice for Determining Total Image Unsharpness in Radiology

E2445 Practice for Performance Evaluation and Long-Term Stability of Computed Radiography Systems

2.2 Federal Standards:³

21 CFR 1020.40 Safety Requirements for Cabinet X-ray Systems

29 CFR 1910.96 Ionizing Radiation

2.3 NIST/ANSI Standards:

NIST/ANSI Handbook 114 General Safety Standard for Installations Using Non-Medical X-ray and Sealed Gamma Ray Sources, Energies to 10 MeV⁴

2.4 Other Standard:⁵

EN 462 – 5 Duplex Wire Image Quality Indicator

EN 13068–1 Radioscopic Testing-Part 1: Qualitative Measurement of Imaging Properties

3. Terminology

3.1 *Definitions*—Definitions of terms applicable to this test method may be found in Terminology **E1316**.

4. Summary of Practice

4.1 It is often useful to evaluate the contrast sensitivity of a penetrating radiation imaging system separate and apart from spatial resolution measurements. Conventional image quality indicators (IQI's), such as Test Method **E747** wire and Practice **E1025** plaque IQIs, combine the contrast sensitivity and

³ Available from U.S. Government Printing Office Superintendent of Documents, 732 N. Capitol St., NW, Mail Stop: SDE, Washington, DC 20401, http://www.access.gpo.gov.

⁴ Available from American Society for Nondestructive Testing (ASNT), P.O. Box 28518, 1711 Arlington Ln., Columbus, OH 43228-0518, http://www.asnt.org.

⁵ Available from British Standards Institute (BSI), 389 Chiswick High Rd., London W4 4AL, U.K., http://www.bsi-global.com.

resolution measurements into an overall performance figure of merit, other methods such as included in Practice E2002 do not address contrast specifically. Such figures of merit are often not adequate to detect subtle changes in imaging system performance. For example, in a high contrast image, spatial resolution can degrade with almost no noticeable effect upon overall image quality. Similarly, in an application in which the imaging system provides a very sharp image, contrast can fade with little noticeable effect upon the overall image quality. These situations often develop and may go unnoticed until the system performance deteriorates below acceptable image quality limits.

5. Significance and Use

5.1 The contrast sensitivity gauge measures contrast sensitivity independent of the imaging system spatial resolution limitations. The thickness recess dimensions of the contrast sensitivity gauge are large with respect to the spatial resolution limitations of most imaging systems. Four levels of contrast sensitivity are measured: 4 %, 3 %, 2 %, and 1 %.

5.2 The contrast sensitivity gauge is intended for use in conjunction with a high-contrast resolution measuring gauge, such as the EN 462 – 5 Duplex Wire Image Quality Indicator. Such gauges measure spatial resolution essentially independent of the imaging system’s contrast sensitivity. Such measurements are appropriate for the qualification and performance monitoring of radiographic and radiosopic imaging systems with film, realtime devices, Computed Radiography (CR) and Digital Detector Arrays (DDA).

5.3 Radioscopic/radiographic system performance may be specified by combining the measured contrast sensitivity expressed as a percentage with the spatial resolution expressed in millimeters of unsharpness. For the EN 462 – 5 spatial resolution gauge, the unsharpness is equal to twice the wire diameter. For the line pair gauge, the unsharpness is equal to the reciprocal of the line-pair/mm value. As an example, an imaging system that exhibits 2 % contrast sensitivity and images the 0.1 mm EN 462 – 5 paired wires (equivalent to imaging 5 line-pairs/millimeter resolution on a line-pair gauge) performs at a 2 %–0.2 mm sensitivity level. A standard method of evaluating overall radiosopic system performance is given in Practice E1411 and in EN 13068–1 and for CR it can be found in Practice E2445.

6. Contrast Sensitivity Gauge Construction and Material Selection

6.1 Contrast sensitivity gauges shall be fabricated in accordance with Fig. 1, using the dimensions given in Table 1, Table 2, and Table 3.

6.2 The gauge shall preferably be fabricated from the examination object material. Otherwise, the following material selection guidelines are to be used:

6.2.1 Materials are designated in eight groupings, in accordance with their penetrating radiation absorption characteristics: groups 03, 02, and 01 for light metals and groups 1 through 5 for heavy metals.

6.2.2 The light metal groups, magnesium (Mg), aluminum (Al), and titanium (Ti) are identified 03, 02, and 01,

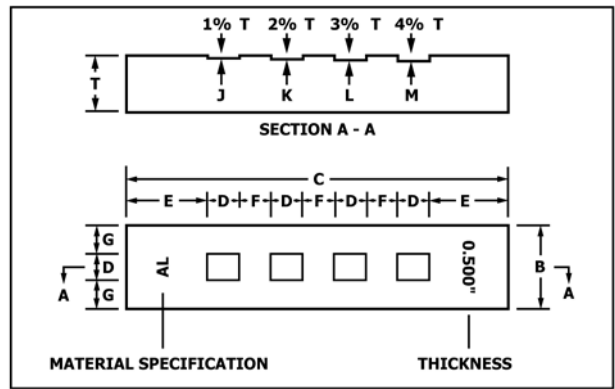


FIG. 1 General Layout of the Contrast Sensitivity Gauge

TABLE 1 Design of the Contrast Sensitivity Gauge

Gauge Thickness	J Recess	K Recess	L Recess	M Recess
T	1 % of T	2 % of T	3 % of T	4 % of T

TABLE 2 Contrast Sensitivity Gauge Dimensions

Gauge Size	B DIM.	C DIM.	D DIM.	E DIM.	F,G DIM.
1	0.750 in. 19.05 mm	3.000 in. 76.20 mm	0.250 in. 6.35 mm	0.625 in. 15.88 mm	0.250 in. 6.35 mm
2	1.500 in. 38.10 mm	6.000 in. 152.40 mm	0.500 in. 12.70 mm	1.250 in. 31.75 mm	0.500 in. 12.7 mm
3	2.250 in. 57.15 mm	9.000 in. 228.60 mm	0.750 in. 19.05 mm	1.875 in. 47.63 mm	0.750 in. 19.05 mm
4	3.000 in. 76.20 mm	12.000 in. 304.80 mm	1.000 in. 25.40 mm	2.500 in. 63.50 mm	1.000 in. 25.4 mm

TABLE 3 Contrast Sensitivity Gauge Application

Gauge Size	Use on Thicknesses
1	Up to 1.5 in. (38.1 mm)
2	Over 1.5 in. (38.1 mm) to 3.0 in. (76.2 mm)
3	Over 3.0 in. (76.2 mm) to 6.0 in. (152.4 mm)
4	Over 6.0 in. (152.4 mm)

respectively, for their predominant constituent. The materials are listed in order of increasing radiation absorption.

6.2.3 The heavy metals group, steel, copper base, nickel base, and other alloys are identified 1 through 5. The materials increase in radiation absorption with increasing numerical designation.

6.2.4 Common trade names or alloy designations have been used for clarification of pertinent materials.

6.3 The materials from which the contrast sensitivity gauge is to be made is designated by group number. The gauge is applicable to all materials in that group. Material groupings are as follows:

6.3.1 *Materials Group 03:*

6.3.1.1 The gauge shall be made of magnesium or a magnesium alloy, provided it is no more radio-opaque than unalloyed magnesium, as determined by the method outlined in 6.4.

6.3.1.2 Use for all alloys where magnesium is the predominant alloying constituent.