



**SLOVENSKI STANDARD**  
**SIST ISO 2370:2020**

**01-oktober-2020**

**Nadomešča:**  
**SIST ISO 2370:1995**

---

**Tekstilije - Določevanje finosti lanenih vlaken - Metode merjenja prepustnosti**

Textiles - Determination of fineness of flax fibres - Permeametric methods

Textiles - Détermination de la finesse des fibres de lin - Méthodes perméamétriques  
**(standards.iteh.ai)**

**Ta slovenski standard je istoveten z: ISO 2370:2019**

<https://standards.iteh.ai/catalog/standards/sist/a62aa720-def9-438e-9adf-be5df654a577/sist-iso-2370-2020>

**ICS:**

59.060.10      Naravna vlakna                      Natural fibres

**SIST ISO 2370:2020**                                      **en,fr**

**iTeh STANDARD PREVIEW**  
**(standards.iteh.ai)**

[SIST ISO 2370:2020](#)

<https://standards.iteh.ai/catalog/standards/sist/a62aa720-def9-438e-9adf-bc5df654a577/sist-iso-2370-2020>

INTERNATIONAL  
STANDARD

ISO  
2370

Third edition  
2019-01

---

---

**Textiles — Determination of fineness  
of flax fibres — Permeametric methods**

*Textiles — Détermination de la finesse des fibres de lin — Méthodes  
perméamétriques*

**iTeh STANDARD PREVIEW**  
**(standards.iteh.ai)**

[SIST ISO 2370:2020](https://standards.iteh.ai/catalog/standards/sist/a62aa720-def9-438e-9adf-bc5df654a577/sist-iso-2370-2020)

[https://standards.iteh.ai/catalog/standards/sist/a62aa720-def9-438e-9adf-  
bc5df654a577/sist-iso-2370-2020](https://standards.iteh.ai/catalog/standards/sist/a62aa720-def9-438e-9adf-bc5df654a577/sist-iso-2370-2020)



Reference number  
ISO 2370:2019(E)

© ISO 2019

## iTeh STANDARD PREVIEW (standards.iteh.ai)

SIST ISO 2370:2020

<https://standards.iteh.ai/catalog/standards/sist/a62aa720-def9-438e-9adf-bc5df654a577/sist-iso-2370-2020>



### **COPYRIGHT PROTECTED DOCUMENT**

© ISO 2019

All rights reserved. Unless otherwise specified, or required in the context of its implementation, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office  
CP 401 • Ch. de Blandonnet 8  
CH-1214 Vernier, Geneva  
Phone: +41 22 749 01 11  
Fax: +41 22 749 09 47  
Email: [copyright@iso.org](mailto:copyright@iso.org)  
Website: [www.iso.org](http://www.iso.org)

Published in Switzerland

# Contents

Page

<b>Foreword</b> .....	<b>iv</b>
<b>Introduction</b> .....	<b>v</b>
<b>1 Scope</b> .....	<b>1</b>
<b>2 Normative references</b> .....	<b>1</b>
<b>3 Terms and definitions</b> .....	<b>1</b>
<b>4 Conditioning and test atmosphere</b> .....	<b>2</b>
<b>5 Constant flow method</b> .....	<b>2</b>
5.1 Principle.....	2
5.2 Sampling.....	2
5.3 Test pieces.....	2
5.3.1 Requirement.....	2
5.3.2 Preparation.....	2
5.4 Apparatus.....	3
5.5 Procedure.....	4
5.5.1 Determination of output.....	4
5.5.2 Measurement of resistance, $R_1$ .....	4
5.5.3 Measurement of resistance, $R_2$ .....	5
5.6 Control of apparatus functioning.....	6
5.7 Calculation and expression of results.....	6
<b>6 Simplified constant flow method</b> .....	<b>7</b>
6.1 Principle.....	7
6.2 Sampling.....	7
6.3 Test pieces.....	8
6.3.1 Requirement.....	8
6.3.2 Preparation.....	8
6.3.3 Determination of the mass of the test pieces.....	8
6.4 Apparatus.....	8
6.5 Procedure.....	10
6.6 Control of apparatus functioning.....	11
6.7 Calculation and expression of results.....	11
<b>7 Constant pressure method</b> .....	<b>11</b>
7.1 Principle.....	11
7.2 Sampling.....	11
7.3 Test pieces.....	12
7.3.1 Requirement.....	12
7.3.2 Preparation.....	12
7.3.3 Determination of the mass of the test pieces.....	12
7.4 Apparatus.....	12
7.5 Procedure.....	12
7.6 Control of apparatus functioning.....	13
7.7 Calculation and expression of results.....	13
<b>8 Test report</b> .....	<b>13</b>
<b>Annex A (normative) Carding of flax tow in wads</b> .....	<b>14</b>
<b>Annex B (normative) Conversion of test results in constant flow method</b> .....	<b>17</b>

## ISO 2370:2019(E)

## Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

The procedures used to develop this document and those intended for its further maintenance are described in the ISO/IEC Directives, Part 1. In particular, the different approval criteria needed for the different types of ISO documents should be noted. This document was drafted in accordance with the editorial rules of the ISO/IEC Directives, Part 2 (see [www.iso.org/directives](http://www.iso.org/directives)).

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights. Details of any patent rights identified during the development of the document will be in the Introduction and/or on the ISO list of patent declarations received (see [www.iso.org/patents](http://www.iso.org/patents)).

Any trade name used in this document is information given for the convenience of users and does not constitute an endorsement.

For an explanation of the voluntary nature of standards, the meaning of ISO specific terms and expressions related to conformity assessment, as well as information about ISO's adherence to the World Trade Organization (WTO) principles in the Technical Barriers to Trade (TBT) see [www.iso.org/iso/foreword.html](http://www.iso.org/iso/foreword.html).

This document was prepared by Technical Committee ISO/TC 38, *Textiles*, Subcommittee SC 23, *Fibres and yarns*.

Any feedback or questions on this document should be directed to the user's national standards body. A complete listing of these bodies can be found at [www.iso.org/members.html](http://www.iso.org/members.html).

This third edition cancels and replaces the second edition (ISO 2370:1980), which has been technically revised. The main changes compared to the previous edition are as follows:

- addition of the third method for the determination of the fineness of flax fibres as [Clause 7](#), "Constant pressure method";
- deletion of Annex C and Annex D.

## Introduction

Fineness can be considered as a vital characteristic of flax. However, because of their special structure, the measurement of the fineness of such fibres presents a difficult problem.

Whereas cotton, wool, man-made fibres, etc., form individual fibres of a given dimension and are easily separated one from the other, flax fibres form, after retting and scutching, fibre strands. These consist of a certain number of ultimate fibres, bound together more or less imperfectly by pectic substances which give certain fibres a branching form. During the spinning operations, these fibre strands are progressively divided without such a process ending in the complete separation into ultimate fibres.

In these conditions, determination of the fineness of flax fibres presents the following difficulties.

- Difficulty from the continuous alteration of the amount of division of the substance during the spinning. One cannot therefore refer to fineness as such, but only to fineness corresponding to a state consecutive to a given operation. It will therefore always be necessary to specify the state in which the substance is found when making any measurement.
- Difficulty, from the fact that the separation of the fibrous elements is a delicate operation, which also results from the constitution of the substance.

Taking these difficulties into account, “permeametric” methods seem most suitable for measuring the fineness of bast.

## iTeh STANDARD PREVIEW (standards.iteh.ai)

[SIST ISO 2370:2020](https://standards.iteh.ai/catalog/standards/sist/a62aa720-def9-438e-9adf-bc5df654a577/sist-iso-2370-2020)

<https://standards.iteh.ai/catalog/standards/sist/a62aa720-def9-438e-9adf-bc5df654a577/sist-iso-2370-2020>

**iTeh STANDARD PREVIEW**  
**(standards.iteh.ai)**

SIST ISO 2370:2020

<https://standards.iteh.ai/catalog/standards/sist/a62aa720-def9-438e-9adf-bc5df654a577/sist-iso-2370-2020>



# Textiles — Determination of fineness of flax fibres — Permeametric methods

## 1 Scope

This document specifies three permeametric methods for the determination of the fineness of flax fibres.

- Constant flow method, with two compressions, using a test piece of parallel fibres (see [Clause 5](#));
- Simplified constant flow method, with one compression, using a test piece of fibres distributed “at random” (see [Clause 6](#));
- Constant pressure method, with one compression, using a test piece of fibres distributed “at random” (see [Clause 7](#)).

This document is applicable to the various forms possible for flax fibres, i.e. long strands, broken strands, all kinds of tow and at all stages of manufacture of these substances.

## 2 Normative references

The following documents are referred to in the text in such a way that some or all of their content constitutes requirements of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 139, *Textiles — Standard atmospheres for conditioning and testing*

ISO 1130, *Textile fibres — Some methods of sampling for testing*

## 3 Terms and definitions

For the purposes of this document, the following terms and definitions apply.

ISO and IEC maintain terminological databases for use in standardization at the following addresses:

- ISO Online browsing platform: available at <https://www.iso.org/obp>
- IEC Electropedia: available at <http://www.electropedia.org/>

### 3.1

#### wad of fibre

fibrous mass introduced into the centre channel of a cylindrical casing forming the test piece and on which the measurement will be made

Note 1 to entry: In the constant flow method, the fibrous elements forming the wad are placed parallel to the axis of the casing. In the simplified constant flow method and constant pressure method, the fibrous mass is introduced into a chamber so that the fibres forming the wad are placed at random. In all three methods, it is essential that the density of the filling is as regular as possible.

### 3.2

#### resistance of a wad of fibres to the passage of air in laminar flow

##### *R*

quotient of the depression  $\Delta P$  (hPa) produced by the *wad of fibres* (3.1) to flow  $Q$  (cm<sup>3</sup>/s) passing through it

Note 1 to entry: It is expressed in hPa·s/cm<sup>3</sup>.

**ISO 2370:2019(E)****3.3****specific surface of a wad of fibres****A**

quotient of the total side surface of the constituent fibrous elements by their volume

Note 1 to entry: It is expressed in  $\text{cm}^2/\text{cm}^3$ .

**3.4****index of specific surface of a wad of fibres****A'**

arithmetic product of the specific surface (A) and the square root of the product of the viscosity of the air ( $\mu$ ) and a dimensionless empirical factor of proportionality (k)

**3.5****index of fineness standard****IFS**

index of fineness determined by a conventional method (gravimetric method) on reference lots

Note 1 to entry: It is relatively close to values expressed by the Tex system.

Note 2 to entry: Compensation is permitted for the fact that the fineness of flax fibres cannot be defined in an absolute manner.

**4 Conditioning and test atmosphere**

Weighing and measuring shall be carried out in the standard atmosphere for conditioning and testing of textiles, defined in ISO 139, on test pieces previously conditioned in the same atmosphere.

**5 Constant flow method**

SIST ISO 2370:2020

<https://standards.iteh.ai/catalog/standards/sist/a62aa720-def9-438e-9adf-bc5df654a577/sist-iso-2370-2020>

**5.1 Principle**

Measurement of the resistance to the passage of air of a wad of parallel fibres of given mass placed successively in two casings of specified size but different diameters, then, from the two values obtained, deduction of the index of specific surface of the wad and the density of the fibres, which characterize the fineness of the fibres.

**5.2 Sampling**

Samples shall be representative of a batch.

Sampling shall be carried out by one of the methods given in ISO 1130.

**5.3 Test pieces****5.3.1 Requirement**

The test piece shall consist of a stub of parallel fibres about  $80 \text{ mm} \pm 1 \text{ mm}$  long, having a mass between 2,8 g and 3,2 g, depending on the material. Five test pieces shall be prepared for each sampling.

**5.3.2 Preparation****5.3.2.1 Scutched or hackled flax**

Cut from the desired place (for example top, middle, bottom) stubs  $80 \text{ mm} \pm 1 \text{ mm}$  long.

### 5.3.2.2 Flax tow


Carry out carding to make the fibres parallel by using hand carding machines as specified in [Annex A](#). Cut from the middle stubs 80 mm ± 1 mm long.

### 5.3.2.3 Slivers

Take, at intervals, sections about 80 mm ± 1 mm long. Bring together the various stubs and take the mass required for the test.

## 5.4 Apparatus

### 5.4.1 Apparatus, shown in [Figure 1](#).

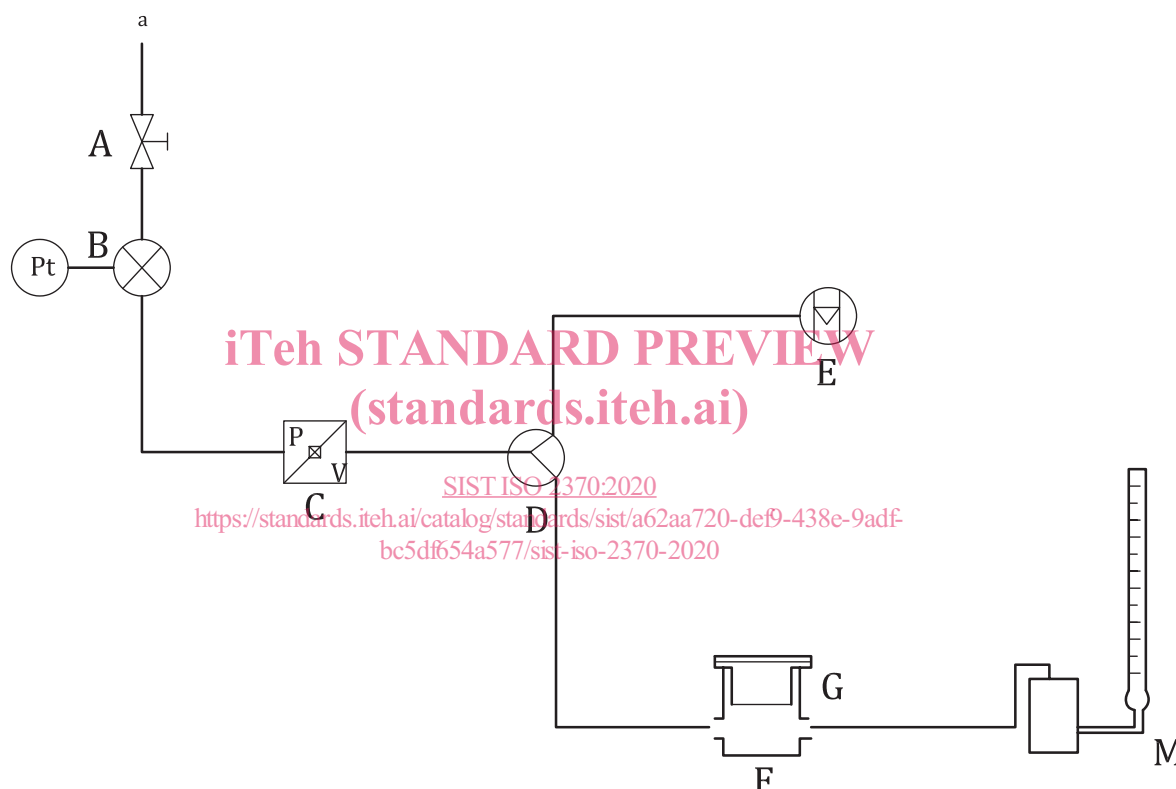

#### Key

A	air tap	E	output meter
B	gauge	F	measuring chamber
C	butterfly valve for output control	G	threaded cap
D	three-way tap	M	manometer
a	To compressor.		

**Figure 1 — Apparatus for the constant flow method**

**5.4.1.1 Air tap, A**, below an air chamber (minimum pressure 0,15 MPa) fed by a compressor or by a general dry compressed air line.

**5.4.1.2 Gauge, B**, graduated from 0 MPa to 0,2 MPa, with a control device.

**5.4.1.3 Butterfly valve for output control, C**, (0,15 cm<sup>3</sup>/s to 0,85 cm<sup>3</sup>/s).