

## SLOVENSKI STANDARD oSIST prEN ISO 11357-1:2022

01-april-2022

Polimerni materiali - Diferenčna dinamična kalorimetrija (DSC) - 1. del: Splošna načela (ISO/DIS 11357-1:2022)

Plastics - Differential scanning calorimetry (DSC) - Part 1: General principles (ISO/DIS 11357-1:2022)

Kunststoffe – Dynamische Differenzkalorimetrie (DSC) – Teil1: Allgemeine Grundlagen (ISO/DIS 11357-1:2022)

PREVIEW

Plastiques - Analyse calorimétrique différentielle (DSC) - Partie 1: Principes généraux (ISO/DIS 11357-1:2022)

Ta slovenski standard je istoveten z: ai/catpren ISO 11357-12022

76df-45df-a881-df3d69d1405a/osist-pren-iso-11357-1-

2()2.2.

#### ICS:

17.200.10 Toplota. Kalorimetrija Heat. Calorimetry 83.080.01 Polimerni materiali na Plastics in general

splošno

oSIST prEN ISO 11357-1:2022 en,fr,de

**oSIST prEN ISO 11357-1:2022** 

## iTeh STANDARD PREVIEW (standards.iteh.ai)

oSIST prEN ISO 11357-1:2022 https://standards.iteh.ai/catalog/standards/sist/a0036832-76df-45df-a881-df3d69d1405a/osist-pren-iso-11357-1-2022

# DRAFT INTERNATIONAL STANDARD ISO/DIS 11357-1

ISO/TC **61**/SC **5** Secretariat: **DIN** 

Voting begins on: Voting terminates on:

2022-01-25 2022-04-19

#### Plastics — Differential scanning calorimetry (DSC) —

#### Part 1:

#### General principles

Plastiques — Analyse calorimétrique différentielle (DSC) — Partie 1: Principes généraux

ICS: 83.080.01

## iTeh STANDARD PREVIEW (standards.iteh.ai)

oSIST prEN ISO 11357-1:2022 https://standards.iteh.ai/catalog/standards/sist/a0036832-76df-45df-a881-df3d69d1405a/osist-pren-iso-11357-1-2022

This document is circulated as received from the committee secretariat.

THIS DOCUMENT IS A DRAFT CIRCULATED FOR COMMENT AND APPROVAL. IT IS THEREFORE SUBJECT TO CHANGE AND MAY NOT BE REFERRED TO AS AN INTERNATIONAL STANDARD UNTIL PUBLISHED AS SUCH.

IN ADDITION TO THEIR EVALUATION AS BEING ACCEPTABLE FOR INDUSTRIAL, TECHNOLOGICAL, COMMERCIAL AND USER PURPOSES, DRAFT INTERNATIONAL STANDARDS MAY ON OCCASION HAVE TO BE CONSIDERED IN THE LIGHT OF THEIR POTENTIAL TO BECOME STANDARDS TO WHICH REFERENCE MAY BE MADE IN NATIONAL REGULATIONS.

RECIPIENTS OF THIS DRAFT ARE INVITED TO SUBMIT, WITH THEIR COMMENTS, NOTIFICATION OF ANY RELEVANT PATENT RIGHTS OF WHICH THEY ARE AWARE AND TO PROVIDE SUPPORTING DOCUMENTATION.

ISO/CEN PARALLEL PROCESSING



Reference number ISO/DIS 11357-1:2022(E)

## iTeh STANDARD PREVIEW (standards.iteh.ai)

oSIST prEN ISO 11357-1:2022 https://standards.iteh.ai/catalog/standards/sist/a0036832-76df-45df-a881-df3d69d1405a/osist-pren-iso-11357-1-2022



#### **COPYRIGHT PROTECTED DOCUMENT**

© ISO 2022

All rights reserved. Unless otherwise specified, or required in the context of its implementation, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office CP 401 • Ch. de Blandonnet 8 CH-1214 Vernier, Geneva Phone: +41 22 749 01 11 Email: copyright@iso.org Website: www.iso.org

Published in Switzerland

Contents		Page	
Fore	word		v
Intr	oductio	on	vi
1	Scop	oe	1
2	•	native references	
3		ns and definitions	
4	<b>Basi</b> 4.1	<b>c principles</b> General	
	4.1	Heat-flux DSC	
	4.3	Power-compensation DSC	
5	Appa	aratus and materials	9
6		eimen	
7	-	conditions and specimen conditioning	
,	7.1	Test conditions	11
	7.2	Conditioning of specimens	
8	Calik	pration	11
	8.1	General Tob STANDADD	11
	8.2	General Toh STANDARD Calibration materials	12
	8.3	Temperature calibration REVIEW 8.3.1 General	12
		8.3.1 General TREVIEW	12
		8.3.2 Procedure 8.3.3 Accuracy of calibration CCS. Iteh. ai	12
	0.4	Heat calibration	13
	8.4		
		8.4.1 General 8.4.2 Procedure <u>OSIST prEN ISO 11357-1:2022</u>	13
		8.4.3httAccuracy of dalibrationatalog/standards/sist/a0036832-	14
	8.5	Heat flowfratedcalibrationd69d1405a/osist-pren-iso-11357-1-	14
		8.5.1 General <u>2022</u>	
		8.5.2 Procedure	
9		redure	
	9.1	Setting up the apparatus	
		9.1.1 Switching on 9.1.2 Purge gas	
		9.1.2 Purge gas	
		9.1.4 Baseline determination	
	9.2	Loading the specimen into the crucible	
		9.2.1 General	
		9.2.2 Selection of crucibles	
		9.2.3 Weighing the specimen crucible	
		9.2.4 Loading the specimen 9.2.5 Determination of the mass of the specimen	
	9.3	Insertion of crucibles into the instrument	
	9.4	Performing measurements	
		9.4.1 General	18
		9.4.2 Scanning mode	
	0.5	9.4.3 Isothermal mode	
	9.5	Post-run checks 9.5.1 Check for loss in mass	
		9.5.2 Inspection of specimens	
		9.5.3 Checking of crucibles and crucible holder	
10	Tost	renort	20
4 1/	1 (2.2)	1 3.17371 3	

#### oSIST prEN ISO 11357-1:2022

#### ISO/DIS 11357-1:2022(E)

Annex A (normative) Extended, high-precision, temperature calibration [12]	22
Annex B (normative) Extended, high-precision, heat calibration	24
Annex C (informative) Recommended calibration materials	26
Annex D (informative) Interaction of calibration materials with different crucible materials	30
Annex E (informative) General recommendations	32
Bibliography	34

## iTeh STANDARD PREVIEW (standards.iteh.ai)

oSIST prEN ISO 11357-1:2022 https://standards.iteh.ai/catalog/standards/sist/a0036832-76df-45df-a881-df3d69d1405a/osist-pren-iso-11357-1-2022

#### **Foreword**

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

The procedures used to develop this document and those intended for its further maintenance are described in the ISO/IEC Directives, Part 1. In particular, the different approval criteria needed for the different types of ISO documents should be noted. This document was drafted in accordance with the editorial rules of the ISO/IEC Directives, Part 2 (see <a href="www.iso.org/directives">www.iso.org/directives</a>).

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights. Details of any patent rights identified during the development of the document will be in the Introduction and/or on the ISO list of patent declarations received (see <a href="https://www.iso.org/patents">www.iso.org/patents</a>).

Any trade name used in this document is information given for the convenience of users and does not constitute an endorsement.

For an explanation of the voluntary nature of standards, the meaning of ISO specific terms and expressions related to conformity assessment, as well as information about ISO's adherence to the World Trade Organization (WTO) principles in the Technical Barriers to Trade (TBT), see <a href="https://www.iso.org/iso/foreword.html">www.iso.org/iso/foreword.html</a>.

This document was prepared by Technical Committee ISO/TC 61, *Plastics*, Subcommittee SC 5, *Physical-chemical properties*.

This fourth edition cancels and replaces the third edition (ISO 11357-1:2016), which has been technically revised.

76df-45df-a881-df3d69d1405a/osist-pren-iso-11357-1-

The main changes compared to the previous edition are as follows:

- the examples of materials given for temperature and enthalpy calibration has been updated;
- the data of sapphire to be used for calibration of heat flow rate have been updated.

A list of all parts in the ISO 11357 series can be found on the ISO website.

Any feedback or questions on this document should be directed to the user's national standards body. A complete listing of these bodies can be found at <a href="https://www.iso.org/members.html">www.iso.org/members.html</a>.

#### Introduction

ISO 11357 describes thermoanalytical DSC test methods which can be used for quality assurance purposes, for routine checks of raw materials and finished products or for the determination of comparable data needed for data sheets or databases. The procedures given in ISO 11357 apply as long as product standards or standards describing special atmospheres for conditioning of specimens do not specify otherwise.

## iTeh STANDARD PREVIEW (standards.iteh.ai)

oSIST prEN ISO 11357-1:2022 https://standards.iteh.ai/catalog/standards/sist/a0036832-76df-45df-a881-df3d69d1405a/osist-pren-iso-11357-1-2022

#### Plastics — Differential scanning calorimetry (DSC) —

#### Part 1:

#### General principles

#### 1 Scope

The ISO 11357 series specifies several differential scanning calorimetry (DSC) methods for the thermal analysis of polymers and polymer blends, such as

- thermoplastics (polymers, moulding compounds and other moulding materials, with or without fillers, fibres or reinforcements),
- thermosets (uncured or cured materials, with or without fillers, fibres or reinforcements), and
- elastomers (with or without fillers, fibres or reinforcements).

The ISO 11357 series is applicable for the observation and measurement of various properties of, and phenomena associated with, the above-mentioned materials, such as

- physical transitions (glass transition, phase transitions such as melting and crystallization, polymorphic transitions, etc.),
- chemical reactions (polymerization, crosslinking and curing of elastomers and thermosets, etc.),
- the stability to oxidation, and

oSIST prEN ISO 11357-1:2022

— the heat capacity<sub>tps://standards.iteh.ai/catalog/standards/sist/a0036832-</sub>

This document specifies a number of general aspects of differential scanning calorimetry, such as the principle and the apparatus, sampling, calibration and general aspects of the procedure and test report common to all following parts.

Details on performing specific methods are given in subsequent parts of the ISO 11357 series (see Foreword).

SAFETY STATEMENT Persons using this document should be familiar with normal laboratory practice, if applicable. This document does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user to establish appropriate safety and health practices and to ensure compliance with any regulatory requirements.

#### 2 Normative references

The following documents are referred to in the text in such a way that some or all of their content constitutes requirements of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 472, Plastics — Vocabulary

ISO 80000-5, Quantities and units — Part 5: Thermodynamics

#### 3 Terms and definitions

For the purposes of this document, the terms and definitions given in ISO 472 and ISO 80000-5 and the following apply.

ISO and IEC maintain terminology databases for use in standardization at the following addresses:

- ISO Online browsing platform: available at <a href="https://www.iso.org/obp">https://www.iso.org/obp</a>
- IEC Electropedia: available at <a href="https://www.electropedia.org/">https://www.electropedia.org/</a>

#### 3.1

## differential scanning calorimetry DSC

technique in which the difference between the rate of flow of heat into a specimen crucible containing the specimen and that into a *reference crucible* (3.3) is derived as a function of temperature and/or time while the specimen and reference are subjected to the same controlled temperature programme in a specified atmosphere using a symmetrical measurement system

Note 1 to entry: It is common practice to record, for each measurement run, a curve in which temperature or time is plotted as the abscissa and *heat flow rate* (3.4) difference as the ordinate. The endothermic and/or exothermic direction is indicated on the DSC curve.

Note 2 to entry: According to the principles of thermodynamics, energy absorbed by a system is considered positive while energy released is negative. This approach implies that the endothermic direction points upwards in the ordinate and the exothermic direction downwards (see Figures 1 and 2). It also has the advantage that the direction of thermal effects in plots of *heat flow rate* (3.4) and specific heat is consistent.

#### 3.2

#### calibration material

material for which one or more of the thermal properties are sufficiently homogeneous and well established to be used for the calibration of a DSC instrument or for the assessment of a measurement method

#### 3.3

## (standards.iteh.ai)

#### reference crucible

crucible used on the reference side of the symmetrical crucible holder assembly

oSIST prEN ISO 11357-1:2022

Note 1 to entry: Normally, the reference crucible is empty talog/standards/sist/a0036832-

Note 2 to entry: In special cases, such as the measurement of highly filled of reinforced polymers or specimens having a heat capacity comparable to that of the crucible, a suitable material can be used inside the reference crucible. This reference material should be thermally inactive over the temperature and time range of interest and its heat capacity should be similar to that of the specimen. In the case of filled or reinforced products, the pure filler or reinforcement can be used, for example.

#### 3.4

#### heat flow rate

quantity of heat transferred per unit time (dQ/dt)

Note 1 to entry: It is expressed in watts (W) or milliwatts (mW).

Note 2 to entry: The total quantity of heat transferred, *Q*, corresponds to the time integral of the heat flow rate:

$$Q = \int \frac{\mathrm{d}Q}{\mathrm{d}t} \,\mathrm{d}t$$

#### 3.5

#### change in heat

#### ۸0

quantity of heat absorbed (endothermic,  $\Delta Q$  positive) or released (exothermic,  $\Delta Q$  negative) within a specified time, t, or temperature, T, range by a specimen undergoing a chemical or physical change and/ or a temperature change:

$$\Delta Q = \int_{t_1}^{t_2} \frac{\mathrm{d}Q}{\mathrm{d}t} \, \mathrm{d}t$$

or

$$\Delta Q = \frac{60}{\beta} \int_{T_1}^{T_2} \frac{\mathrm{d}Q}{\mathrm{d}t} \, \mathrm{d}T$$

where

- Δ0 is expressed in joules (J) or as a specific quantity,  $\Delta q$ , expressed in joules per amount of material in grams ( $J \cdot g^{-1}$ ) or joules per amount of material in moles ( $J \cdot mol^{-1}$ );
- is the constant heating or cooling rate, dT/dt, expressed in kelvins per minute (K·min<sup>-1</sup>). β

Note 1 to entry: If measurements are made at constant pressure,  $\Delta O$  corresponds to the change in enthalpy,  $\Delta H$ .

#### 3.6

#### specific heat capacity at constant pressure

 $\emph{c}_{\emph{p}}$  quantity of heat necessary to raise the temperature of unit mass of material by 1 K at constant pressure:

$$c_p = \frac{1}{m} \times \left(\frac{\mathrm{d}Q}{\mathrm{d}T}\right)_p$$

or

$$c_p = \frac{1}{m} \times \frac{60}{\beta} \times \left(\frac{\mathrm{d}Q}{\mathrm{d}t}\right)_p$$

# $c_p = \frac{1}{m} \times \frac{60}{\beta} \times \left(\frac{dQ}{dt}\right)_p$ **iTeh STANDARD pD**

where

### (standards.iteh.ai)

- dQ is the quantity of heat, expressed in joules (J), necessary to raise the temperature of an amount of material of mass m, expressed in grams (g), by dT kelvins at constant pressure;
- is the heating rate, expressed in kelvins per minute (Kimin 1) 36832-76df-45df-a881-df3d69d1405a/osist-pren-iso-11357-1-
- is expressed in joules per gram per kelvin ( $J \cdot g^{-1} \cdot K^{-1}$ ).

Note 1 to entry:  $c_p$  may also be expressed in joules per mole per kelvin (J·mol<sup>-1</sup>·K<sup>-1</sup>) when the amount of material, *m*, is expressed in moles.

Note 2 to entry: When analysing polymers, ensure that the measured specific heat capacity does not include any heat change due to a chemical reaction or a physical transition.

#### 3.7

#### baseline

part of the recorded curve in which no reactions or transitions take place

Note 1 to entry: This can be an isothermal baseline when the temperature is maintained constant or a dynamic baseline when the temperature is changed in accordance with a controlled temperature programme.

Note 2 to entry: The baselines defined in 3.7.1 to 3.7.3 refer to the quasi-stationary range only, i.e. when the instrument is operating under stable conditions shortly after starting and shortly before ending the DSC run (see Figure 1).

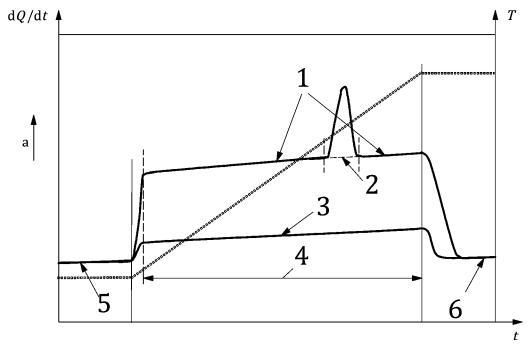




Figure 1stanSchematical rawing/showing basefines 6832-76df-45df-a881-df3d69d1405a/osist-pren-iso-11357-1-2022

#### 3.7.1

#### instrument baseline

 $curve\ obtained\ using\ only\ empty\ crucibles\ of\ identical\ mass\ and\ material\ in\ the\ specimen\ and\ reference\ positions\ of\ the\ DSC\ cell$ 

Note 1 to entry: The instrument baseline is required for heat capacity measurements.

#### 3.7.2

#### specimen baseline

DSC curve obtained outside any reaction or transition zone(s) while the instrument is loaded with both the specimen in the specimen crucible and the *reference crucible* (3.3)

Note 1 to entry: In this part of the curve, the difference in *heat flow rate* (3.4) between the specimen crucible and the *reference crucible* (3.3) depends solely on the heat capacity of the specimen and the *instrument baseline* (3.7.1).

Note 2 to entry: The specimen baseline reflects the temperature dependence of the heat capacity of the specimen.

Note 3 to entry: For heat capacity determinations, a dynamic DSC curve is required and, in addition, the *instrument baseline* (3.7.1) and the isothermal start and end baselines (see Figure 1).

#### 3.7.3

#### virtual baseline

imaginary line drawn through a reaction and/or transition zone assuming the heat of reaction and/or transition to be zero

Note 1 to entry: Assuming the change in heat capacity with temperature to be linear, the virtual baseline is drawn by interpolating or extrapolating the specimen baseline in a straight line. It is normally indicated on the DSC curve for convenience (see Figures 1 and 2).

Note 2 to entry: The virtual baseline drawn from peak onset,  $T_{\rm i}$ , to peak end,  $T_{\rm f}$  (the peak baseline) allows the determination of the peak area from which the heat of transition can be obtained. If there is no significant change in heat capacity during the transition or reaction, the baseline can be drawn simply by connecting the peak onset and peak end by a straight line. If significant heat capacity changes occur, a sigmoidal baseline can be drawn.

Note 3 to entry: Extrapolated and interpolated virtual baselines will not necessarily coincide with each other (see Figure 2).

#### 3.8

#### step

abrupt positive or negative change in the height of a DSC curve, taking place over a limited temperature range

Note 1 to entry: A step in the DSC curve can be caused by, for example, a glass transition (see Figure 2).

iTeh STANDARD

#### 3.8.1

#### step height

difference between the heights of the extrapolated baselines before and after a step, measured at the time or temperature corresponding to the point on the DSC curve which is equidistant between the two baselines

(standards.iteh.ai)

#### 3.9

#### peak

part of the DSC curve which departs from the specimen baseline (3.7.2), reaches a maximum or minimum, and subsequently returns/to-the specimen baseline (3.7.2) ards/sist/a0036832-

Note 1 to entry: A peak in the DSC curve may indicate a chemical reaction or a first-order transition. The initial departure of the peak from the *virtual baseline* (3.7.3) corresponds to the start of the reaction or transition.

#### 3.9.1

#### endothermic peak

peak in which the rate of flow of heat into the specimen crucible is greater than that into the *reference crucible* (3.3)

Note 1 to entry: This corresponds to a transition which absorbs heat.

#### 3.9.2

#### exothermic peak

peak in which the rate of flow of heat into the specimen crucible is less than that into the *reference crucible* (3.3)

Note 1 to entry: This corresponds to a transition which releases heat.

#### 3.9.3

#### peak area

area enclosed by a peak and the interpolated virtual baseline (3.7.3)