This document is not an ASTM standard and is intended only to provide the user of an ASTM standard an indication of what changes have been made to the previous version. Because it may not be technically possible to adequately depict all changes accurately, ASTM recommends that users consult prior editions as appropriate. In all cases only the current version of the standard as published by ASTM is to be considered the official document.



Designation:F392-93 (Reapproved 2004)

Standard Test Method for Flex Durability of Flexible Barrier MaterialsDesignation: F392/F392M – 11

Standard Practice for Conditioning Flexible Barrier Materials for Flex Durability¹

This standard is issued under the fixed designation $F392/\underline{F392M}$; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ε) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1This test method covers the determination of the flex resistance of flexible barrier materials. Pinhole formation is the criterion presented for measuring failure, but other tests such as gas-transmission rates can be used in place of the pinhole test.

1.2This standard does not purport to address all of the safety problems, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use. Specific precautionary statements are given in 5.7.

1.1 This practice covers conditioning of flexible barrier materials for the determination of flex resistance. Subsequent testing can be performed to determine the effects of flexing on material properties. These tests are beyond the scope of this practice.

<u>1.2 The values stated in either SI units or inch-pound units are to be regarded separately as standard. The values stated in each system may not be exact equivalents; therefore, each system shall be used independently of the other. Combining values from the two systems may result in non-conformance with the standard.</u>

<u>1.3 This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.</u>

2. Referenced Documents

2.1 ASTM Standards:²

D618Practice for Conditioning Plastics for Testing

D722Test Method for Grease Resistance of Paper TM F392/F392M-11

E691Practice for Conducting an Interlaboratory Study to Determine the Precision of a Test Method <u>171</u> Specification for <u>Atmospheres for Conditioning and Testing Flexible Barrier Materials</u>

F2097 Guide for Design and Evaluation of Primary Flexible Packaging for Medical Products

3. Summary of Test Method

3.1Specimens of flexible materials are flexed at standard atmospheric conditions (23°C and 50% relative humidity), unless otherwise specified. Flexing conditions and number and severity of flexing strokes vary with the type of structure being tested. The flexing action consists of a twisting motion followed, in most cases, by a horizontal motion, thus, repeatedly twisting and crushing the film. The frequency is at a rate of 45 cpm.

3.2Flex failure is determined by measuring the pinholes formed in the structure. These pinholes are determined by using colored turpentine and allowing it to stain through the holes onto a white backing. In addition, other failure criteria such as gas permeation or moisture-vapor transmission can be used at the discretion of the tester.

3.3The various test conditions are summarized as follows:

3.3.1<u>Terminology</u>

Copyright © ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States.

¹ This test method practice is under the jurisdiction of ASTM Committee F02 on Flexible Barrier MaterialsPackaging and is the direct responsibility of Subcommittee F02.20 on Physical Properties.

Current edition approved May 15, 1993. Published August 1993. Originally published as F392-74. Last previous edition F392-74 (1987). DOI: 10.1520/F0392-93R04. Current edition approved April 1, 2011. Published June 2011. Originally approved in 1974. Last previous edition approved in 2004 as F392 - 93 (2004). DOI: 10.1520/F0392_F0392M-11.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For Annual Book of ASTM Standards volume information, refer to the standard's Document Summary page on the ASTM website.

🕼 F392/F392M – 11

3.1 *pinhole*, *n*—a small opening of non-specific shape or dimension that passes completely through all layers of a flexible material.

3.1.1 *Discussion*—The use of the term "pin" provides the relative size reference as in a small hole made with or as if with a pin.

4. Summary of Practice

4.1 Specimens of flexible materials are flexed at standard atmospheric conditions defined in Specification E171, unless otherwise specified. Flexing conditions and number and severity of flexing strokes vary with the type of structure being tested. The flexing action consists of a twisting motion followed, in most cases, by a horizontal motion, thus, repeatedly twisting and crushing the film. The frequency is at a rate of 45 cycles per minute (cpm.)

4.2 Flex failure is determined by measuring the effect of the flex conditioning on the barrier and/or mechanical performance of the structure. The property to be evaluated determines the appropriate conditioning level.

4.3 The various flex conditioning levels are summarized as follows:

<u>4.3.1</u> Condition A—Full flex for 1 h (that is, 2700 cycles).

3.3.2

4.3.2 Condition B—Full flex for 20 min (that is, 900 cycles).

3.3.3

4.3.3 Condition C—Full flex for 6 min (that is, 270 cycles).

3.3.4

4.3.4 Condition D-Full flex for 20 cycles.

3.3.5

4.3.5 Condition E—Partial flex only for 20 cycles.

4.Significance and Use

4.1This test method is valuable in determining the resistance of flexible-packaging materials to flex-formed pinhole failures. 4.2This test method does not measure any abrasion component relating to flex failure.

4.3Physical holes completely through the structure are the only failures measured by the colored-turpentine-pinhole portion of this test. Failures in the integrity of one of the plies of a multi-ply structure will not be determined by the colored-turpentine test. Gas permeation or moisture vapor transmission tests, or both, can be used in conjunction with the flex test to measure the loss of ply integrity. However, any permeation test requiring a pressure differential will not measure the permeation coefficient in the presence of pinholes.

4.3.1The various conditions described in this procedure are to prevent testing a structure under conditions that either give too many holes to effectively count and be significant (normally greater than 50), or too few to be significant (normally less than five per sample).

4.4Measurements on nylon film, possibly because of its hydrophilic nature, have not shown good reproducibility (between laboratories), although the repeatability of the data within a laboratory was good.

5. Apparatus and Reagent

5.1 Significance and Use

5.1 This practice is valuable in determining the resistance of flexible-packaging materials to flex-formed pinhole failures. Conditioning levels A, B, or C are typically used for this evaluation.

5.2 This practice is valuable for determining the effect of flexing on barrier properties such as gas and/or moisture transmission rates. Conditioning levels D or E are typically used for this evaluation.

5.3 This practice does not measure any abrasion component relating to flex failure.

5.4 Failures in the integrity of one or more of the plies of a multi-ply structure may require different testing than the detection of holes completely through the structure. Permeation tests using gas or water vapor can be used in conjunction with the flex test to measure the loss of ply integrity. However, any permeation test requiring a pressure differential will not measure the permeation coefficient in the presence of pinholes. For a list of test methods refer to Guide F2097.

5.4.1 The various conditions described in this procedure are to prevent testing a structure under conditions that either give too many holes to effectively count (normally greater than 50), or too few to be significant (normally less than five per sample). Material structure, purpose for testing and a mutual agreement between parties involved are important points to consider in the selection of conditioning level for testing.

6. Apparatus

<u>6.1</u> *Flex Tester*, ³ designed so that it can be set up in accordance with the specifications listed in Section <u>89</u>. This apparatus shall consist essentially of a <u>90-mm (3.5-in.) 90 \pm 1-mm [3.5-in.] diameter stationary mandrel and a <u>90-mm 90 \pm 1 mm diameter</u></u>

³ The Gelbo Tester, which is capable of producing the prescribed flexing action, available from the United States Testing Co., Inc., 1415 Park Ave., Hoboken, NJ 07030, or its equivalent, has been found satisfactory for this test method.practice.

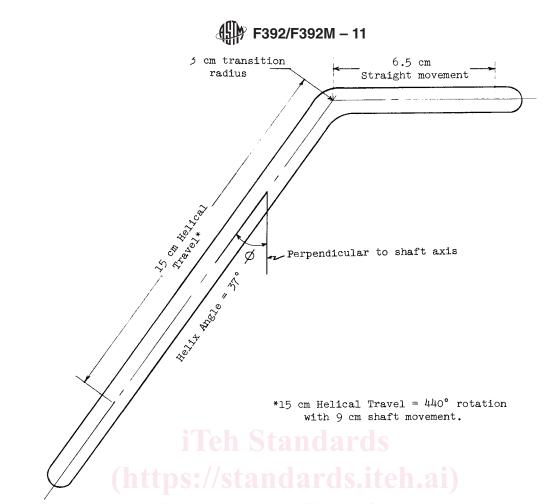


FIG. 1 Planar Evolution of Gelbo Shaft Helical Groove (310.870-mm ([1.250-in.]] Diameter Shaft)

movable mandrel spaced at a distance of $180 \pm 2 \text{ mm} (7 \text{ in.}] [7 \text{ in.}]}$ apart from face-to-face at the starting position (that is, maximum distance) of the stroke. Mandrels shall contain vents to prevent pressurization of samples. The specimen supporting shoulders on the mandrels shall be $13 \pm 1 \text{ mm} (0.5 \text{ in.}) [0.5 \text{ in.}]}$ wide. The motion of the movable mandrel is controlled by a grooved shaft to which it is attached. For the full or maximum stroke the groove is designed to give a twisting motion of $440 \pm 4^{\circ}$ in the first 90 mm of the stroke of the movable mandrel, followed by a straight horizontal motion of 65 mm (2.5 in.), [2.5 in.], so that at the closed position the mandrels are $25 \pm 1 \text{ mm} (1 \text{ in.}) [1 \text{ in.}]}$ apart. The motion of the machine is reciprocal with a full cycle consisting of the forward and return strokes. The machine operates at 45 ± 2 cpm.

5.1.16.1.1 Fig. 1 shows the planar evolution of the helical groove in the driven shaft to give the required 440° (37° helix angle) twisting motion and the straight horizontal motion.

5.1.2For 6.1.2 For the partial flex used with Condition E the movable head is set to travel only 80 mm (3.25 in.)[3.25 in.] of the 180-mm (7-in.)[7-in.] spacing. Therefore, only approximately 90 % of the twisting stroke is utilized giving a twisting motion of only 400°, and none of the horizontal stroke is utilized.

5.26.2 Tape, flexible, double-sided, pressure-sensitive, not more than 13 mm (0.5 in.) [0.5 in.] wide.

5.36.3 Template, for cutting 200 by 280-mm (8 by 11-in.) samples.

5.4Paint Brush, large, 50 to 150 mm wide.

5.5Tissue Paper, absorbent.

5.6White Paper, such as uncoated bond paper, at least as large as the film samples.

5.7Turpentine(Colored, Water-Free)—To 100 mL of pure gum spirits of turpentine (chemically pure grade, sp gr 0.860 to 0.875 at 15°C) add 5 g of anhydrous calcium chloride (CaCl₂) and 1.0 g of oil-soluble red dye. Stopper the container, shake well, and let stand for at least 10 h, shaking occasionally. Then filter through a dry filter paper at a temperature of approximately 21°C, and store in an airtight bottle.

Note1-Caution: Use of these materials requires that appropriate safeguards be used to avoid hazards of skin contact, inhalation, and flammability.

6.Test Specimens—All Conditions

6.1Cut the samples into 200 by 280-mm (8 by 11-in.) flat sheets with the 200-mm dimension in the direction to be tested. This will also be in the direction of the flex-tester axis.

6.2Flex test four specimens in their machine direction and four in their transverse direction. In addition, test a control set of four, adjacent, unflexed specimens (either direction) for pinholes.