

---

---

## Rubber, vulcanized or thermoplastic — Determination of low-temperature stiffening (Gehman test)

*Caoutchouc vulcanisé ou thermoplastique — Détermination de la  
rigidité à basse température (Essai Gehman)*

iTeh Standards  
(<https://standards.iteh.ai>)  
Document Preview

ISO 1432:2021

<https://standards.iteh.ai/catalog/standards/iso/a2f87cf9-963a-46c0-b375-9c2f0a89cfc0/iso-1432-2021>



iTeh Standards  
(<https://standards.iteh.ai>)  
Document Preview

ISO 1432:2021

<https://standards.iteh.ai/catalog/standards/iso/a2f87cf9-963a-46c0-b375-9c2f0a89cfc0/iso-1432-2021>



**COPYRIGHT PROTECTED DOCUMENT**

© ISO 2021

All rights reserved. Unless otherwise specified, or required in the context of its implementation, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office  
CP 401 • Ch. de Blandonnet 8  
CH-1214 Vernier, Geneva  
Phone: +41 22 749 01 11  
Email: [copyright@iso.org](mailto:copyright@iso.org)  
Website: [www.iso.org](http://www.iso.org)

Published in Switzerland

# Contents

Page

<b>Foreword</b>	<b>iv</b>
<b>1 Scope</b>	<b>1</b>
<b>2 Normative references</b>	<b>1</b>
<b>3 Terms and definitions</b>	<b>1</b>
<b>4 Principle</b>	<b>1</b>
<b>5 Apparatus</b>	<b>1</b>
<b>6 Calibration</b>	<b>3</b>
<b>7 Test piece</b>	<b>3</b>
7.1 Preparation of test piece	3
7.2 Conditioning of test piece	4
<b>8 Procedure</b>	<b>4</b>
8.1 Mounting of test piece	4
8.2 Stiffness measurements in liquid media	4
8.3 Stiffness measurements in gaseous media	5
8.3.1 General	5
8.3.2 Measurements	5
8.4 Crystallization	5
<b>9 Number of tests</b>	<b>5</b>
<b>10 Expression of results</b>	<b>5</b>
10.1 Torsional modulus	5
10.2 Relative modulus	6
10.3 Apparent torsional modulus of rigidity	7
<b>11 Precision</b>	<b>8</b>
<b>12 Test report</b>	<b>8</b>
<b>Annex A (normative) Calibration schedule</b>	<b>10</b>
<b>Annex B (informative) Precision</b>	<b>13</b>
<b>Bibliography</b>	<b>16</b>

## Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

The procedures used to develop this document and those intended for its further maintenance are described in the ISO/IEC Directives, Part 1. In particular, the different approval criteria needed for the different types of ISO documents should be noted. This document was drafted in accordance with the editorial rules of the ISO/IEC Directives, Part 2 (see [www.iso.org/directives](http://www.iso.org/directives)).

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights. Details of any patent rights identified during the development of the document will be in the Introduction and/or on the ISO list of patent declarations received (see [www.iso.org/patents](http://www.iso.org/patents)).

Any trade name used in this document is information given for the convenience of users and does not constitute an endorsement.

For an explanation of the voluntary nature of standards, the meaning of ISO specific terms and expressions related to conformity assessment, as well as information about ISO's adherence to the World Trade Organization (WTO) principles in the Technical Barriers to Trade (TBT), see [www.iso.org/iso/foreword.html](http://www.iso.org/iso/foreword.html).

This document was prepared by Technical Committee ISO/TC 45, *Rubber and rubber products*, Subcommittee SC 2, *Testing and analysis*.

This fifth edition cancels and replaces the fourth edition (ISO 1432:2013), which has been technically revised.

The main changes compared to the previous edition are as follows:

- in [Clause 2](#), normative references have been updated;
- a precision statement has been added as [Annex B](#).

Any feedback or questions on this document should be directed to the user's national standards body. A complete listing of these bodies can be found at [www.iso.org/members.html](http://www.iso.org/members.html).

# Rubber, vulcanized or thermoplastic — Determination of low-temperature stiffening (Gehman test)

**WARNING 1** — Persons using this document should be familiar with normal laboratory practice. This document does not purport to address all of the safety problems, if any, associated with its use. It is the responsibility of the user to establish appropriate safety and health practices and to determine the applicability of any other restrictions.

**WARNING 2** — Certain procedures specified in this document might involve the use or generation of substances, or the generation of waste, that could constitute a local environmental hazard. Reference should be made to appropriate documentation on safe handling and disposal after use.

## 1 Scope

This document specifies a static procedure, known as the Gehman test, for determining the relative stiffness characteristics of vulcanized or thermoplastic rubbers over a temperature range from room temperature to approximately  $-120\text{ }^{\circ}\text{C}$ .

## 2 Normative references

The following documents are referred to in the text in such a way that some or all of their content constitutes requirements of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 18899:2013, *Rubber — Guide to the calibration of test equipment*

ISO 23529, *Rubber — General procedures for preparing and conditioning test pieces for physical test methods*

## 3 Terms and definitions

No terms and definitions are listed in this document.

ISO and IEC maintain terminological databases for use in standardization at the following addresses:

- ISO Online browsing platform: available at <https://www.iso.org/obp>
- IEC Electropedia: available at <http://www.electropedia.org/>


## 4 Principle

The torsional stiffness is measured as a function of temperature, starting from a low temperature. The stiffness is measured by connecting the test piece in series with a calibrated spring wire and measuring the angle of twist of the test piece when the top of the wire is turned  $180^{\circ}$ .

## 5 Apparatus

**5.1 Torsion apparatus**, consisting of a torsion head, capable of being turned  $180^{\circ}$  in a plane normal to the torsion wire. The top of the wire is fastened to the torsion head. The bottom of the wire is fastened to the test piece clamp. A device for “friction-free” indication or recording of angle by mechanical or electrical means shall be provided, permitting convenient and exact adjustment of the zero point. The indicating or recording system shall allow reading or recording of the angle of twist to the nearest degree. This principle is shown in [Figure 1](#).

**5.2 Torsion wires**, made of tempered spring wire, of a length of  $65 \text{ mm} \pm 8 \text{ mm}$ , and having nominal torsional constants of  $0,7 \text{ mN}\cdot\text{m}$ ,  $2,8 \text{ mN}\cdot\text{m}$  and  $11,2 \text{ mN}\cdot\text{m}$ . In cases of dispute, the  $2,8 \text{ mN}\cdot\text{m}$  wire shall be used.

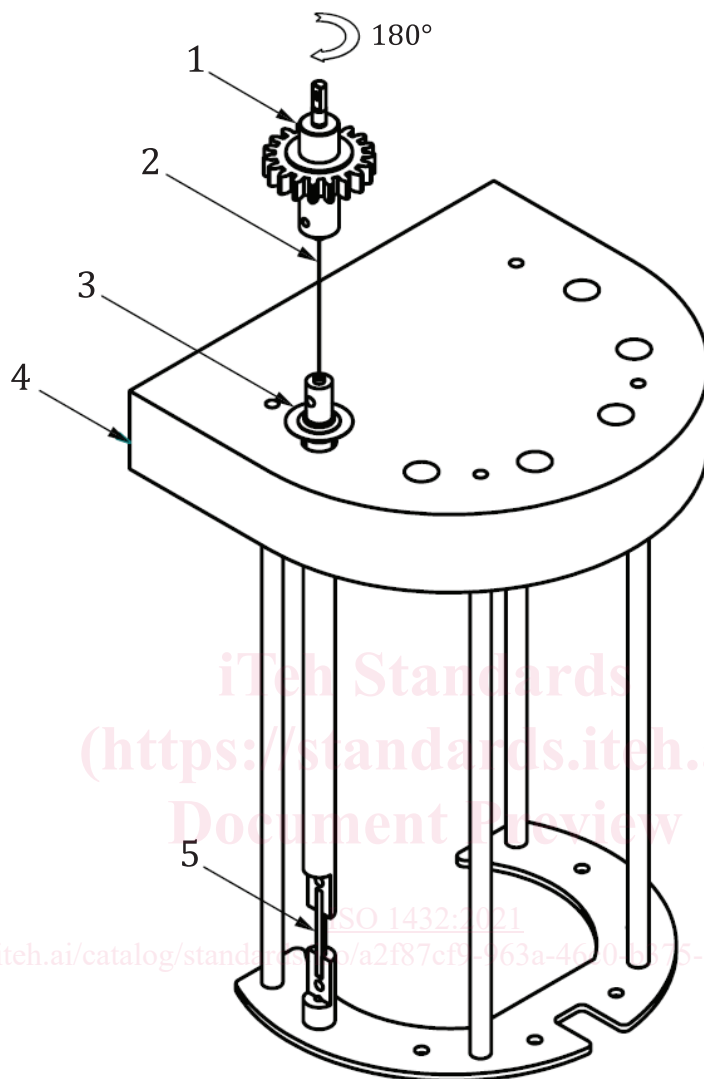

**Key**

- 1 torsion head
- 2 torsion wire
- 3 angle measurement
- 4 test piece rack
- 5 test piece

**Figure 1 — Principle of a torsion apparatus**

**5.3 Test piece rack**, made of material of poor thermal conductivity, for holding the test piece in a vertical position in the heat transfer medium. The rack may be constructed to hold several test pieces. The rack is attached to a stand. It is advantageous to make the vertical portion of the stand from material

of poor thermal conductivity. The base of the stand shall be of stainless steel or other corrosion-resistant material.

Two clamps shall be provided for holding each test piece. The bottom clamp shall be attached to the test piece rack. The top clamp acts as an extension of the test piece and is connected to the torsion wire by a rod.

**5.4 Heat-transfer medium**, liquid or gaseous, which remains fluid at the test temperature and which does not appreciably affect the material being tested, as prescribed in ISO 23529.

Gases may be employed as the heat transfer medium provided the design of the apparatus is such that results obtained using them duplicate those obtained with liquids.

NOTE The following fluids have been used satisfactorily:

- a) for temperatures down to  $-60\text{ }^{\circ}\text{C}$ , silicone fluids of kinematic viscosity of about  $5\text{ mm}^2/\text{s}$  at ambient temperature, which are usually suitable owing to their chemical inertness towards rubbers, their non-flammability and their non-toxicity;
- b) for temperatures down to  $-73\text{ }^{\circ}\text{C}$ , ethanol;
- c) for temperatures down to  $-120\text{ }^{\circ}\text{C}$ , methylcyclohexane cooled by liquid nitrogen (found to be satisfactory with the use of suitable apparatus).

**5.5 Temperature-measuring device**, capable of measuring temperature to within  $0,5\text{ }^{\circ}\text{C}$  over the whole range of temperature over which the apparatus is to be used.

The temperature sensor shall be positioned near the test pieces.

**5.6 Temperature control**, capable of raising the temperature as per [8.2](#) and [8.3](#) and maintaining the temperature of the heat-transfer medium to within  $\pm 1\text{ }^{\circ}\text{C}$ .

**5.7 Container for heat-transfer medium**, a bath for a liquid medium, or a test chamber for a gaseous medium, with means of heating and cooling the coolant to the minimum temperature required.

**5.8 Stirrer**, for liquids, or **fan** or **blower**, for gases, which ensures thorough circulation of the heat-transfer medium. It is important that the stirrer also moves the liquid vertically to ensure a uniform temperature in the liquid.

**5.9 Stopwatch**, or other timing device, graduated in seconds.

## 6 Calibration

The requirements for calibration of the test apparatus are given in [Annex A](#).

## 7 Test piece

### 7.1 Preparation of test piece

Test pieces shall be prepared in accordance with ISO 23529.

The dimensions of the test piece shall be: length  $40\text{ mm} \pm 2,5\text{ mm}$ , width  $3\text{ mm} \pm 0,2\text{ mm}$  and thickness  $2\text{ mm} \pm 0,2\text{ mm}$ . It shall be moulded or cut with a suitable die from a moulded sheet of suitable thickness.

## 7.2 Conditioning of test piece

**7.2.1** The minimum time between forming and testing shall be 16 h.

For non-product tests, the maximum time between forming and testing shall be 4 weeks and, for evaluations intended to be comparable, the tests should be carried out, as far as possible, after the same time interval.

For product tests, whenever possible, the time between forming and testing should not exceed 3 months. In other cases, tests shall be made within 2 months of the date of receipt by the customer of the product.

**7.2.2** Samples and test pieces shall be protected from light as much as possible during the interval between forming and testing.

**7.2.3** Prepared test pieces shall be conditioned in accordance with ISO 23529 immediately before testing for a minimum of 3 h at a standard laboratory temperature, the same temperature being used throughout any one test or series of tests intended to be comparable.

## 8 Procedure

### 8.1 Mounting of test piece

Clamp each test piece used in such a manner that  $25 \text{ mm} \pm 3 \text{ mm}$  of the test piece is free between the clamps. The test piece clamp shall be located in such a position that the specimen is under zero torque or with a slight pre-load to keep the test piece straight when the temperature changes.

If the absolute modulus is required, measure the test length of the test pieces to the nearest 0,5 mm, the width to the nearest 0,1 mm and the thickness to the nearest 0,01 mm.

### 8.2 Stiffness measurements in liquid media

Make the reference measurement with the standard torsion wire ( $2,8 \text{ mN}\cdot\text{m}$ ) at  $23 \text{ }^{\circ}\text{C} \pm 2 \text{ }^{\circ}\text{C}$ , either in air or in the liquid bath.

Place the rack containing the test pieces in the liquid bath with a minimum of 25 mm of liquid covering the test pieces.

Adjust the angle measuring device to zero. Then turn all test pieces at the same time, or in sequence, quickly but smoothly, through  $180^{\circ}$  and record the torsion angle after 10 s. If the test pieces are measured in sequence, ensure that all the measurements are completed within approximately 2 min. If the reading at  $23 \text{ }^{\circ}\text{C}$  does not fall in the range of  $120^{\circ}$  to  $170^{\circ}$ , the standard torsion wire is not suitable for testing the test piece. Test pieces producing twists of more than  $170^{\circ}$  shall be tested with a wire having a torsional constant of  $0,7 \text{ mN}\cdot\text{m}$ . Test pieces producing twists of less than  $120^{\circ}$  shall be tested with a wire having a torsional constant of  $11,2 \text{ mN}\cdot\text{m}$ .

Remove the test pieces from the liquid bath (assuming the reference measurement has been made in liquid) and adjust the temperature of the liquid to the lowest temperature desired.

Place the test pieces in the bath with a minimum of 25 mm of liquid covering the test pieces and maintain them at this temperature for approximately 15 min.

Then increase the bath temperature by one of the two following methods:

- a) stepwise by  $5 \text{ }^{\circ}\text{C}$  intervals, each increase being made after approximately 5 min;
- b) continuously with a heating rate of about  $1 \text{ }^{\circ}\text{C}/\text{min}$ .



Make the stiffness measurements in the stepwise case after conditioning the test piece for 5 min at each temperature and in the continuous case at intervals of 1 min maximum. Continue the tests until a temperature is reached at which the angular twist is within 5° to 10° of the twist at 23 °C.

Record the angle of twist and the temperature at each measurement.

The relative modulus may be plotted on a graph during the test.

### 8.3 Stiffness measurements in gaseous media

#### 8.3.1 General

Procedures with air, carbon dioxide or nitrogen differ from those with liquid media only in that the cooling is done with the test pieces in the medium and the length of the conditioning period is different.

#### 8.3.2 Measurements

With the test pieces in the test chamber, adjust the temperature of the chamber to the lowest temperature desired in approximately 30 min. After this temperature has been maintained constant for 10 min, make the measurements in a similar way to those in the liquid media, ensuring that all the test pieces in the rack are tested within 2 min.

Then increase the chamber temperature by one of the two following methods:

- a) stepwise by 5 °C intervals, each increase being made after approximately 10 min;
- b) continuously with a heating rate of about 1 °C/min.

Make the stiffness measurements in the stepwise case after conditioning the test piece for 10 min at each temperature and, in the continuous case, at intervals of 1 min maximum. Continue the tests until a temperature is reached at which the angular twist is within 5° to 10° of the twist at 23 °C.

Record the angle of twist and the temperature at each measurement.

The relative modulus may be plotted on a graph during the test.

### 8.4 Crystallization

When it is desired to study crystallization or plasticizer effects, the time of conditioning at the desired temperature should be increased.

## 9 Number of tests

At least three test pieces of each material shall be tested. It is good practice to include a control rubber with known twist/temperature characteristics.

## 10 Expression of results

### 10.1 Torsional modulus

The torsional modulus of the test piece at any temperature is proportional to the quantity

$$\frac{180-\alpha}{\alpha}$$

where  $\alpha$  is the angle of twist, in degrees, of the test piece.

## 10.2 Relative modulus

The relative modulus at any temperature is the ratio of the torsional modulus at that temperature to the torsional modulus at 23 °C.

The value of the relative modulus for any temperature is readily determined from the angles of twist at that temperature and at 23 °C, and the ratio of the values of the factor  $(180 - \alpha)/\alpha$  corresponding to those angles.

The temperatures at which the relative modulus is 2; 5; 10 and 100, respectively, are determined using Table 1 and the twist versus temperature values for the test piece. The first column of Table 1 lists each degree of twist in the range of 120° to 170°, so that the value corresponding to the twist of the test piece at 23 °C can be selected.

Successive columns give the twist angles which correspond to values 2; 5; 10 and 100, respectively, for the relative modulus. The temperatures corresponding to these angles are designated as  $t_2$ ,  $t_5$ ,  $t_{10}$  and  $t_{100}$ , respectively.

**Table 1 — Twist angles for designated values of the relative modulus (RM)**

Twist angle, $\alpha$ , in degrees at 23 °C	Twist angle, $\alpha$ , in degrees for relative modulus (RM)			
	RM = 2	RM = 5	RM = 10	RM = 100
120	90	51	30	3
121	91	52	31	4
122	92	53	31	4
123	93	54	32	4
124	95	55	33	4
125	96	56	33	4
126	97	57	34	4
127	98	58	35	4
128	99	59	36	4
129	101	61	36	5
130	102	62	37	5
131	103	63	38	5
132	104	64	39	5
133	105	65	40	5
134	107	66	41	5
135	108	68	42	5
136	109	69	42	5
137	111	70	43	6
138	112	71	45	6
139	113	72	46	6
140	114	74	47	6
141	116	75	48	6
142	117	77	49	7
143	119	78	50	7
144	120	80	51	7
145	121	82	53	7
146	123	83	54	7
147	124	85	55	7
148	126	87	57	8
149	127	88	58	8
150	129	90	60	9
151	130	92	62	9
152	132	94	62	9
153	133	96	65	10
154	134	97	67	10
155	136	100	69	11