

E2303:11^{e1}



ISO/ASTM 52303 – 2015(E)

An American National Standard

Standard Guide for Absorbed-Dose Mapping in Radiation Processing Facilities¹

This standard is issued under the fixed designation ~~E2303~~; ISO/ASTM 52303; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

^{e1} NOTE—Editorial changes were made throughout in December 2012.

1. Scope

1.1 This document provides guidance in determining absorbed-dose distributions (mapping) in products, materials or substances irradiated in gamma, X-ray (bremsstrahlung) and electron beam facilities.

NOTE 1—For irradiation of food and the radiation sterilization of health care products, specific ISO and ISO/ASTM standards containing dose mapping requirements exist. See ISO/ASTM Practices 51431, 51608, 51649, 51702 and 51818 and ISO 11137-1. Regarding the radiation sterilization of health care products, in those areas covered by ISO 11137-1, that standard takes precedence.

1.2 This guide is one of a set of standards that provides recommendations for properly implementing dosimetry in radiation processing, it is intended to be read in conjunction with ~~ASTM Practice ISO/ASTM E2628~~ISO/ASTM E2628~~52628~~.

1.3 Methods of analyzing the dose map data are described. Examples are provided of statistical methods that may be used to analyze dose map data.

1.4 Dose mapping for bulk flow processing and fluid streams is not discussed.

1.5 Dosimetry is an element of a total quality management system for an irradiation facility. Other controls besides dosimetry may be required for specific applications such as medical device sterilization and food preservation.

1.6 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory requirements prior to use.*

2. Referenced Documents

2.1 ASTM Standards:²

E170 Terminology Relating to Radiation Measurements and Dosimetry

E178 Practice for Dealing With Outlying Observations

E2232 Guide for Selection and Use of Mathematical Methods for Calculating Absorbed Dose in Radiation Processing Applications

~~E2628 Practice for Dosimetry in Radiation Processing~~

2.2 ISO/ASTM Standards:²

51261 Guide for Selection and Calibration of Dosimetry Systems for Radiation Processing

51431 Practice for Dosimetry in Electron Beam and X-Ray (Bremsstrahlung) Irradiation Facilities for Food Processing

51608 Practice for Dosimetry in an X-ray (Bremsstrahlung) Facility for Radiation Processing

51649 Practice for Dosimetry in an Electron Beam Facility for Radiation Processing at Energies between 300 keV and 25 MeV

51702 Practice for Dosimetry in a Gamma Irradiation Facility for Radiation Processing

51707 Guide for Estimating Uncertainties in Dosimetry for Radiation Processing

51818 Practice for Dosimetry in an Electron Beam Facility for Radiation Processing at Energies between 80 and 300 keV

52628 Practice for Dosimetry in Radiation Processing

¹ This guide is under the jurisdiction of ASTM Committee E61 on Radiation Processing, and is the direct responsibility of Subcommittee E61.03 on Dosimetry Application, and is also under the jurisdiction of ISO/TC 85/WG 3.

Current edition approved July 1, 2011; Feb. 9, 2015. Published August 2011. Originally approved in 2003; June 2015. Originally published as ASTM E2303-03. Last previous ASTM edition E2303 approved 11^{e1} in 2003 as. The present International E2303-03. DOI: 10.1520/E2303-11E01. Standard ISO/ASTM 52303-2015(E) replaces ASTM E2303-11^{e1}.

² For referenced ASTM and ISO/ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

2.3 *International Commission on Radiation Units and Measurements Reports*:³

ICRU Report 6085a Fundamental Quantities and Units for Ionizing Radiation

2.4 *International Organization for Standardization*:⁴

ISO 11137-1 Sterilization of health care products – Radiation – Part 1: Requirements for development, validation, and routine control of a sterilization process for medical devices

GUM Guide to the Expression of Uncertainty in Measurement, 1995, ISBN 92-6710188-9

VIM International Vocabulary of Basic and General Terms in Metrology

2.5 *Joint Committee for Guides in Metrology (JCGM) Reports*:

JCGM 100:2008 GUM 1995, with minor corrections, Evaluation of measurement data – Guide to the expression of uncertainty in measurement⁵

JCGM 200:2012, VIM International vocabulary of metrology – Basis and general concepts and associated terms⁶

3. Terminology

3.1 Definitions:

3.1.1 *absorbed-dose mapping*—measurement of absorbed dose within an irradiated product to produce a one-, two- or three-dimensional distribution map of absorbed dose.

³ Available from International Commission on Radiation Units and Measurements, 7910 Woodmont Ave., Suite 800, Bethesda, MD 20814.

⁴ Available from International Organization for Standardization (ISO), 1 rue de Varembé, Case postale 56, CH-1211, Geneva 20, Switzerland.

⁵ Document produced by Working Group 1 of the Joint Committee for Guides in Metrology (JCGM/WG 1). Available free of charge at the BIPM website (<http://www.bipm.org>).

⁶ Document produced by Working Group 2 of the Joint Committee for Guides in Metrology (JCGM/WG 2). Available free of charge at the BIPM website (<http://www.bipm.org>).

3.1.1.1 Discussion—

For a process load, such a dose map is obtained using dosimeters placed at specified locations within the process load.

3.1.2 *calibration curve (VIM:2008)*—expression of the relation between indication and corresponding measured quantity value.

3.1.2.1 Discussion—

In radiation processing standards, the term “dosimeter response” is generally used for “indication.”

3.1.3 *dose map, dose mapping*—see *absorbed-dose mapping*. [STMS52303-15](https://standards.iteh.ai/STMS52303-15)

3.1.4 *dose uniformity ratio*—ratio of the maximum to the minimum absorbed dose within the irradiated product. [STMS52303-15](https://standards.iteh.ai/STMS52303-15)

3.1.4.1 Discussion—

The concept is also referred to as the max/min dose ratio. Product generally refers to the “process load.”

3.1.5 *dose zone*—a region or discrete point(s) within a process load that receives the same absorbed dose within the statistical uncertainty of the irradiation process and absorbed-dose measurement(s).

3.1.6 *installation qualification (IQ)*—process of obtaining and documenting evidence that equipment has been provided and installed in accordance with its specification.

3.1.7 *irradiation container*—holder in which process load is transported through the irradiator.

3.1.7.1 Discussion—

“Irradiation container” is often referred to simply as “container” and can be a carrier, cart, tray, product carton, pallet, product package or other holder.

3.1.8 *operational qualification (OQ)*—process of obtaining and documenting evidence that installed equipment operates within predetermined limits when used in accordance with its operational procedures.

3.1.9 *performance qualification (PQ)*—process of obtaining and documenting evidence that the equipment, as installed and operated in accordance with operational procedures, consistently performs in accordance with predetermined criteria and thereby yields product meeting its specification.

3.1.10 *process load*—a volume of material with a specified product loading configuration irradiated as a single entity.

3.1.11 *processing category*—group of different product that can be processed together.

3.1.11.1 Discussion—

Processing categories can be based on, for instance, composition, density or dose requirements.

3.1.12 *reference material*—homogeneous material of known radiation absorption and scattering properties used to establish characteristics of the irradiation process, such as scan uniformity, depth-dose distribution, throughput rate, and reproducibility of dose delivery.

3.1.13 *routine monitoring position*—position where absorbed dose is monitored during routine processing to ensure that the product is receiving the absorbed dose specified for the process.

3.1.13.1 Discussion—

This position may be a location of minimum or maximum dose in the process load or it may be an alternate convenient location in, on or near the process load where the relationship of the dose at this position with the minimum and maximum dose has been established.

3.1.14 *simulated product*—material with attenuation absorption and scattering properties similar to those of the product, material or substance to be irradiated.

3.1.14.1 Discussion—

Simulated product is used during irradiator characterization as a substitute for the actual product, material or substance to be irradiated. When used in routine production runs in order to compensate for the absence of product, simulated product is sometimes referred to as compensating dummy. When used for absorbed-dose mapping, simulated product is sometimes referred to as phantom material.

3.2 Definitions of other terms used in this standard that pertain to radiation measurement and dosimetry may be found in Terminology E170. Definitions in E170 are compatible with ICRU Report 60; that document, therefore, may be used as an alternative reference.

4. Significance and Use

4.1 This guide is one of a set of guides and practices that provide recommendations for properly implementing dosimetry in radiation processing. In order to understand and effectively use this and other dosimetry standards, consider first “Practice for Dosimetry in Radiation Processing,” ASTM Practice ASTM/ISO E262852628, which describes the basic requirements that apply when making absorbed dose measurements in accordance with the ASTM E10.01 series of dosimetry standards. In addition, ASTM Practice ASTM/ISO E262852628 provides guidance on the selection of dosimetry systems and directs the user to other standards that provide information on individual dosimetry systems, calibration methods, uncertainty estimation and radiation processing applications.

4.2 Radiation processing is carried out under fixed path conditions where (a) a process load is automatically moved through the radiation field by mechanical means or (b) a process load is irradiated statically by manually placing product at predetermined positions before the process is started. In both cases the process is controlled in such a manner that the process load position(s) and orientation(s) are reproducible within specified limits.

NOTE 2—Static irradiation encompasses irradiation of the process load using either manual rotation, no rotation or automated rotation.

4.3 Some radiation processing facilities that utilize a fixed conveyor path for routine processing may also characterize a region within the radiation field for static radiation processing, sometimes referred to as “Off Carrier” processing.

4.4 Many radiation processing applications require a minimum absorbed dose (to achieve a desired effect or to fulfill a legal requirement), and a maximum absorbed dose (to ensure that the product, material or substance still meets functional specifications or to fulfill a legal requirement).

4.5 Information from the dose mapping is used to:

4.5.1 Characterize the radiation process and assess the reproducibility of absorbed-dose values, which may be used as part of operational qualification and performance qualification.

4.5.2 Determine the spatial distribution of absorbed doses and the zone(s) of maximum and minimum absorbed doses throughout a process load, which may consist of an actual or simulated product.

4.5.3 Establish the relationship between the dose at a routine monitoring position and the dose within the minimum and maximum dose zones established for a process load.

4.5.4 Verify mathematical dose calculation methods. See ASTM Guide E2232.

4.5.5 Determine the effect of process interruptions on the distribution of absorbed dose and the magnitude of the minimum and maximum doses.

4.5.6 Assess the impact on the distribution of absorbed dose and the magnitude of the minimum and maximum doses resulting from the transition from one process load to another where changes, for example, in product density or product loading pattern may occur.

5. Prerequisites

5.1 *Prerequisites to Dose Mapping: Installation Qualification and Dosimetry System Calibration:*

5.1.1 Prior to performing dose mapping for irradiator operational qualification (OO) and performance qualification (PQ), confirm that installation qualification (IQ) is complete.

5.1.1.1 For electron beam and X-ray irradiation facilities, IQ includes dosimetric testing to confirm the characteristics of the beam (electron energy, average beam current, and if applicable, scan width and scan uniformity). Refer to ISO/ASTM 51431, 51608, 51818, 51649 and ISO 11137-1.

5.1.1.2 For gamma irradiation facilities, dosimetric testing is not required during IQ; however, the activity of the source and location of the individual components of the source should be confirmed and documented. Refer to ISO/ASTM 51702 and ISO 11137-1.

5.1.2 Select an appropriate dosimetry system(s) for the dose mapping exercises. See 6.2.4.1 and ASTM Practice ISO/ASTM E2628/52628 for guidance.

5.2 *Calibration of the Dosimetry System:*

5.2.1 Prior to use, the dosimetry system, consisting of dosimeters measurement instruments and their associated reference standards, and procedures for the system's use, should be calibrated in accordance with the user's documented procedure that specifies details of the calibration process and quality assurance requirements. Calibration methods are described in ISO/ASTM 51261.

NOTE 3—A dosimetry system calibration obtained using irradiation conditions different from the conditions of use may be used for relative dose measurement applications. For example, an irradiation facility may perform a lab-based calibration with subsequent verification using reference standard dosimeters under the conditions of use. While dose mapping at the irradiation facility may be performed using dose values from the lab-based calibration (prior to completing the verification exercise) to assess the dose distribution and locations of minimum and maximum absorbed dose, these dose measurements would be considered preliminary (i.e. relative) pending the outcome of the verification exercise.

5.2.2 For the calibration of the instruments, and for the verification of instrument performance between calibrations, see ISO/ASTM 51261 or instrument-specific operating manuals, or both.

6. Dose Mapping

6.1 *Dose Mapping for Operational Qualification of the Irradiation Facility:*

6.1.1 As specified in ISO/ASTM Practices 51431, 51608, 51649, 51702, and ISO 11137-1, perform irradiation facility dose mapping to characterize the irradiator with respect to the dose distribution and reproducibility of absorbed dose delivery. This should be performed in accordance with a formal validation program, and should cover the operational range that will be used in the irradiation of products.

6.1.2 Perform irradiation facility dose mapping by placing dosimeters in a number of process loads of reference material that fills the container to its design volume limits. The number of process loads to be dose mapped should be large enough (3 or more) to determine the variability of dose. For those irradiation facilities that vary operating parameters which impact dose distribution, dose mapping should be carried out over a range of selected operating parameters which cover the operational limits to be used in the irradiation of products.

6.1.2.1 *Specific to Photon-based Facilities (gamma or X-ray)*—Material densities should be within the density range for which the irradiator is to be used. When processing multiple densities, dose mapping should be done for at least two densities close to the minimum and maximum density to be processed to assess the impact density has on the magnitude and distribution of the absorbed dose. A user may consider dose mapping for additional intermediate densities to gain additional performance information.

6.1.2.2 *Specific to Electron Beam Facilities*—For irradiation facility dose mapping, use one or more reference materials having densities within the density range for which the irradiator is to be used.


6.1.2.3 Determine absorbed-dose distribution throughout the process load for each product path through the irradiation field and each set of process parameters.

NOTE 4—Additional ways to influence the absorbed-dose distribution within a given process load include: performing single- versus double-sided irradiation in electron beam and X-ray facilities, or using multiple source rack(s) or source rack positioning changes in gamma irradiators.

6.1.2.4 For each process load, place a sufficient number of dosimeters in an array to determine the absorbed-dose distribution. Dosimeter strips or sheets may be used to increase the spatial resolution of the dose map. An example of dosimeter placement array is given in Fig. 1.

6.1.2.5 Measure the dose at the same positions in three or more replicate process loads to determine the variability of the measured absorbed dose and absorbed-dose distribution for each product path and set of process parameters.

(1) For process loads transported through the irradiation field, a sufficient number of similar process loads should precede and follow those being dose mapped to minimize variations on the absorbed-dose distribution in the dose-mapped process loads.

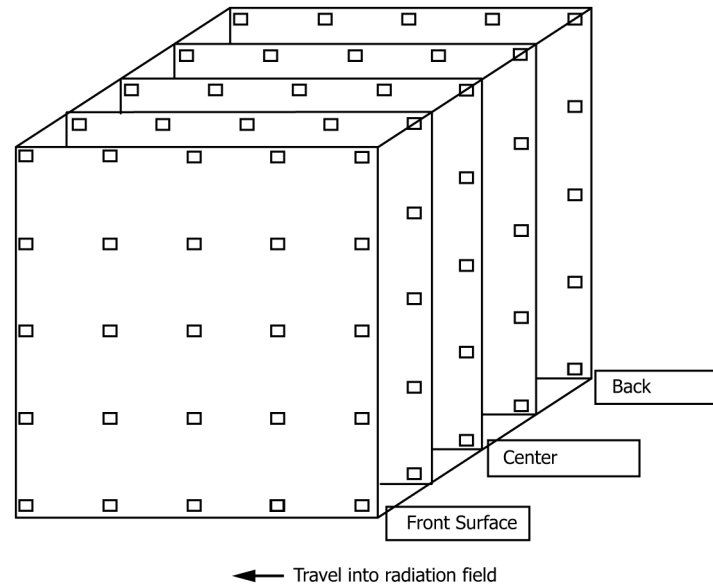

NOTE 1—In this drawing the small squares represent dosimeter positions. The “Front” is defined as the initial and in some cases only surface to directly face the radiation source during processing. The number of dosimeters and the number of planes (surfaces) to be mapped will depend on several factors, including but not limited to, the radiation type (electrons versus photons), single- versus double-sided irradiation, and resolution of absorbed dose required.

FIG. 1 An Example of a Dosimeter Placement Array in a Three-Dimensional Grid Pattern for an Operational Qualification Dose Mapping

(2) Depending on the irradiator design, additional dose map studies may be needed to determine effects on dose and dose distribution associated with changes during processing in process loading configurations and their density (sometimes referred to as “phase-in and phase-out” effects). The effect of density changes on dose and dose distribution can be evaluated by irradiating two different density process loads sequentially and dose mapping the last process load of the one density and the first process load of the second density and comparing these results against the results obtained from the uniform density dose map described in 6.1.2.5, (1).

(3) If OQ measurements show that effects of “phase-in/phase-out” may exist, then the effect on actual product may also have to be assessed during PQ (see 6.2.5.1).

6.1.2.6 Following irradiation, retrieve and measure the response of each dosimeter, and evaluate the data in accordance with established procedures (see Section 7).

6.1.3 If changes are made to the irradiation system that could affect the absorbed-dose or absorbed-dose distribution, it may be necessary to repeat the dose mapping.

NOTE 5—ISO 11137-1 provides additional guidance regarding changes to the irradiation system and recommended post-change qualification activities.

6.1.4 The use of mathematical models in determining dosimeter locations for dose mapping or in predicting dose map results may be useful. See Guide E2232 for guidance.

6.2 Dose Mapping for Performance Qualification of Process Loads

6.2.1 Perform dose mapping for specific products and load configurations to determine the dose distribution expected during the routine processing of process loads. Products, materials or substances should be actual product or may be simulated product of materials with similar density, distributions and packaging configuration as the actual products.

6.2.2 If a routine monitoring position is used for process monitoring, the relationships between minimum dose, maximum dose and the dose at the routine monitoring position should be established.

6.2.3 Specify a loading pattern that describes the products, materials or substances contained within the process load, including dimensions, mass or density, and if applicable, the orientation of the product within the process load as well as the orientation of the process load itself with respect to the radiation field.

6.2.4 Specify or determine the location of the dosimeters used for the dose map, taking into consideration voids, density variations or any material interfaces that may cause significant localized dose gradients that could affect the location of minimum or maximum dose, or both, within the process load.

6.2.4.1 Use dosimeters capable of measuring any localized dose gradients and of a size that does not significantly influence the radiation field or the interpretation of absorbed-dose measurements.

6.2.4.2 Process loads containing voids, density variations or materials interfaces that could cause localized dose gradients require that the dosimeters be placed directly on the material surfaces. Selection of the dosimeter positions for dose mapping should include areas of suspected high dose gradients based on a physical assessment of the materials and their composition that make

up the process load being dose mapped. These positions may be concentrated in the expected zones of minimum or maximum dose, or both, known from the irradiator operational qualification (OQ) dose map. Heterogeneous products such as metal implants or certain foods may require placement of appropriately sized dosimeters positioned at internal locations within the individual products. This may involve cutting open the individual product inside the package to permit dosimeter positioning and retrieval, or removal of dosimeters from their protective packaging to facilitate dosimeter placement. The latter requires assurances that the dosimeters can be characterized and perform acceptably when used without protective packaging.

NOTE 6—When dosimeters are calibrated in their protective packaging but used outside the packaging for a specific application, this usage may alter the calibrated state of the dosimeters. The impact on absorbed-dose measurement for this usage should be assessed.

6.2.4.3 The use of mathematical models in determining dosimeter locations for dose mapping or in predicting dose map results may be useful. See Guide E2232 for guidance.

6.2.5 Measure the dose at the same position(s) in the maximum and minimum dose zones in three or more process loads to determine the variability of the absorbed-dose delivery and measurements. Each process load should contain similar materials and dosimeter placements that are configured in the same way and should be processed under the same operating conditions.

6.2.5.1 A sufficient number of process loads should precede and follow the dose mapped process loads to minimize phase-in/out effects (see 6.1.2.5, Item 1).

6.2.6 Doses outside of the product dose specification are acceptable for dose mapping purposes. See Note 9 in 7.2.4 for additional discussion.

6.2.7 Repeat the dose mapping procedure if a change is made to the product or the irradiation facility that may impact the previously characterized dose distribution.

6.2.8 If measurements done according to 6.1.3 lead to the conclusion that dose or dose distribution has changed, then repeat of product dose map is needed.

6.2.9 Practical considerations for Product Dose Mapping (see 6.2.1).

6.2.9.1 Facilities typically irradiate a variety of products and dose mapping of all products may be impractical. If products have similar loading configurations and are known to have densities and radiation absorption characteristic equivalent to a product (actual or simulated) that has already been dose mapped, then it is not necessary to perform dose mapping for them, and a processing category can be established consisting of product that can be irradiated together.

6.2.9.2 Criteria for including product in processing categories shall be documented, and should include:

- (1) dimension of the process load
- (2) weight of the process load
- (3) density of the process load
- (4) composition of the product
- (5) orientation of the product items with the process load
- (6) number of product items within the process load
- (7) the required minimum dose
- (8) the maximum acceptable dose

6.2.9.3 If facilities irradiate only process loads that can be demonstrated to have the same dose distribution characteristics as those used in the operational qualification (OQ) dose mapping(s) discussed in 6.1, then it is not necessary to conduct performance qualification (PQ) dose mapping.

6.3 *Other Dose Mapping Studies*—The dynamics of routine processing may require additional studies relevant to each processing path be performed during operational or performance qualification, or both, to further characterize irradiator performance and its impact on the magnitude and distribution of absorbed dose. The number of studies required will generally depend on the specific irradiation system; however, selected studies common to many irradiation systems, including process interruption, partially-filled irradiation containers, and center-loading of product in irradiation containers, are described in the following sections.

6.3.1 *Process Interruption*—The result of intentional or unintentional stoppage of the irradiation process. The process interruption and subsequent restart of the irradiation process can impact the absorbed dose delivered to the product. For many gamma irradiators, this typically means irradiation containers remain stationary while the source transitions between the fully raised and storage positions, which contributes additional dose to product. For many electron beam and X-ray irradiators, a system shutdown may impact the irradiation source or the product conveyor system, or both, and the impact on the absorbed-dose distribution will depend on whether one or both systems shut down. In order to assess the effect of process interruption on the absorbed dose delivered to the product, a dose map should be performed.

6.3.1.1 For gamma irradiators where product is conveyed in containers through a defined irradiation path, the dose map would generally require:

- (1) placement of dosimeters in process loads closest to the source (during interruption), where dose is expected to be most influenced by source transitions,
- (2) raising and lowering the source (while containers remain stationary) a sufficient number of times to ensure the dose measured by the dosimeters is within its calibrated range, and